
FLAMENTY-GIAVARA ASSOCIATES NEW HAVEN CT F/G 13/13 NATIONAL DAM SAFETY PROGRAM. NORWICH RESERVOIR NUMBER 2 DAM (10m-etc(U) AUG 81 H C FLAMENTY DAGWS1-81-C-0006 AD-A107 414 DACW51-81-C-0006 UNCLASSIFIED NL ' 1 .. 3 A. 7414



SUSQUEHANNA RIVER BASIN

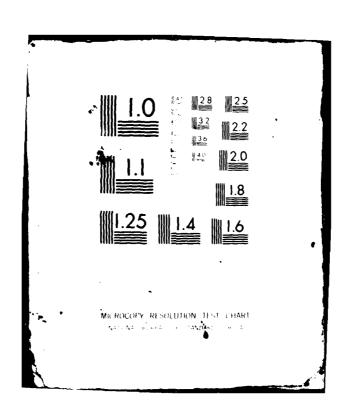

LEVEL

NORWICH RESERVOIR NO. 2 DAM

CHENANGO COUNTY, NEW YORK INVENTORY No. NY 349

PHASE I INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM

THE DOCUMENT AS A STORY OF PAGES WHICH DO NOT REPRODUCE LEGIBLY,





D

FILE COPY

APPROVED FOR PUBLIC RELEASE.

DISTRIBUTION UNLIMITED

NEW YORK DISTRICT, CORPS OF ENGINEERS MAY 1981

81 11 13 080

DISCLAIMER NOTICE

THIS DOCUMENT IS BEST QUALITY PRACTICABLE. THE COPY FURNISHED TO DTIC CONTAINED A SIGNIFICANT NUMBER OF PAGES WHICH DO NOT REPRODUCE LEGIBLY.

SECURITY CLASSIFICATION OF THIS PAGE (Mine Date Entered READ INSTRUCTIONS REPORT DOCUMENTATION PACE BEFORE COMPLETING FORM 2. GOVY ACCESSION NO. 3. RECIPIENT'S CATALOG HUHZER TYPE OF REPORT & PERIOD COVERED 4. TITLE (and Subilite) Phase I Inspection Report Phase I Inspection Report Norwich Reservoir No. 2 Dam National Dam Safety Program Sqsquehanna River Basin, Chenango County, N.Y. 6. PERFORMING OPG. REPORT NUMBER Inventory No. 349 7. AUTHOR() CONTRACT OR GRANT HUMBER(e) HUGH C./FLAHERTY DACW51-81-C-0006 9. PERFORMING ORGANIZATION NAME AND ADDRESS Flaherty-Giavara Associates One Columbus Plaza New Haven, CT 06510 11. CONTROLLING OFFICE NAME AND ADDRESS 12. REPORT DATE 4 Auguct 1981 Department of the Army 13- NUMBER OF PAGES 26 Federal Plaza New York District, Coff New York, New York 10287 14. MONITORING AGENCY NAME & ADDRESS(II different from Controlling Office) 15, SECURITY CLASS. (of this ropom) Department of the Army 26 Federal Plaza New York District, CofE UNCLASSIFIED New York, NY 10287 15. DECLASSIFICATION/DOWNGRADING 16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; Distribution unlimited. 17. DISTRIBUTION STATEMENT (of the obstract entered in Block 20, if different from Report) National Dam Safety Program. Norwich Reservoir Number 2 Dam (Inventory Number NY 349), 🕿 Susquehanna River 18. SUPPLEMENTARY NOTES: Basin, Chenango County, New York. I Inspection Report 19. KEY WORDS (Continue on reverse side II necessary and identity by block number). Dam Safety Norwich Reservoir No. 2 Dam National Dam Safety Program Chenango County Visual Inspection Susquehanna River Basin, Mydrology, Structural Stability IQ. ABSTRACT (Continue we records aids it necessary and identify by block number) This report provides information and analysis on the physical condition of the dam as of the report data. Information and analysis are based on visual inspection of the dam by the performing organization. Examination of available documents and a visual inspection of the dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies that need to be evaluated and remedied. DO , FORM 1473 PERTON OF I HOV 65 IS ORFOLUTE

SECURITY CLASSIFICATION OF THIS PAGE (MIND DAIL BRILLING

Using the Corps of Engineers' Screening Criteria for the initial review of spillway adequacy, it has been determined that the embankment would be overtopped by the outflow resulting from all storms exceeding 13 percent of the Probable Maximum Flood (PMF). Dam overtopping, the resulting erosion of the embankment and hence, dam breaching would cause water surface levels downstream to reach depths which would pose significant danger to residents. Therefore, the spillway is adjudged to be seriously inadequate and the dam is assessed as unsafe, nonemergency.

The classification "unsafe" applied to a dam because of a seriously inadequate spillway is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean that there appears to be a serious deficiency in spillway capacity and if a severe storm were to occur, overtopping and failure of the dam could take place, significantly increasing the hazard to life downstream from the dam.

	<u> </u>		
Acce	ssion For		
	GRA&I		
1	DTIC TAB		
Unannounced			
Just.	ification		
Ву			
Dist	ribution/		
Ava	ilability Codes		
{	Avail and/or		
Dist	Special		
	1 22		
} .	1×21		
1	1 11		
L	1-7/-1		



PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I Investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through frequent inspections can unsafe conditions be detected and only through continued care and maintenance can these conditions be prevented or corrected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test Flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

PHASE I INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM NORWICH RESERVOIR NO. 2 DAM INVENTORY NO. NY 349 SUSQUEHANNA RIVER BASIN CHENANGO COUNTY, NEW YORK

TABLE OF CONTENTS

	PAGE NO.
ASSESSMENT	-
OVERVIEW PHOTOGRAPH	-
LOCATION MAP	i
1 - PROJECT INFORMATION	1
1.1 GENERAL	1
1.2 DESCRIPTION OF PROJECT	1
1.3 PERTINENT DATA	4
2 - ENGINEERING DATA	6
2.1 GEOTECHNICAL DATA	6
2.2 DESIGN RECORDS	6
2.3 CONSTRUCTION RECORDS	6
2.4 OPERATION RECORDS	7
2.5 EVALUATION OF DATA	7
3 - VISUAL INSPECTION	8
3.1 FINDINGS	8
3.2 EVALUATION OF OBSERVATIONS	10
4 - OPERATION AND MAINTENANCE PROCEDURES	12
4.1 PROCEDURE	12
4.2 MAINTENANCE OF DAM	12
4.3 WARNING SYSTEM	12
4.4 EVALUATION	12

5 -	HYDRO	OLOGIC/HYDRAULIC	13
	5.1	DRAINAGE AREA CHARACTERISTICS	13
	5.2	ANALYSIS CRITERIA	13
	5.3	SPILLWAY CAPACITY	13
	5.4	RESERVOIR CAPACITY	14
	5.5	FLOODS OF RECORD	15
	5.6	OVERTOPPING POTENTIAL	15
	5.7	EVALUATION	15
6 -	STRU	CTURAL STABILITY	16
	6.1	EVALUATION OF STRUCTURAL STABILITY	16
7 -	ASSES	SSMENT/RECOMMENDATIONS	17
	7.1	ASSESSMENT	17
	7.2	RECOMMENDED MEASURES	18
A P P	ENDIC	FS	
			
Α.	PHOT	OGRAPHS	
в.	VISU	AL INSPECTION CHECKLIST	
c.		OLOGIC/HYDRAULIC ENGINEERING DATA AND UTATIONS	
D.		IOUS INSPECTION REPORTS/AVAILABLE MENTS	
E.	REFE	RENCES	

F. DRAWINGS

PHASE I INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM

Name of Dam: Norwich Reservoir No. 2 Dam

State Located: New York

County: Chenango

Watershed: Susquehanna River Basin

Stream: Ransford Creek

Date of Inspection: March 13, 1981

ASSESSMENT

Examination of available documents and a visual inspection of the dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies that need to be evaluated and remedied.

Using the Corps of Engineers' screening criteria for the initial review of spillway adequacy, it has been determined that the embankment would be overtopped by the outflow resulting from all storms exceeding 13 percent of the Probable Maximum Flood (PMF). Dam overtopping, the resulting erosion of the embankment and hence, dam breaching would cause water surface levels downstream to reach depths which would pose significant danger to residents. Therefore, the spillway is adjudged to be seriously inadequate and the dam is assessed as unsafe, nonemergency.

The classification "unsafe" applied to a dam because of a seriously inadequate spillway is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean that there appears to be a serious deficiency in spillway capacity and if a severe storm were to occur, overtopping and failure of the dam could take place, significantly increasing the hazard to life downstream from the dam.

It is recommended that the following additional investigations be performed by a registered professional engineer engaged by the owner:

Conduct a detailed hydrologic and hydraulic analysis to determine the need for and methods of increasing the discharge capacity of the dam. This would include investigating the adequacy of the principal spillway weir and discharge channel (bypass canal) and the emergency spillway.

2. Verify the location, methods of construction and if possible, the condition of the outlet modifications (where the 36 inch former principal spillway was cut off and flow was diverted to the twin 12 inch pipes leading to the lower reservoir).

It is recommended that within 3 months of the final approval date of this report, the hydrologic investigation of the structure should be undertaken and within 6 months, the remaining investigation should commence. Appropriate remedial measures for both additional investigations should be completed within 18 months of the final approval.

The following remedial measures should be completed within 12 months to correct existing deficiencies:

- 1. Remove all spruce trees that are growing between the crest and lower berm on the left side of the downstream embankment slope and also any whose trunks or roots may be encroaching onto the right side of the embankment. The trees growing on the abutments may remain. The trees to be removed constitute a potential hazard if uprooted during a storm. This may lead to a loss of freeboard, to a dangerous reduction of embankment width, or to the formation of piping channels if uprooted and the remaining roots rot in place.
- 2. The trunks of all cut trees are to be removed and backfilled. Equipment and procedures for this maintenance operation should be such as to avoid damage to existing grass and weed cover on the slopes. Any slopes that become scarred by runoff or traffic should be reseeded and mulched.
- 3. Patch the cracks in the concrete apron and repair the separation between the concrete headwall and apron of the emergency spillway inlet to prevent water from flowing up from beneath the apron.
- 4. Place rockfill in the bypass canal below the outlet headwall of the emergency spillway where undermining has begun.
- 5. Ensure the reservoir drain and its controls are operational.
- 6. Backfill and regrade the areas of minor surface sloughs on the downstream slope.
- 7. Regrade the dam crest to remove vehicle ruts and shallow depressions and allow surface runoff without concentrated flow. A gravel surface layer would improve trafficability and reduce rutting.
- 8. Continue to periodically cut the brush on the slopes of the embankment and the bypass canal bottom to prevent their being overgrown.

- 9. Fill in the animal burrows noted on the embankment slopes.
- 10. Develop and implement a flood warning and emergency evacuation plan to alert the downstream residents in the event conditions occur which could result in failure of the dam.

Submitted by:

FLAHERTY GIAVARA ASSOCIATES, P.C.

High L. Flaherty, P.E. L.S. Charman of the Board New York License No. 58508


Approved by:

Col. W. M. Smith, Jr./ New York District Engineer

Date:



PHOTO #1: Overview of Norwich Reservoir No. 2 Dam Inventory No. NY 349

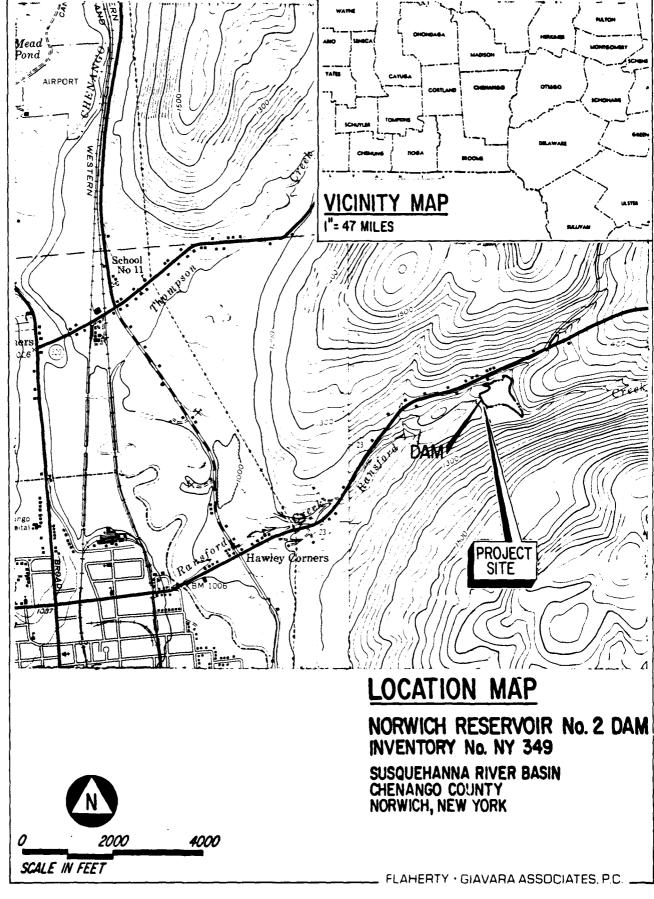

NATIONAL DAM SAFETY PROGRAM PHASE I INSPECTION REPORT NORWICH RESERVOIR NO. 2 DAM INVENTORY NO. NY 349 D.E.C. NO. 117C-621 SUSQUEHANNA RIVER BASIN CHENANGO COUNTY, NEW YORK

SECTION 1 - PROJECT INFORMATION

1.1 GENERAL

a. Authority

The Phase I Inspection reported herein was authorized by the Department of the Army, New York District, Corps of Engineers, to fulfill the requirements of the National Dam Inspection Act, Public Law 92-367. Flaherty Giavara Associates, P.C. has been retained by the New York District to inspect and report on selected dams in the State of New York. Authorization and notice to proceed was issued to Flaherty Giavara Associates, P.C. under a letter of December 24, 1980 from W. M. Smith, Jr. Colonel, Corps of Engineers. Contract No. DACW 51-81-C-0006 has been assigned by the Corps of Engineers for this work.

b. Purpose

Evaluation of the existing conditions of the subject dam to identify deficiencies and hazardous conditions, determine if they constitute hazards to life and property and recommend remedial measures where necessary.

1.2 DESCRIPTION OF PROJECT

a. Description of Dam and Appurtenances

Norwich Reservoir No. 2 Dam consists of an earthen embankment with a 36 inch diameter cast iron water supply pipe under the right central portion of the embankment, a cut stone masonry and concrete principal spillway with flashboards and a "bypass canal" beyond the right abutment and an emergency spillway utilizing twin 48 inch diameter corrugated metal pipes through the right abutment. Profiles and sections prepared for the project by the Norwich Water Works are included on drawings in Appendix F.

The dam embankment is 638 feet long and a maximum of 56 feet high and has an upstream slope of 3 horizontal to 1 vertical and a downstream slope of 2 to 1. The crest of

the dam is 10 feet in width and its elevation is 1249.0 (NGVD). There is a 15 to 18 foot berm near the down-stream toe of slope. The embankment cross section consists primarily of compacted glacial material except for a 10+ foot wide zone of compacted clay and gravel (puddled) core. The core is 5 feet wide near the top of the embankment and widens to 9 to 14 feet at the original ground surface. The core extends 7 to 18 feet below ground surface to form a cutoff. The width of the bottom of the cutoff is approximately 5 to 6 feet.

The upstream slope has a layer of 15 inches of broken rock for slope protection, while the downstream slope has a "soil dressing" and grass.

A 36 inch diameter cast iron water supply pipe runs beneath the right central part of the embankment from an intake structure in the reservoir, and constitutes part of the water supply system for the City of Norwich.

The principal spillway is 45 feet wide consisting of a cut stone masonry and concrete weir with wooden flash-boards, cut stone masonry abutments and wingwalls and a 2400 foot long "bypass canal". It is located to the north of the right abutment diverting flow around both this dam and Norwich Water Works Dam No. 1 (NY 347). The "bypass canal" is excavated into earth and rock while portions of the left side are formed by a berm. The excavated side slopes vary; however, the berm side slopes are 2 horizontal to 1 vertical on the canal side and 2.5 to 1 on the side sloping away from the canal.

The emergency spillway consists of two 48 inch diameter corrugated metal pipes located between the reservoir and the bypass canal and discharging a short distance downstream of the principal spillway weir. At the inlet, there is a concrete headwall and a concrete apron which serves as a weir, and at the outlet into the bypass canal there is a concrete endwall.

b. Location

The Norwich Reservoir No. 2 Dam is located off New York Route 23 approximately 1.6 miles northeast of the City of Norwich in the Town of Norwich, New York. The dam is located at latitude north 42 -33.0' and longitude west 75 - 29.3' on the U.S. Geological Survey 7.5 minute series topographic map "Holmesville, New York". The Location Map on page i indicates where the dam is situated.

c. Size Classification

The maximum height of the dam is 56 feet and the maximum storage capacity is 222 acre-feet. Therefore, Norwich Reservoir No. 2 Dam is classified as an "Intermediate" dam as defined by the Recommended Guidelines for Safety Inspection of Dams.

d. Hazard Classification

There are approximately 2 dwellings, a large trailer park (30 to 40 trailers), 4 commercial buildings, two major roads (including New York Route 23) and high voltage transmission lines within the dam failure flood hazard Therefore, the dam is in the "High" hazard category as defined by the Recommended Guidelines for Safety Inspection of Dams.

e. Ownership

The dam is owned by the City of Norwich. The address and telephone number of the owner is as follows:

Owner

Contact: Mr. Nicholas W. Andrews, Superintendent

Norwich Water Department

City of Norwich 31 East Main Street

Norwich, New York 13815

Telephone: (607) 334-6618

f. Purpose

The primary purpose of this dam is water supply for the City of Norwich.

g. Design and Construction History

The dam was designed in 1888 by the Norwich Water Works, W. S. Franklin, Chief Engineer and John Mitchell, Presi-It was constructed in 1890 by the Troy Public Works Company-Limited of Troy, New York. Major post construction modifications include the installation of flashboards on the principal spillway weir in 1913 and the construction of the emergency spillway in 1967.

h. Normal Operating Procedure

The water level in the reservoir is checked visually twice daily, seven days a week. The flashboards are lowered in late spring to retain flow during the dry months,

then they are raised in late fall to permit flow to pass during the wet months.

1.3 PERTINENT DATA

a.	Drainage Area (Square Miles)	3.79
b.	Discharge at Dam Site (CFS)	
	Top of DamCrest of Emergency SpillwayCrest of Principal Spillway	934 95
	left weir (with flashboards) right weir (without flashboards)	69 -
c.	<u>Elevations</u>	
	- Top of Dam - Crest of Emergency Spillway	1249.0 1245.6
	- Crest of Principal Spillway left weir (with flashboards)	1245.4
	right weir (without flashboards) - Reservoir Drain Inlet	1244.1 1205.0
d.	Reservoir Surface Area (Acres)	
	- Top of Dam - Crest of Emergency Spillway	12.0 10.0
	 Crest of Principal Spillway left weir (with flashboards) 	9.9
	right weir (without flashboards)	9.1
е.	Storage (Acre-Feet)	
	Top of DamCrest of Emergency Spillway	222 189
	 Crest of Principal Spillway left weir (with flashboards) 	187
	right weir (without flashboards)	176
f.	Dam	
	 Type: Compacted glacial material with a compacted clay and gravel (puddled) core and cutoff 	
	- Length (Feet)	638
	- Upstream Slope (H:V) - Downstream Slope (H:V)	3:1 2:1
	- Crest Width (Feet)	10

g. Principal Spillway

- Type: Cut stone masonry weir with a concrete crest and adjustable flash-boards as well as an excavated earthen channel (bypass canal)

- Length (Feet)
weir
channel
42

- Bottom Width (Feet)
weir
channel
30

- Side Slopes (H:V)
weir vertical
channel 0.5-2.0:1

- Channel Bottom Slopes (Feet/Foot)
upstream
downstream
0.004 to 0.060

- Control: Flashboards

h. Emergency Spillway

- Type: Twin 48 inch diameter corrugated metal pipes (112 feet long) with a concrete apron and headwall at its inlet and a concrete endwall at its outlet

- Control: None

i. Reservoir Drain

- Type: 36 inch diameter cast iron pipe (200 feet long)

- Control: 36 inch diameter slide gate located near the outlet into the still-ing basin

SECTION 2 - ENGINEERING DATA

2.1 GEOTECHNICAL DATA

a. Geology

The Norwich Reservoir No. 2 Dam is located on Ransford Creek, a southwesterly flowing tributary to the Chenango River, about 1.5 miles northeast of the City of Norwich in the Appalachian (Allegheny) Plateau physiographic province of New York State.

The topography in the area ranges from elevation 1200 at the streambed downstream of the dam to about elevation 1500 to 1780 at the summits of hills surrounding the dam and reservoir area.

The underlying bedrock at the site consists of the Unadilla Formation belonging to the Upper Devonian Genesee group. This formation consists of coarse silty shales and siltstones that were deposited in a shallow water, near-shore setting of the Catskill Delta that propagated across the state from east to west. The bedding of these deposits is quite even and laminated, splitting readily into thin sheets upon exposure.

Above the bedrock, the valley bottom and side slopes are mantled by a heterogeneous mixture of clay, silt, sand and rock fragments known as glacial till (or hardpan).

b. Subsurface Investigations

No known subsurface explorations were made at the site. Based on reports made in the mid 1920's, the subsurface conditions at the site consist of relatively impermeable glacial till (hardpan) or shale bedrock.

2.2 DESIGN RECORDS

The Norwich Reservoir No. 2 Dam was designed in 1888 by the Norwich Water Works, W. S. Franklin, Chief Engineer. No design data was obtained for this dam.

2.3 CONSTRUCTION RECORDS

This dam was constructed in 1890 by the Troy Public Works Company-Limited of Troy, New York. Cross sections and a profile of the embankment and bypass canal, a plan and profile of the waste weir and plans for the installation of the flashboards are included in Appendix F. In addition, excerpts from the technical specifications can be found in Appendix D.

2.4 OPERATION RECORDS

There were no operation records available for this dam.

2.5 EVALUATION OF DATA

The data presented herein was obtained primarily from the Norwich Water Department located in Norwich, New York and also from the files of the New York State Department of Environmental Conservation (DEC). This information appears to be reliable and adequate for the purposes of a Phase I Inspection Report.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS

a. General

Visual inspection of the Norwich Reservoir No. 2 Dam was conducted on March 13, 1981. The weather was overcast and the temperature was $40 \pm ^{\circ}F$. At the time of the inspection, there were small patches of snow on the ground and water was flowing in the principal spillway (See Photo No. 9).

b. Dam

The earthfill embankment of the dam is generally in good condition (See Photos No. 4, 5, 6 and 7). The dam crest is also in good condition except for vehicle ruts and shallow depressions and is presently used for access to Norwich Water Works Dam No. 1 (See Photo No. 3). There was no visible evidence of lateral movement, seepage, major settlement or erosion, or other serious defects.

The following specific items were noted:

- 1. Several minor surface sloughs were observed on the right side of the upper downstream slope.
- 2. Several large animal burrows were noted on the upper portion of the downstream slope. Several small animal burrows were observed near the crest on both the upstream and downstream slopes (See Photo No. 18).
- 3. Moderate to large-sized spruce trees are growing on the downstream slope along the left and right abutments; this tree cover overlaps onto the downstream embankment slope on the left side (See Photos No. 5 and 7).

c. Principal Spillway

1. Principal Spillway Weir

This two-stage broad-crested weir is constructed of cut stone masonry and concrete and is in good condition. The lower stage contains provisions for 2.5 foot high adjustable flashboards. The approach channel to the weir is straight, free from debris and also in good condition (See Photo No. 8). A 50 foot long by 13 foot wide bridge spans the spillway weir (See Photo No. 8) and is used for access to the lower reservoir, dam and chemical feed building. It has two spans constructed of steel I-beams, a steel grate

deck and a 3 foot high pipe rail parapet (See Photo No. 8).

2. Principal Spillway Discharge Channel (Bypass Canal)

The discharge channel has a typical width of 45 feet, a length of approximately 2400 feet and is in good condition (See Photo No. 12). This channel directs flow around both this dam and the lower dam (NY 347). The side slopes of the channel vary from 0.5 horizontal to 1 vertical to 2:1 and are excavated into bedrock in some sections. Portions of the left side slope are formed by an earthen berm.

d. Emergency Spillway

The twin 48 inch diameter corrugated metal pipes which discharge into the bypass canal are in good condition showing little sign of deterioration.

The following observations were made:

- 1. Numerous cracks were observed in the concrete walls and apron of the inlet structure (See Photo No. 10). These cracks range from hairline to 1/4 inch in width and at one location as indicated on the sketch on page 8-11 in Appendix B, there is a 3/8 inch separation between the abutment and wingwall. Water seepage was noted between the concrete apron and the headwall at the inlet (See Photo No. 11). The pipe inlet elevation was approximately 0.3 feet below the reservoir level at the time of observation.
- 2. Slight undermining of the concrete endwall was noted at the emergency spillway outlet into the bypass canal (See Photos No. 12 and 13). No flow beneath the headwall was observed.
- 3. The left 48 inch CMP has an angle point in its hori-zontal alignment.

e. Water Distribution System Appurtenances

1. Intake Structure

A wood and stone masonry intake structure is located approximately 100 feet from the dam crest within the reservoir (See Photo No. 14). It is connected to the shoreline by a 58 foot long by 5 foot wide access footbridge. Both structures are in good condition showing little sign of deterioration.

2. Outlet Works

The primary outlet works is a 36 inch diameter cast iron water supply pipe located between the intake structure and the stilling basin (See No. Photo 15). Connected to this pipe is a 12 inch diameter cast iron pipe which supplies water to two 4 inch diameter cast iron discharge pipes (See Photo No. 16), to the aerating jets of the lower reservoir and to the City of Norwich water distribution system. Additionally, a 14 inch diameter cast iron pipe serves as a drain for the stilling basin emptying into the lower reservoir (See Photo No. 17). The pipe networks for the upper and lower reservoirs are shown on a "Sketch Map" on page D-17 in Appendix D.

f. Downstream Channel

The only natural channel downstream of the dam is located at the end of the bypass canal below the lower dam and reservoir. It has a width of 10 to 15 feet and a depth of 6 inches. Immediately downstream of the upper dam is the lower reservoir and dam - NY 347 (See Photo No. 19).

g. Reservoir - Storage Pool Area

The reservoir area is bordered by moderately to steeply sloping wooded land. There does not appear to be any significant probability of landslides into the storage pool affecting the safety of the dam (See Photo No. 2).

The "bypass canal" for Reservoir No. 2 runs along the top of the slope above the right side of Reservoir No. 1. An earthen berm was built along portions of the bypass canal on the side adjacent to Reservoir No. 1, but well back from the top of slope.

3.2 EVALUATION OF OBSERVATIONS

The visual inspection revealed several deficiencies. The following observations were made:

- a. Moderate to large-sized spruce trees were growing on the left downstream slope and along each abutment.
- b. Numerous cracks were noted in the concrete walls and apron of the emergency spillway inlet structure.
- c. Slight undermining of the concrete endwall was observed at the outlet to the emergency spillway.
- d. Several minor surface sloughs were observed on the right side of the upper downstream slope.

- e. Vehicle ruts and shallow depressions were noted on the dam crest.
- f. Several large animal burrows were noted on the upper portion of the downstream slope.

SECTION 4 - OPERATION AND MAINTENANCE PROCEDURES

4.1 PROCEDURES

The normal water surface level is maintained by the crest of the right broad-crested weir of the principal spillway at elevation 1244.1 (NGVD). However, with the flashboards in place, the normal water surface level is increased to the elevation of the left broad-crested weir at 1245.4 (NGVD). The following operational procedures are in effect at this time:

- a. The reservoir water level is checked visually twice daily, seven days a week.
- b. The reservoir level can be raised by diverting water via a tunnel to Ransford Creek from Chenango Lake in the Unadilla River watershed.

4.2 MAINTENANCE OF DAM

Maintenance operations at the Norwich Reservoir No. 2 Dam include:

- a. The dam crest and embankments are mowed manually once every year.
- b. Deciduous trees are cut back annually to prevent them from growing too close to the reservoir.
- c. Repairs to masonry are performed as required.
- d. Metalwork and wooden structures are painted as necessary.

4.3 WARNING SYSTEM

No warning system is presently in effect.

4.4 EVALUATION

Presently, the operation and maintenance procedures in effect for this dam and its appurtenances are satisfactory. However, increased maintenance efforts are required to correct the deficiencies which now exist.

SECTION 5 - HYDROLOGIC/HYDRAULIC

5.1 DRAINAGE AREA CHARACTERISTICS

The dam is located in the Town of Norwich on Ransford Creek, approximately 8100 feet upstream of the Chenango River. Ransford Creek joins the Chenango River at the City of Norwich, approximately forty-five miles upstream of the Susquehanna River at Binghamton, New York.

The watershed (shown on the Watershed Map on Page C-5 in Appendix C) consists of 2424 acres (3.79 square miles) of hilly uplands. It is divided into two subwatersheds, one has typical slopes of 15+ percent while the other has slopes ranging from 5 to 10 percent. Land within the watershed is primarily agricultural with extensive open fields.

Two watercourses flow into the reservoir; each is a small perennial stream with a typical flow width of 10 feet and a typical flow depth of 6 inches.

5.2 ANALYSIS CRITERIA

The purpose of the hydrologic/hydraulic analysis is to evaluate the spillway capacity and the potential for overtopping. The analysis of the spillway capacity of the dam and storage of the reservoir was performed using the Corps of Engineers HEC-1 Computer Model - Dam Safety Version. The procedure included determining the Probable Maximum Flood (PMF) runoff from the watershed and routing the inflow hydrograph through the impoundment to determine the outflow hydrograph. The unit hydrograph was defined by the Snyder Synthetic Unit Hydrograph method, and the Modified Puls routing procedure was incorporated.

The initial rainfall loss was assumed to be 1.0 inches, and the uniform rainfall loss was assumed to be 0.1 inches per hour. In accordance with recommended guidelines of the Corps of Engineers, the Probable Maximum Precipitation (PMP) was 20.2 inches (24 hour duration, 200 square mile area).

The analysis was conducted for both the full PMF and for several fractional PMF conditions. The PMF inflow of 8626 CFS was routed through the reservoir and the peak outflow was determined to be 8626 CFS.

5.3 SPILLWAY CAPACITY

The total outlet capacity is the sum of the discharges from the principal spillway and the emergency spillway.

The principal spillway consists of a two stage broad-crested overflow weir, one stage being 16.7 feet long and the other

13.0 feet long. The right weir is at a lower elevation (1244.1 NGVD) than the left weir (1245.4 NGVD) and has 2.5 feet of adjustable flashboards.

The emergency spillway consists of a concrete apron at the inlet that acts as a weir for certain stages and two 48 inch diameter corrugated metal pipes (CMP).

The stage discharge data for the combined principal and emergency spillways was calculated for the stages tabulated below:

Stage (Feet)	Discharge Capacity (CFS)	Element of Structure
1244.1	0	Right Broad-Crested Weir
1244.4	6	
1245.4	69	Left Broad-Crested Weir
1245.6	95	Emergency Spillway Crest
1246.4	263	-
1247.4	487	
1248.4	746	
1249.0	934	Top of Dam

The total spillway capacity at the top of the dam is 934 CFS.

The principal spillway can pass the peak outflow from a flood equal to approximately 3 percent of the PMF before use of the emergency spillway would be required.

5.4 RESERVOIR CAPACITY

The storage capacity of the reservoir was obtained primarily from the records of the Norwich Water Department as indicated below:

Stage (Feet)	Storage (Acre-Feet)	Storage (Inches of Runoff)
1244.1	176	0.87
1245.4	187	0.93
1245.6	189	0.94
1249.0	222	1.10

5.5 FLOODS OF RECORD

No data regarding floods of record was obtained for this dam.

5.6 OVERTOPPING POTENTIAL

The results of the HEC-1 DB computer analysis indicate that the crest of the dam is overtopped by all storms exceeding 13 percent of the outflow from the PMF event. The PMF discharge rate of 8626 cubic feet per second (CFS) would occur at a peak flood stage of 1252.7 feet, which is 3.7 feet above the crest of the dam.

The results of the analysis are tabulated below:

Flood Condition	Peak Inflow (CFS)	Peak Outflow (CFS)	Maximum Stage Elevation (NGVD)
0.5 PMF	4313	4313	1251.0
1.0 PMF	8626	8626	1252.7

5.7 EVALUATION

Using the Corps of Engineers' screening criteria for the initial review of spillway adequacy, it has been determined that the combined capacity of the principal and emergency spillways is not adequate to pass either the full PMF or one half the PMF; only approximately 13 percent of the outflow from the PMF can be safely passed before overtopping will occur. The PMF event would overtop the dam for a duration of 13 hours and the maximum depth of flow over the crest would be 3.7 feet. It is estimated that as a result of overtopping, breaching of the dam would cause water surface levels downstream to reach depths which would pose significant sanger to residents. Therefore, the spillway is adjuaged to be seriously inadequate and the dam is assessed as unsafe, nonemergency.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

a. Visual Observations

There was no visible evidence of major settlement, lateral movement or other signs of overall structural instability of the dam during the site examination. Based on the conditions that were observed, there is no reason to question the static structural stability of the dam.

b. Design and Construction Data

The drawings entitled "Storage Reservoir Embankment, Upper Location", "Waste Weir" and "Bypass Canal" for the Norwich Reservoir No. 2 Dam (See Appendix F) show a configuration for the embankment, principal spillway and discharge channel that generally corresponds to the conditions observed on March 13, 1981, with the following exceptions:

- 1. The discharge is no longer through the 36 inch diameter cast iron pipe into the lower reservoir.
- 2. An earthern berm has been constructed at the downstream toe of the embankment.
- 3. Flashboards were installed on the principal spillway weir in 1913.
- 4. The emergency spillway was built in 1967.

There is no construction data to confirm the actual physical properties and configuration of the earthfill or the puddled core in the embankment. However, the dam proportions are considered to be reasonable for the soils that were available at the site and the dam would be expected to have adequate safety margins with respect to stability under static loading conditions.

c. Seismic Stability

The Norwich Reservoir No. 2 Dam is located in Seismic Zone 1, and in accordance with recommended Phase I guidelines does not require seismic analysis.

SECTION 7 - ASSESSMENT/RECOMMENDATIONS

7.1 ASSESSMENT

a. Condition

On the basis of the visual examination, the embankment and appurtenances of the Norwich Reservoir No. 2 Dam are considered to be in good condition. There were no signs of impending structural failure or other conditions which would warrant urgent remedial action; however, a number of minor deficiencies were noted.

b. Adequacy of Information

The evaluation of the embankment portions of this dam is based primarily on visual examination, reference to available plans, approximate hydraulic and hydrologic computations, and application of engineering judgement. The available information that was obtained is adequate for the purposes of a Phase I assessment.

c. Need for Additional Investigations

It is recommended that the following additional investigations be performed by a registered professional engineer engaged by the owner:

- 1. Conduct a detailed hydrologic and hydraulic analysis to determine the need for and methods of increasing the discharge capacity of the dam. This would include investigating the adequacy of the principal spillway weir and discharge channel (bypass canal) and the emergency spillway.
- 2. Verify the location, methods of construction and if possible, the condition of the outlet modifications (where the 36 inch former principal spillway was cut off and flow was diverted to the twin 12 inch pipes leading to the lower reservoir).

d. <u>Urgency</u>

It is recommended that within 3 months of the final approval date of this report, the necessary hydrologic investigation should be undertaken and within 6 months, the remaining investigation should commence. Appropriate remedial measures for both of the additional investigations described in Section 7.1c should be completed within 18 months of the final approval of the report. Corrective measures listed in Section 7.2 should be accomplished within 12 months of final approval.

7.2 RECOMMENDED MEASURES

It is considered important that the following items be accomplished in addition to any items required as a result of the additional investigations recommended in Section 7.1c:

- a. Remove all spruce trees that are growing between the crest and lower berm on the left side of the downstream embankment slope, and also any whose trunks or roots may be encroaching onto the right side of the embankment. Trees growing on the abutments may remain. The trees to be removed constitute a potential hazard if uprooted during a storm. This may lead to a loss of freeboard, to a dangerous reduction of embankment width, or to the formation of piping channels if uprooted and the remaining roots rot in place.
- b. The trunks of all cut trees are to be removed and back-filled. Equipment and procedures for this maintenance operation should be such as to avoid damage to existing grass and weed cover on the slopes. Any slopes that become scarred by runoff or traffic should be reseeded and mulched.
- c. Patch the cracks in the concrete apron and repair the separation between the concrete headwall and apron of the emergency spillway inlet to prevent water from flowing up from beneath the apron.
- d. Place rockfill in the bypass canal below the outlet headwall of the emergency spillway where undermining has begun.
- e. Ensure the reservoir drain and its controls are operational.
- f. Backfill and regrade the areas of minor surface sloughs on the downstream slope.
- g. Regrade the dam crest to remove vehicle ruts and shallow depressions and allow surface runoff without concentrated flow. A gravel surface layer would improve trafficability and reduce rutting.
- h. Continue to periodically cut the brush on the embankment slopes and the bypass canal bottom to prevent their being overgrown.
- i. Fill in the animal burrows observed on the embankment slopes.
- j. Develop and implement a flood warning and emergency evacuation plan to downstream residents public in the event

conditions occur which could result in the failure of the dam.

APPENDIX A
PHOTOGRAPHS

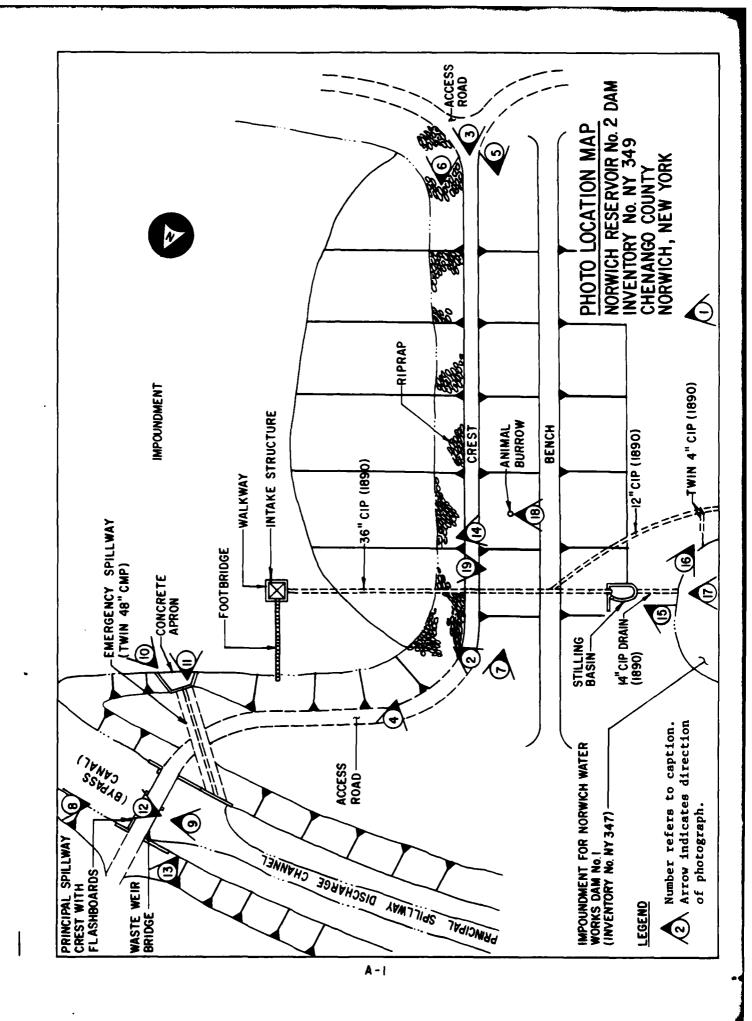




PHOTO #2: Overview of impoundment



PHOTO #3: Crest of dam looking toward right abutment



PHOTO #4: Overview of upstream face of dam



PHOTO #5: Overview of downstream face of dam

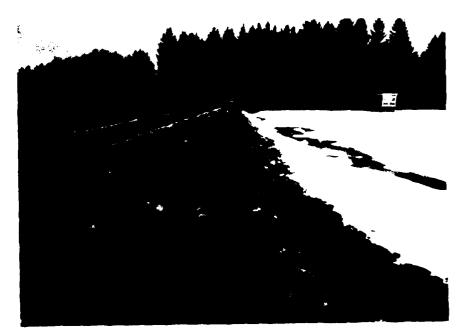


PHOTO #6: Upstream face of dam



PHOTO #7: Downstream face of dam



PHOTO #8: View of principal spillway from upstream

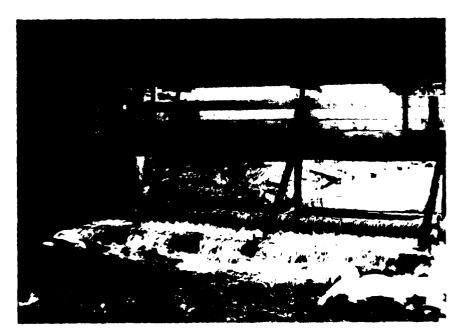


PHOTO #9: Closeup of flashboards from downstream



PHOTO #10: View of emergency spillway (twin 48" corrugated metal pipes - CMP) from upstream



PHOTO #11: Seepage through joint between concrete headwall and apron



PHOTO # 12: Outlet of emergency spillway and downstream channel conditions

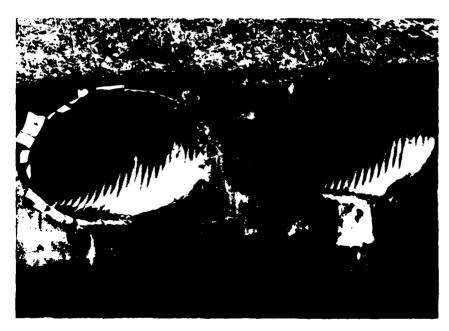


PHOTO #13: Closeup of emergency spillway outlet



PHOTO #14: Intake structure



PHOTO #15: Outlet works (36" cast iron pipe - CIP)



PHOTO #16: 4" CIP outlet pipe flowing nearly full



PHOTO #17: 14" CIP drain from outlet works (shown in Photo #15)



PHOTO #18: Animal burrow



PHOTO #19: Downstream channel conditions - impoundment for Norwich Water Works Dam No. 1 (Inventory No. NY 347)

APPENDIX B
VISUAL INSPECTION CHECKLIST

VISUAL INSPECTION CHECKLIST

1) Basic Data

a.	Gen	era.	ĺ
-	064	~~~.	1

	Name of Dam Norwich Reservoir No. 2 Da	am
	Fed. I.D. # NY 349	DEC Dam No. 117C-621
	River Basin Susquehanna	
	Location: Town Norwich	County Chenango
	Stream Name Ransford Creek	
	Tribucary of Chenango River	
	Latitude (N) 42° - 33.0'	Longitude (W) 75° - 29.3'
	Type of Dam Earthen embankment	
	Hazard Category High	_
	Date(s) of Inspection March 13, 1981	
	Weather Conditions Overcast, 40° ±F.	_
	Reservoir Level at Time of Inspection _	Elevation 1244.2 (NGVD)
ь.	Inspection Personnel R.C. Smith, T.L. Wa	ard & R.A. Criscuolo of Flaherty Giavara
	Associates, P.C.; J.J. Rixner & C.W.	Eller of Haley & Aldrich, Inc.; E. Thomas
_	of Salmon Associates.	Phone No. \
c.	Persons Contacted (Including Address & 1	ritone No. /
	Nicholas W. Andrews, Superintendent	Thomas J. Natoli, City Engineer
	Norwich Water Department City of Norwich	City of Norwich P.O. Box 430
	31 East Main Street	31 East Main Street
	Norwich, New York 13815	Norwich, New York 13815
	(607) 334-6618	(607) 334-4427
d.	History:	
	Date Constructed 1890 Date	e(s) Reconstructed Never
	Designer Norwich Water Works; W.S. Fra	anklin, Chief Engineer
	Constructed By Troy Public Works Company	ny - Limited
	Owner City of Norwich	

2) Embankment

a.	Cuar	racteristics				
	(1)	Embankment Material Compacted earth material				
	(2)	Cutoff Type Compacted clay and gravel (puddled)				
	(3)	Impervious Core Compacted clay and gravel (puddled)				
	(4)	Internal Drainage System None observed				
	(5)	Miscellaneous No comments				
ъ.	Cres	st ·				
	(1)	Vertical Alignment Good; minor wheel rutting in roadway				
	(2)	Horizontal Alignment Good; angled upstream toward the left abutment				
	(3)	Surface Cracks None observed				
	(4)	Miscellaneous Mowed grass cover				
c.	Upst	cream Slope				
	(1)	Slope (Estimate - V:H) 1:3				
	(2)	Undesirable Growth or Debris, Animal Burrows Few mouse/mole burrows				
		near the crest				
	(3)	Sloughing, Subsidence or Depressions Slight surface erosion on right abutment				

(4)	Slope Protection Layer of riprap with flat platey shale extending within
	one foot of the crest; one foot strip of grass at crest; heavier grass
	and brush cover at the abutments.
(5)	Surface Cracks or Movement at Toe None evident
Down	stream Slope
(1)	Slope (Estimate - V:H) 1:2
(2)	Undesirable Growth or Debris, Animal Burrows Several woodchuck burrows
	near the toe of slope; pine and spruce (6 inch - 24 inch in diameter)
(3)	cover the left abutment and slope. Sloughing, Subsidence or Depressions Two minor surface sloughs were noted
	near the right abutment; some erosion of surface soil through the stone
	below
(4)	Surface Cracks or Movement at Toe None observed
(5)	Seepage None evident
ν-,	
(6)	External Drainage System (Ditches, Trenches, Blanket) None observed
(-,	
(7)	Condition Around Outlet Structure Dry stone masonry stilling basin in
(,,	good condition
(8)	Seepage Beyond Toe None observed
(0)	deepage beyond toe
Abue	ments - Embankment Contact
ADUL	Right: good condition
	Left: good condition
	Lete, good condition

		(1)	Erosion at Contact None apparent
		(2)	Seepage Along Contact None observed
			`
3)	Dra	inage	System
	a.	Desc	ription of System Masonry and wood intake structure with a 36 inch
		di	ameter cast iron pipe (CIP) feeds water into the distribution system
		th	rough a 12 inch CIP from which two 4 inch CIP blowoffs discharge into
		th	e lower reservoir (NY 347)
	b.	Condi	Ltion of System Fair; some valves have not been opened or closed in
		ye	ars and may be inoperable
	c.	Disci	narge from Drainage System Stilling basin and rirapped outlet
		~	
4)	Ina		ntation (Monumentation/Surveys, Observation Wells, Weirs, Peizometers, Etc.)
7,	100		ne observed
			
		-	
			•
		_	


٠,	Kes	ELVOIT					
a. Slopes Moderately to steeply sloping woodlands							
	b.	Sedimentation No apparent problems					
	c.	Unusual Conditions Which Affect Dam None apparent					
6)	Are	Area Downstream of Dam					
	a.	Downstream Hazard (No. of Homes, Highways, etc.) Approximately 2 dwellings,					
		a large trailer park (30 to 40 trailers), 4 commercial buildings, two					
		major roads (including New York Route 23) and high voltage transmission					
	ь.	lines are within the dam failure flood hazard area Seepage, Unusual Growth					
		None observed					
	c.	Evidence of Movement Beyond Toe of Dam None evident					
	d.	Condition of Downstream Channel Not applicable					
7)	Spi	Spillway(s) (Including Discharge Conveyance Channel)					
		Principal spillway, emergency spillway and discharge conveyance channel					
		(bypass canal)					
	a.	General Principal spillway and discharge conveyance channel (bypass					
		canal) handle normal flows while the emergency spillway conveys flow					
		during overflow conditions					
		,					
	ь.	Condition of Principal Spillway Good; minor seepage around right abutment;					
		some open joints in masonry					
		**					

	Condition of Emergency Spillway Some seepage through the joint between the						
	concrete apron and headwall at the inlet to the twin 48 inch CMP; cracks						
	observed in the concrete apron; the center of the concrete endwall has						
	been undermined by 9 [±] inches.						
d.	Condition of Discharge Conveyance Channel Fair; side slopes have a moderate						
	growth of trees and brush but appear stable						
Res	ervoir Drain/Outlet						
	e: Pipe X Conduit Other						
	erial: ConcreteMetalXOther						
	e: 36 inch cast iron pipe (CIP) Length 200 feet						
	ert Elevations: Entrance 1205.0 (NGVD) Exit 1199.4 (NGVD)						
	sical Condition (Describe): Unobservable						
•	Material: Rust was visible at the outlet						
	Joints: Unobservable Alignment Straight						
	Structural Integrity: Good						
	Hydraulic Capability: Good; pipe is used for water supply for the City of						
	Norwich						
	Means of Control: Gate Valve X Uncontrolled						
	Operation: Operable Inoperable Uncontrolled						
	Present Condition (Describe): Unknown; the valve was not operated during						
	Present Condition (Describe): Unknown; the valve was not operated during the inspection						


•	Concrete Surfaces Concrete surfaces of the emergency spillway inlet have
	several cracks.
,	Structural Cracking Minor shrinkage cracks were observed
ı	Movement - Horizontal & Vertical Alignment (Settlement) Numerous settlement
	cracks up to ½ inch wide at the inlet (See the sketch on page B-11)
	Junctions with Abutments or Embankments A 3/8 inch separation was observed
	between the headwall and the right wingwall (See the sketch on page B-II)
	
	Drains - Foundation, Joint, Face None evident
	Water Passages, Conduits, Sluices 36 inch cast iron water supply pipe from
	the intake structure having a 12 inch cast iron pipe branching off to the
	distribution system.
	Seepage or Leakage Some seepage was noted through the joint separation
	mentioned in 9)d. above.

h.	Joints - Construction, etc. Some open joints in stone masonry of the principal
	spillway; no indication of reinforcement between the wingwalls and the
	headwall of the emergency spillway inlet.
i.	Foundation Inaccessible
j.	Abutments Minor openings in masonry joints as noted in 9)h. above
~	
k.	Control Gates Valves control the flow of water to the distribution system
1.	Approach & Outlet Channels Concrete surface is cracked at the approach to the
	emergency spillway.
m.	Energy Dissipators (Plunge Pool, etc.) Stilling basin at the outlet of the
•	36 inch diameter cast iron water supply pipe.
n.	Intake Structures Stone masonry and wood structure with access footbridge
Ber	in good condition
٥.	Stability Appears to be stable
.	Stability Appears to be stable
	No companies
p.	Miscellaneous No comments


10)	App	purtenant Structures (Power House, Lock, Gatehouse, Other)			
	a.	Description and Condition			
		1	Intake structure: It appears to be in good condition.		
		2.	Bridge over principal spillway weir: Good condition.		

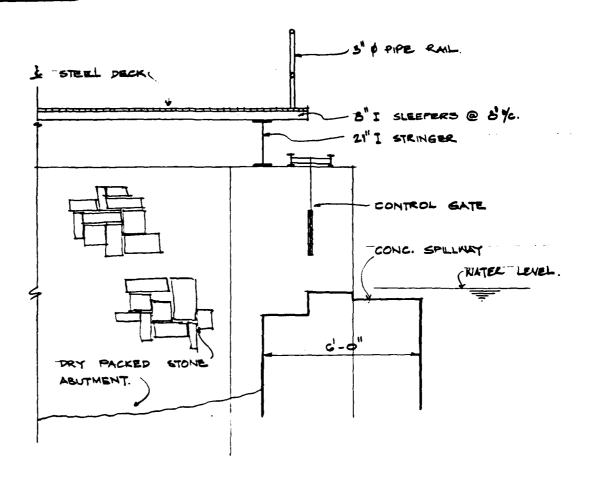

SECTION THRU CONC. SPILLWAY AT BRIDE.

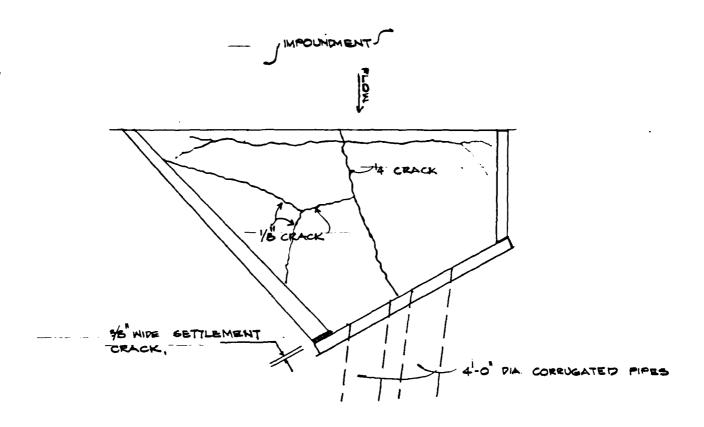

PLAN OF EMERGENCY SPILLWAY .

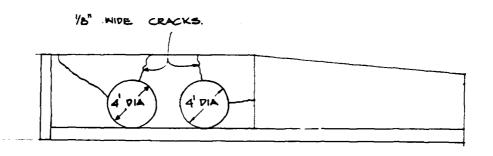


ELEVATION OF EMERGENCY SPILLWAY. .


(N.T.S)

NAME OF DAM : NORWICH RESERVOIR Nº2

FED 10 Nº : 349

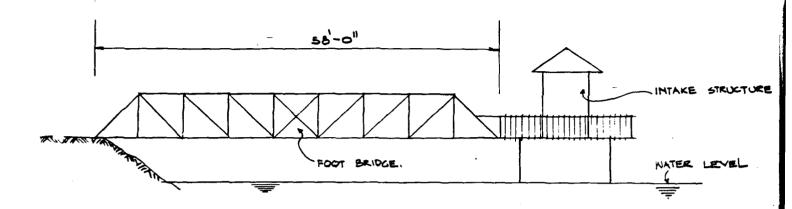

· ELEVATION OF INTAKE STRUCTURE & FOOT BRIDGE .

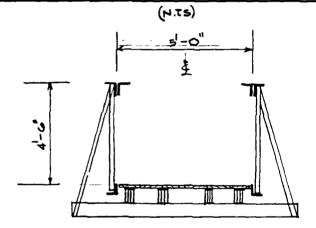

SECTION THRU FOOT BRIDGE.

APPENDIX C HYDROLOGIC/HYDRAULIC ENGINEERING DATA AND COMPUTATIONS

CHECK LIST FOR DAMS HYDROLOGIC AND HYDRAULIC ENGINEERING DATA

AREA-CAPACITY DATA:


		Elevation (ft.)	Surface Area (acres)	Storage Capacity (acre-ft.)
1)	Top of Dam	1249.0	12.0	222
2)	Design High Water (Max. Design Pool)			
3)	Emergency Spillway Crest	1245.6	10.0	189
4)	Pool Level with Flashboards	1245.4	9.9	187
5)	Principal Spillway Crest	1244.1	9.1	176

DISCHARGES:	Volume (cfs)
1) Average Daily	Unknown
2) Emergency Spillway @ Maximum High Water (Top of Dam)	126
3) Principal Spillway @ Maximum High Water (Top of Dam)	808
4) Principal Spillway @ Emergency Spillway Crest	95
5) Low Level Outlet @ Principal Spillway Crest	
6) Total (of all facilities) @ Maximum High Water	934
7) Maximum Known Flood	Unknown
8) At Time of Inspection	0

CREST:		ELEVATION: 1249.0
Type Vegetated earthen	embankment	
Width 10 feet		Length 638 feet
Spillover Cut stone maso	nry and concrete spil	
Location Beyond and ups		
SPILLWAY:		
PRINCIPAL		EMERGENCY
1244.1 (NGVD)	Elevation	1245.6 (NGVD)
Broad-crested weir	s Type	Twin 48 inch CMP
13.0 feet and 16.7	feet Width	<pre>15 feet @ entrance to pipes; 32 feet @ concrete apron</pre>
	Type of Control	
Weir	Uncontrolled	Weir
	Controlled	
Flashboards	Type:	None
	(Flashboards; ga	ite)
One	Number	One 32 foot weir/ 18 feet long
2.5 feet high/ 16.7 feet	Size/Length	2-48 inch CMP/112 feet long
Reinforced concrete	Invert Material	Reinforced concrete and corrugated meta
Continuously	Anticipated Leng	[] _]
Not applicable	Chute Length	18 feet
l [‡] foot	Height Between	1 [±] foot
	Spillway Crest & Approach Chann Invert (Weir Flo	

Type:	
Location	n:
Records	
Date	e <u>Unknown</u>
Max	. Reading Unknown
	CONTROL SYSTEM: System None in effect
Method	of Controlled Releases (mechanisms) Valves used to control flow to the
<u>wa</u>	ter distribution system; flashboards used to regulate reservoir levels.

RAINAGE AREA: 2424 acres = 3.79 square miles
RAINAGE BASIN RUNOFF CHARACTERISTICS:
Land Use - Type Rural, agriculture
Terrain - Relief Moderate slopes
Surface - Soil Glacial till
Runoff Potential (existing or planned extensive alterations to existing surface or subsurface conditions)
Primarily open fields with scattered woodlands; glacial till soils;
average watershed slope is 5 to 10 percent; some residential homes
and roadways.
Potential Sedimentation problem areas (natural or man-made; present or future) None
Potential Backwater problem areas for levels at maximum storage capacity including surcharge storage: None
None
•
Dikes - Floodwalls (overflow & non-overflow) - Low reaches along the reservoir perimeter:
Location: None
Elevation:
Reservoir:
Length @ Maximum Pool 1000 + feet = 0.2 miles (Miles)
Length of Shoreline (@ Spillway Crest) $3500 \pm \text{feet} = 0.7 \text{ miles}$ (Miles)

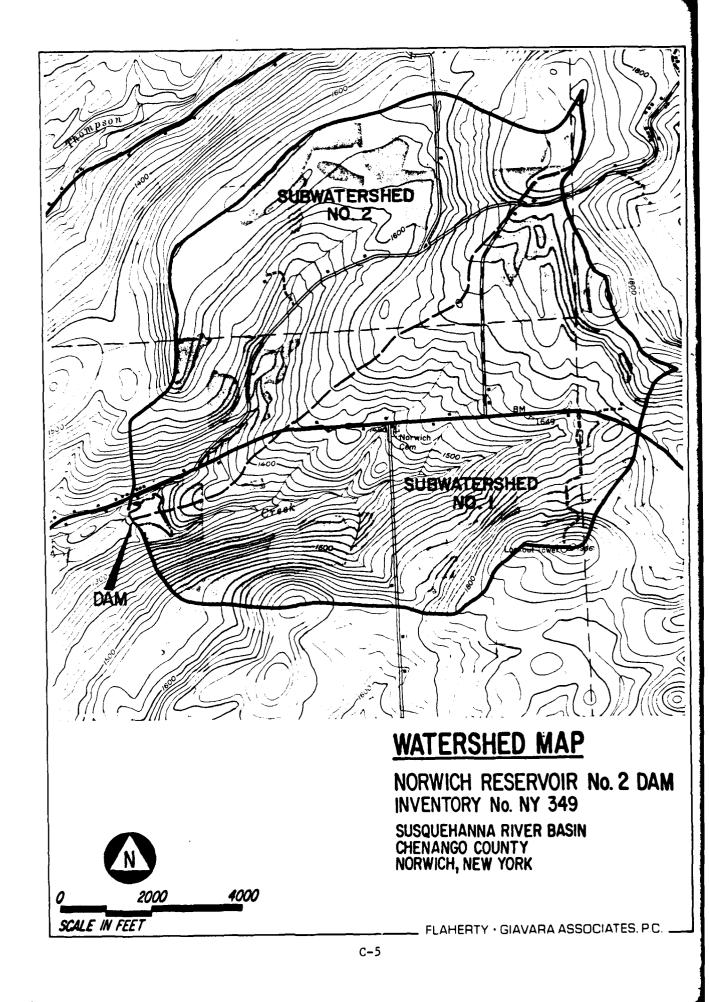

CALCULATIONS

OJECT.	700	
	/ 34°	
l		
1		

FLAHERTY-GIAVARA ASSOCIATES SHEET NO.____ ENVIRONMENTAL DESIGN CONSULTANTS BY

ONE COLUMBUS PLAZA, NEW HAVEN, CONN. 06610/203/789-1280 CHK'D. BY TEW DATE 5-7-6

= 44

WATERSHED DATA FOR HES I SHIDES HADES SATE

1) Time to Penic - Sub-Watther No.1 L= 15,500 ft = 2,94 miles Lc= 8,000 ft = 1.52 miles Ct: 210 for average Slope.

> Tp= 2.0 (294 x 1.52) = 3.13 Hours tr = tp = 3113 = 0.57 USE tr: 0.5 tpR= tp + 0,25(tr - tr) = 3,12 + 0,25 (0.5 - 0.5?) = 3,11 Hours

DRAWAGE AREA = 13 40,7 AREE = 2,09 12

2) The to Peuc - Euchweiterenes More L= 15,000 ft = 2.84 miles Lc= 7,000 ft = 133 miles Ct = 2.0 for average Slopes

> Tp= 2.0 (2.84 × 1.33) = 2.93 Hours tr: to = 2.90 = 0.54 USE tr = 0.5 tpR= tp + 0.25 (te-tr) = 2.98 + 0.25 (0.5-0.54) = 2.97 Hours

Decrease And = 1083 6 Acres 1 169 3

3 To Impervaci

Barr - 1

Force 1700 - x 25' = 495 x 2 -House 201 & hongeste Conserve 415

THE ASSESS CONTRACTOR OF THE SECOND



FLAHERTY-GIAVARA ASSOCIATES SHEET NO. 2 OF 13

ENVIRONMENTAL DESIGN CONSULTANTS
ONE COLUMBUS PLAZA NEW HAVEN, CONN. 08610/203/789-1260

CHK'D, BY TLW DATE 5-7-61

Watershed NO 2

10.6 xcres = 1.0% 1083.6 Acres


4) Rainfail Daia (From nudrometeorolousas Report NO. 33).


> 24 Hour Duration PMP = 20.2 12 65 For 200 equal miles

Duration 115.	Adv. Facier 1.
ن	111
12	172
5 4	133
1 8	143



ENVIRONMENTAL DESIGN CONSULTANTS BY RAC DATE 5-1-81 ONE COLUMBUS PLAZA, NEW HAVEN, CONN 08510/203/780-1280 CHK'D, BY TLW DATE 5-7-61

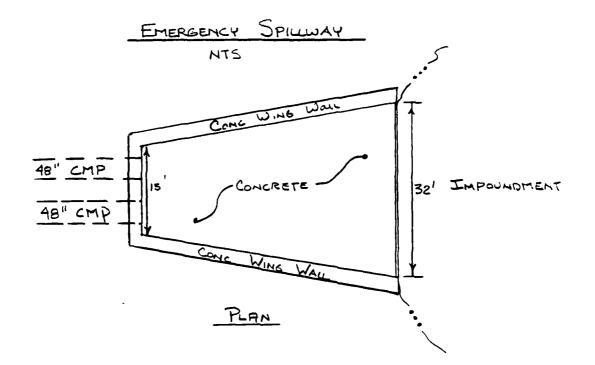

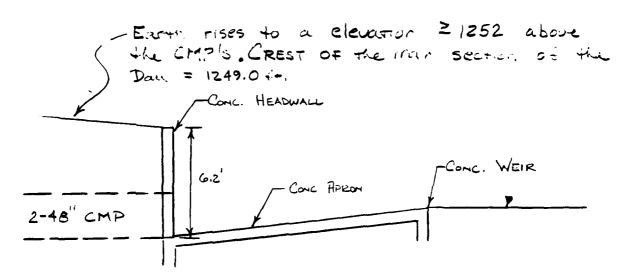

PROFILE

EMERGENCY SPILLWAY

The outlet capacity of the imergency Spirmay (2-48" cmp) was as 12 by examining the structure his different controlling flow construct that many after depending on the here which on the structure. Flow conditions were looked at in the following order - A) Flow over the transporar concrete weir ; E) will which y inlet control, c) assuming charlet control, and Di for spen crance, flow.

A stage discrarge curve was planted for the flow flow conditions will be timed stage discharge curve was derived than the plot by selecting the controller discharge for a given stage. It was a way that no such expence of the maritum will take place, ou submergence is possible.

Overtopping of the daw was as you to occur over the many crest of the dam only elouding for the HEC-IDE comput festest coercipping of the main section only (No Dulyman Acts).



FLAMERTY-GIAVARA ASSOCIATES ENVIRONMENTAL DESIGN CONSULTANTS ONE COLUMBUS PLAZA NEW HAVEN CONN 06610/203/769-1260

SHEET NO. 5 OF 13

BY DATE 1- 5

CHK'D, BY TOW DATE 5-7-5

EMERGENCY SPILLWAY

A) WEIR @ 2-48" PIPE:

Supe of trangular weir 2 10 to 1

Q=CLH1.5

L= Length @ Impoundment = 321

HED		Q ÉT À	ELEV USUN
0	_	-	1245.6
0.2	2.82	8.1	1245.8
0.4	ವ್ಯಕ್ತಿತಿ	229	1246.0
0.6	2.86	42.5	1246.2
08	2,90	66.4	1246 4
1.6	2.91	93.1	1246 3
1.2	2.92	122.3	1248 8
1.5	2.93	172.0	1247.1



FLAHERTY-GIAVARA ASSOCIATES SHEET NO. OF 13 ENVIRONMENTAL DESIGN CONSULTANTS ONE COLUMBUS PLAZA, NEW HAVEN, CONN 08610/203/789-1280 CHK'D, BY TLNV DATE 5-7-91

STAGE DISCHARGE FOR EMERICON TYPICE ! 1-42 UM- 18

B) HILLET CENTROL

<u>.</u>	10/2	<u> </u>	20	They (Jack)
1.2	<i>0</i> .3	2 Crest or	= CON., YIE Z	1245.6
). 5	0.4	16	32	1245,7
200	0.5	23	4.5	1246.4
	5, 3	32	، ، سامان	1246.3
3.0	٥, ڪ .	55	100	1247.4
3.5	3.9	<u> </u>	;	12473
4.5	5.5	73	Carry .	1248.4
~ } , 📆	1.1	<i>3</i>	15+	1246.3
4.6	, 2	11	early may be the	243.0
50	(15)	155		1243.4
5.5	, 4	∏ ⊘	220	1247.3
	:.5	11-1	288	1250.4
6.5	1.60	125	250	1255 3
7.0	1.5	140	280	1251.4

INLET and Control towns Liberaryes Fix Marketin & The World Down to Some Transfer or is a property of the second of 1 15 CHYTCHILE THARTS FOR THE LEW TON IS SULVERTS .

FOR INLET CONTROL APPRIAGE VELLITY WAS NEGLECTLD.



FLAHERTY-GIAVARA ASSOCIATES ENVIRONMENTAL DESIGN CONSULTANTS

EMERICENCY COLLUNAL BLAST

C) POTES CONTES

L= 112'

T= 0.024

KE = 0.5

The assume = To top 20 1000, Ele 1= 1243.6

NV = H + ho - LSo = H+ 4 - 0.3

H (FT)	<u>a</u> ((75)	2 Q (C+S)	<u>w</u>	ELEV USGS
0.5	40	<i>9</i> 0	4.2	1249,1
1.0	55	110	4,~	1249,6
Z.0	77	154	5.7	1243.6
3,0	95	195	6.7	1250.6
4.0	110	220	7.7	1251.6
5.0	121	242	2.7	252.6
60	135	275	9.	1253.6
7.0	150	300	12.7	1254,6

D) OPEN CHANNEL FLOW

INV=1243.9, flow ciarts e 1245.9 due se

D(FT)	<u> Quiden (</u> 3F\$)	Qc.cu17 (50	S. WTOTAL DES	Espaina.
<i>2</i> ,5	1.4	1,5	2,4	1244,4
1,5	ت بی	4.5	1.3	(244)
15	13.5	15.5	24,0	1245 4
7:	22,3	16.0		1245.7
24	45.0	32.0	r	1242.)
3.9	47.0	3 5.0	30 (0)	1247 -

CIPEN CHANNEL FLOW FROM NOMOGRAPHS FOUND IN U.S. DEMARTMENT OF TRANSPORTATIONS, HYDRAULE DEMAN SELLE II. E. (DECIGN CHANNEL TO CHANN

	PROJECT	<u> </u>	f.a	ENVIRONMEN	GIAVARA AS: TAL DESIGN CO ZA NEW HAVEN CONN	NSULTANTS	SHEET NO	DATE	1.2.2
	_		STA	DISCHA			• :		
		HALET Controc	Ę	MERCENCY	Spillian			. <u>}</u>	
	OUTLL: CONTIKUL	O							
	OUTULI © CONTRO	O	•						
			<u>.</u> 6	×				700	Ç.
			8	Θ	⊙				Discharge (eff
(6		o 0				T) (1)
				P	``	⊙			
					OPEN				
					0 ()				
	1252.4 7	-+1/52	7.032	1246.4) 19AT2	1246.4	1245.4	1244.+	
	1				C-13				




ENVIRONMENTAL DESIGN CONSULTANTS

BY RAC DATE 4-2-8

STAGE DISCHARGE CURUE EMERGENCY Spilling C-14

PRINCIPAL SPILLWAU

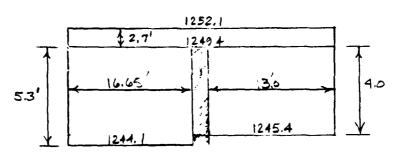

C=3.5

ವಿಕರಿಸಿತ

	Q=(3)LH115
STAGE (FF)	DIECHARGE (CFC
1244.1	0
1244.4	8.2
1245.4	74.0
1245.6	95 ,3
1246.4	213.2
1247.4	40%
1248,4	<i>i</i> 4€.0
1247.0	<u>ಕ್ಕಿಪ್</u> ಟಿ
1243.4	401.5

9 (1.0, 52) 12x300,3

२+ = 12511 CFS

€ 1251.4

= 5a //

RT= 14220 CFS

@1252.4

$$Q_{1} = (0.6), 76.05, 10 \times 32.0 \times 57$$

$$= 1014.5$$

$$Q_{2} = (2.5), (40), (60), 50$$

$$Q_{3} = (2.5), (40), (60), 50$$

$$Q_{4} = (4.4), 50$$

$$Q_{5} = (4.5), 50$$

$$Q_{5} = (4$$

= 85%



VIRONMENTAL DESIGN CONSULTANTS BY RAC DATE 1-1-2 COLUMBUS PLAZA, NEW HAVEN, CONN 08510/203/789-1280 CHK'D. BY TLW DATE 5-7-5

3 1253.4

=6.8.3

ê 1254.4

$$Q_{2} = (aG)(52) = 2432.2 \times 7.7$$

$$Q_{2} = (aG)(52) = 2432.2 \times 7.7$$

$$Q_{3} = (aG)(52) = 243.2$$

$$Q_{3} = (aG)(52) = 343.2$$



Cumulative Stage Discharge

Principal & Emergency Spilling

STAGE (FT)	PRINCIPAL (CFS)	EMERGENCY (cfs)	TOTAL (CFS)
1244.	0	_	J
1244.4	8.2	_	8.2
1245.4	74.0	_	74.0.
1245.6	95.3	_	95.3
1246.4	-13.2	50.0	263/2
1247.4	409.7	77.0	483.7
1248.4	J48.0	Sec. 20	746.5
1249.0	2.3.2	1230	934.2
1249.4	921.5	145.0	1066.5
1250.4	1251.1	183.0	1434.
1251 4	1422.0	=14.5	1636.0
1252.4	(54) ô	2880	1505.8
1253.4	13.1.4	263.0	21294
1254.4	0,1003	294.0	24842

PROJECT - - +-FLAHERTY-GIAVARA ASSOCIATES

ENVIRONMENTAL DESIGN CONSULTANTS
ONE COLUMBUS PLAZA, NEW HAVEN, CONN. 08610/203/789-1240

CHK'D, BY TLW DATE 5-7-61 STAGE DISCHARGE CURVE PRINCIPAL & EMERGENCY CHURAS C-18

HEC-1 FLOOD HYDROGRAPH COMPUTATIONS

1981

FLAHERTY GLAVARA ASSOCIATES, P. C.	力 不不不 化二二二甲基甲基苯甲基甲基苯甲基甲基甲基甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲甲	FLOOD HYDROGRAPH PACKAGE (HEC-1)	DAM SAFETY VERSION JULY 1978	LAST MODIFICATION 26 FEB 79	

NATIONAL DAM INSPECTIUN PROCHAM, PHASE I REPORT, CORPS OF ENGINEERS - NEW YORK DISTRICT DAM INVENTORY NO NY 349, NORMICH RESERVOIR ND 2 DAM, CHENAHGO COUNTY, NEW YORK, JUNE 27, SPEPARED BY FLAHERIY GIAVARA ASSOCIATES, P.C., ONE COLUMBUS FLAZA, NEW HAVEN, CONNECTICUT 120, 0.30	1 0	-	0 000	1	0 01		1249 4 1230 4	1066 5 1434.1		
DF ENG CHENAN 1BUS F	0	>	0	0	C	VED O	1249 0	934.2		Ω
CORPS (2 DAM, CONE COLUT	0.7	METHOD		1 МЕТНОD	·	2 COMBINED	1248 4 13	746 0		I.CULAT I DI
1 REPURT VOIR NO	9	SNYDER	•	O 1 SNYDER METHOD 1 143	(07 ° 1		486. 7		TWDRK CA
WICH RESERVASSOCIATES	n: C	0 0 10 INFLOW HYDROSRAPH, SUB-WATERSHED NO. 1, 3.78 3.78 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	1	0 НУВПОВРАН, SUB-WATERSHED NO 2, 1 1 69 3 78 20 2 111 122 133	•	SUB-WATERSHEDS NO. MODIFIED PULS METHOD	1 1246, 4 1247, 4	263 2		SEQUENCE UF STREAM METWORK CALCULATIONS OFF HYDROGRAPH AT 1 UFF HYDROGRAPH AT 1 1 THYDROGRAPHS AT 1 TE HYDROGRAPH TO 0F NETWORK
UN PRUCE 349, NUF GIAVARA	0	B-WATERS	•	B-WATERS		SUB-WATE	1243	2.50 9.90 9.90 9.00 9.00 9.00 9.00	375 0	OF SEQUENCE UF STREAM RUNDFF HYDROGRAPH AT RUNDEF HYDROGRAPH AT COMBINE 2 HYDROGRAPH TO ROUTE HYDROGRAPH TO BYDROGRAPH BYDR
INSPECTI NO NY AHERTY 30	0 3	tAFH, SU 2 09		:APH, SU 1 69 111	1.5		1245	2123.4 2129.4 2121.1 21.1	1 5	E COUNTY OF THE PROPERTY OF TH
IAL DAM INENTORY ED BY FL	0	HYDROSE 1	0.63	HYDROGE 20 2	0 63	INFLOW HYDROGRAPHS I I RESERVOIR ROUTING	1244 4	1628 1828 1828 1254 4	in N	РРЕVІЕМ
	0		3.11	INFLOW	2, 97 0, 92		1244			
	ร็วก็	×₹.Σσ	. ⊢ 3 ×	X X E J	⊢3 ×:	주 <u>목</u> 목록:	7 7 7 1 7 4 1	 		s.
लग्दरी के प्र	0.61.	B 2-2-	. n. e.	อรกต	269	្រុក្ខា ថ ្ង ខាន មេតុជាស្វាល	ម្ចាស់ មានក្រុម	anaman anaman anaman	n n n	£

RUN DATE 6/27/ TIME 3 01 FM

MULTI-PLAN ANALYSES TO BE PERFORMED NPLAN= 1 NRTIO= 9 LRTIO= 1 RTIOS= 0.10 0.20 0.30 0.40 0.50 0.60 0.70 0.80 1.00

SUB-AREA RUNDFF COMPUTATION

LUCAL INAME ISTAGE I SAME 878 000 00 MUNS I 878 00 00 JPR T RAT10 INFLOW HYDRUGRAPH, SUB-WATERSHED NO. 1, SNYDER METHOD ISTAG 1COMP IECON ITAPE JPLT 0 0 0 0 PMS R6 R12 R24 R48 20.20 111.00 122.00 133.00 143.00 HYDROCRAPH DATA TRSDA TRSPC 3 78 1 00 SNAP TAREA 2 09 SPFE 0.00 1HYDG

STRKR DLTKR RTIDL ERAIN STRKS RTIDK STRTL CNSTL ALSMX 0.00 0.00 1.00 0.00 0.00 1.00 0.00 1.00 0.00 1.00 0.

L ROP T

RT 1MP 0 01

UNIT HYDROGRAPH DATA
TP# 3.11 CP#0.63 NTA* 0

RECESSION DATA
STRIG* -2 00 GRCSN* -0 10 RTIOR* 1 50
APPROXIMATE CLARK COEFFICIENTS FROM GIVEN SNYDER CP AND TP ARE TC* 7.22 AND R* 5 49 INTERVALS

70000 24444 A00000 PER1UD 61 62 63 64 **E**RS**R**S ガラアの END-OF-PERIOD FLOW
CUMP 0 MU DA
4 1 02
4 1 02
4 1 02 20000 00000 000000 **mooo**o noooo \$0000 N0000 PER 100 素ローーい 3-1-1-1 00001-1-1 00001-1-1

00000 00000 00000

178 29

	71516
000000000000000000000000000000000000000	3 72
00000000000000000000000000000000000000	25 17
	28 83
44444777777777777777777777777777777777	SUM
BPPPOOLITIGUE 44 V D 4 4 7 7 7 BB 3 P 5 0 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
——————————————————————————————————————	
00000000000000000000000000000000000000	
00000000000000000000000000000000000000	
しょうしょうしょうしょう はいいい かいいい かいいい かいいい かいいい かららららららららん カルヤヤヤ サンジン ちょうしょう しょうしょうしょう しょうしょう しょうしょう しょうしょう という しょうしょう よっぱん りょうしょう カー・ション しょうしょう よっぱん アジャン・ジャン・ジャン・ジャン・ジャン・ジャン・ジャン・ジャン・ジャン・ジャン・	
######################################	
55555555555555555555555555555555555555	

1 * 0 \(F \)

	655(X) 0					ZXXX LLLL	Z	
	AND EXCE							
	PRECIPIL) AND EXCESSIX)			•		* * .		
	o 9	•						
. VOI UME 21405 20405 26-48 672-70 2951 3640	ငဏ							
10TAL	0 0		,	• .				
72HUUR 595 17 26 48 672 70 2951. 3640.	(*) O			•				
24-H0UR 1403 40 24 98 634 62 2784 3433	STATIUN 1 INFLUM(1), BUTFLUM(D) AND UBSERVED FLUM(*) ROOO \$5000 0 0 0 0		. ,		 	 ·		
6-HUUR 3616 102 16-09 408-79 1793:	STATION (1) AND UBS O	•			•			
РБАК 46/4. 132	OUTFLOW((400(
	FLUW(1), 3000 0	. •	•	•				
CFS CMS INCHES MM AC-FT THOUS CU M	IM 2005 0			•				
	1000			•				

PAGE 0005 FLAHERTY GIAVARA ASSUCIATES. C-23

44-4.	ال با بال	والمناف لمالي	نالالال

	٠			•	0000 na 0000 1988 1988		400 H 0 H 0 H		
					0000 T 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	•	10 0 4 V 1 4 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9		
	·				0.00 1.00 1.00 1.00 1.00 1.00 1.00 1.00	VOLUME 7140 202 2 25 67 27 275 384	4508884 <i>4</i>		
		• .	• •	·		TOTAL VOI	10 2 32 2 2 3 3 3 3 8 1 9 3 8 8 1 9 3		
		4			MOOOW 44 400 7 10 4 4	72-HOUR 60. 2. 65 67. 27 295 364	AN 1. RIII 0000 77 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		
	, .				1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	24-HDUR 140 2 50 63 46 278 343	1 FUR PL 0 0 2 19 2 14 1 22 2 102 13		
					1 1 2 1 4 2 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	6-HOUR 362 10 1 61 40 88 179 221	A1 S1A		
					HYDROGRAPH 6 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	PEAK 467 13	HYDRUGRAPH 1 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		
•		•	•	•	£0000mg;	CFS CMS CMS INCHES MM MM AC-FT	11-040444 61-040444		
		•			000111 882 981 981 981	11 , SUOHT	0000346		
— 					00004. 00004. 00004. 00004.		### ##################################		
	#####################################								

C-24

FLAHERIY GIAVARA ASSOCIATES, P.C.

PAGE 000A

c	
	_
C	L
Ç	ſ
Ĺ	L
<	•
۰	4
* (5000	2
č	ň
ĭ	Ü
4	1
	1
٥	ċ
\$	1
:	į
•	
ζ	9
,	
) -	-
٥	Ľ
٠	ľ
;	į
_	

4 1014 80074	4		4-4904 4-4904 4-4909 4-4909	
146 146 146 146 146 146 146 146 146 146	444 444 444 444 444 444 444 444 444 44		24.00.00.00.00.00.00.00.00.00.00.00.00.00	
B04 168 72 48 48 VULUME 14281 5 34 134 34	239 239 239 239 239 239 239 239 239 239	VOLUME 21421 607 7 93 201 81 885	11169999999999999999999999999999999999	VOLUME 28562 809 10 59 269 08 1180
888 197 73 50. TOTAL	73.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.	TOTAL	ATIO 4 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	TOTAL
933. 230 78 32 72-HDUR 119 134.34	728 728 728 11. 17. 17. 17. 17. 17. 17. 17. 17. 17.	72-HDUR 179 201. 81 885 1092	PL 2010 1.1 1.1 1.1 1.1 1.1 1.1 1.1 1.1 1.1	72-HDUR 238 10 37 269.08 1180.
269. 269. 34. 24-HOUR 281. 3 00. 126.92	257. 221. 11. 11. 12. 13. 14. 18. 18. 18. 18. 18. 18. 18. 18. 18. 18	24-HDUR 421 12 7 50 190 39 1030	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	24-HOUR 361 16 9 99 253. 85 1113
65 85 85 57 57 6-HOUR 723 723 81.73		6-HOUR 1085 31 32. 63 122. 63 538.	A T T T T T T T T T T T T T T T T T T T	6-HDUR 1446 41 41 163. 30 71.7
PERAK PAGG P. P. P	YDRUGRA	PEAK 1402 40	YDROGRA	PEAK 1870 53
777 373 89 99	ี้ ตัวเกา ตัว เกา ตัวเกา ตัว	:	107 - 107 -	
659 442 92 61. CFS INCHES	AC-FT THGUS CU M 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	CFS CMS CMS INCHES MM AC-FT THOUS CU M	64-44-4-10-10-10-10-10-10-10-10-10-10-10-10-10-	CFS CMS INCHESS MA AC-FT
i	•	i	;	
5336 1023 44 4.	4 4 8000 8000 8001 8001 8001 8001 8001	; ;	2001 1001 1001 1008 1008 1008 1008	
	· · ·		÷	

1007 1003 1007 1007 1007		4446888849998		200 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
11.11.11.11.11.11.11.11.11.11.11.11.11.		2 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4		2011 2011 2011 2011 2011 2011 2011 2011
2004 1000 1000 1000 1000 1000 1000 1000	. VOLUME 38702 1011 13.24 336.33 1820	1 1/4001 0000001 01-144-10000/0	42843 1213 1213 13 89 403 62 1770.	
A 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	101AL	2 11 2 6 11 2 6 11 2 6 11 2 6 11 2 9 9 11 2 9 9 11 2 9 9 0 1 2 1 5 1 5 1 5 1 5 1 5 1 5 1 5 1 5 1 5	JR 101AL	20 10 20 20 20 20 20 20 20 20 20 20 20 20 20
4 PLAN 1. 22 22 22 23 23 24 4 1946 1316 1316	R 72-HOUR 298 13 24 1 336 39 1 475	R PLAN 1. 2 27 27 92 92 92 92 92 92 92 92 92 92 92 92 92	R 72-HOUR 357. 10 10 7 403 62 1770. 2184	R PLAN 1, 22 493 440 311 32 722
1164000462461 1164000462461	24-HDUR 702 20 12 49 317 31 1392	1 FUR 2011 2014 2014 2017 2017 2017 2017 2017 2017 2017 2017	24-HDUR B42 24 14 99 380 77 1670 2060	2 FUR 2 1 68 2 8 2 8 9 1 9 1 3 2 4 7
4-10HGGKAPH	PEAK 6-HOUR 1337 1808 66 8 03 204 38 896 1106	## URUSRAPH AT STA	PLAY 6-HOUR 2804 2169 61 79 61 249 25 1076	HYDROLPAPH AT STA
EU686	1130 PES 1130 PES 113	######################################	2	
0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-	114. 2. 2. EVERTA	0.01-30% -0.00% 0.00 8 -0.00% -0.00%	186 9.6.1981	14-0 384 64 14-0 384 64
1 34 24 2 BOC		6 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		

4 200 190 8		1100 1100 1100 1100 1100 1100 1100 110			
500 1443 1683		11 12 12 12 12 12 12 12 12 12 12 12 12 1			
589 253 169	VOL. UME 47783 1415 18 54 470 89 2065	135 135 1077 1017 3218 2674 193	VULUME 57124 1618 21 19 538 16 2360 2912	1	VOLUME 71405 2022 26.2 26.48 672.70 275.1
688 263 176	T01AL	7110 8 2 2 128 128 138 138 174 771 786 3001	10TAL	ATID 9 160 160 160 192 4433 963 983 376 201	10TAL
804 274 183	72-HDUR 417 12 18 54 470 89 2065 2065	PLAN 1, R 2 2 2 1 106 346 348 3739 3739 318 303	72-H0UR 476 13 21 19 538 16 2360 2912	PLAN 1. R 133 100 100 100 100 1148 1148 1148 1158	72-HDUR 593 17 26 48 672 70 2931 3640
942 196 190	24-H0UR 982 28 17 49 444 23 1948 2403	1 FOR 23 76 33 104 104 1076 2711 3711 3711 3711 3711 3711 3711	24-HOUR 1123 32 19 99 307 69 2227 2747	1 FOR 977 977 977 1 40 1 40 1 40 1 40 1 40 1 40 1 40 1 40	24-HDUR 1403 40 24 98 634 62 2784 3733
108 297 198	6-HOUR 2531 72 11 26 286 13 1255 1358	A1 S1 A1 S1 A	6-MUUR 2892 82 12 87 327 00 1434 1769	A 12 1	4 HOUR 3616 102 16 09 408 73 1773
	96 AK 97 SE 99 SE 199 S	HYDRUGRAPH 22 22 22 22 22 22 22 22 22 22 22 22 22	PEAK 3739 106	HYDROGRAPH A 4	РЕАК 4674 137
1307 310 705	25.25.25.25.25.25.25.25.25.25.25.25.25.2	22000000000000000000000000000000000000	CFS CFS CFS INCHES FF AC-FT	18 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	ນທິນ ຣ ⊬ຣ ວິວັຊີ (ລ
60 4016 6016 6016	INCI AC THOUS CO		INC AC THOUS C	111 2007 2007 2007 2007 2007 2007 2007 2	CFS CMS INCHES M MAC-FT THOUS CU M
1831 264 224				1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	

	IAUTO	CAL O	•	RTIMP 0.01	
	ISTAGE	SAME LO	R96 0.00	ALSMX 0.00	!
	T INAME	BI MONS	R72 F	CNSTL 0 00	;
	THE LOW HEDROGERY SOB MATERSHED NO 2. SNYDER METHOD STAGE IAUTO 15144 ICOMP LECON ITAPE JPLT JPRT INAME ISTAGE IAUTO 0 0 0 0 1 0 0 0	RATID ISNUM ISAME LUCAL 0 000 0		LUSS DATA LUSS DATA LUSS DATA LUSS DATA COUNTY OF UNITED BY STRING STRIL CNSTL ALSMX O 0 00 0 00 0 00 1 00 0 00 0 00 0 00 0	UNIT HYDROGRAPH DATA TPs 2 97 CPs0 63 NTAm 0
SUB AREA KUNDFF COMPUTATION	SNYDER M APE JP 0	H DATA TRSPC 1 00	PMS R6 R12 R24 R48 20 20 20 111 00 122 00 133 00 143 00	ATA RTIOK 0 1 00	RAPH DATA
A RUNOFF COM	D NO 2.	SNAP TRSDA TRSPC 0 00 3 78 1 00	PREC1P R12 22 00 1	LUSS D	T HYDROG
SUB ARE	WATERSHE COMP 1E		# W 11	14 ERA	INO CALL
	5144 50B	TOHE TAREA	PMS 20 50 1	91 BE 1100	
ı	HI DRUJK	10H2	SPF E 0 00	MA 00	
	וניו רחיז	1HYDG		91 STR	
				186	

15. 15. 10. CP = 0.63 VOL = 1.0 201. 166. 30. 25. 5 4. .4D R# & C. 230. 36. ORDINATES, LAG 211 234 93 44 -PERIOD FLOW END-OF-COMP UNIT HYDROGRAPH 32 END-OF-PERIOD 53 108 163 94 78 64 15 10 **素の……ほほりは48000620回りから**

8

RTIOR= 1.50 BO AND R= 5.29 INTERVALS

RECESSION DATA
STRIU -2 00 GRCSN= -0 10
APPROXIMATE CLARK COEFICIENTS FROM GIVEN SNYDER CP AND TP ARE TC* 6.

#####################################	66120. 1872 31)		O CIP(L) AND EXCESS(X)
			PRECI
			c
20000000000000000000000000000000000000	8.7 F	7AL VOLUME 66020 30 28 30 28 769 19 27.28 3365	4000
60000000000000000000000000000000000000	! !	72-HDUR 101 550 16 30 28 769 19 2728 3363	3200
83786438665128318316776689000 83786438663661831677668800000000000000000000000000000000		3069 1220 87 1220 87 25 19 09 682 83 1522 2419 1877 2984	STATION 1 AND UBSERVED FLUM(2500 3000
		РЕАК 3988 113	UUTFLUM(U)
)	CFS CMS INCHES MM AC-FT THOUS CU M	1000 1500 1500
00000000000000000000000000000000000000	·		0000

1*0VF*

FLAHERTY GLAVARA ASSOCIATES. P.C.

PAGE 0012

PAGE 0013

FLAHERTY GIAVARA ASSOCIATES. P C

FLAHERIY GIAVARA ASSIN LATES P. C.

	и — шр4еи— чиры афцирафор		404444 404444604 40047448604 604444	
	2000 - 10 00 00 00 00 00 00 00 00 00 00 00 00		=8 = 0.00 0.00 0.44 ± 8 € 0.00 0.44 ± 8 € 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	
: : :	1990 1990 1990 1990 1990 1990	VOLUME 6602 187 3 03 76 92 273 337		VOL.UME 13204. 374. 6 06. 153 84. 573.
•	A110 1 1 30 4 8 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	R TOTAL 2	7 1 1 0 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	TOTAL
	7 000000000000000000000000000000000000	72-HQUR 55 3 03 76 92 273 337	PLAN 1. 7 1. 8 14 15 16 16 16 16 16 16 16 16 16 16 16 16 16	72-HUUR 110 3 6 06 153 84 546
	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	24-HOUR 122 122 22 64 242 242 242	1 FUR 2 2 2 2 2 2 2 2 2 2 2 2 2 2 4 4 7 7 7 7	24-HOUR 244 7 7 5 7 136 41 3484
	4 5 	6-HOUR 307 1 29 1 25 122 188	4 5 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	6. HOUR 614 13 3 38 304 375
	4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	444	PRUGRA	के कर 867 14
	. #59-2 0 54 0 575556	20 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	± - 000 300 100 000 000 000 000 000 000 000	H 63 SODE
	3-45 V 16 44 4 4 5 6 5 6 6 6 6 6 6 6 6 6 6 6 6 6	सूत्र सूत्र १५० सम्बद्धाः		= .v.
	୨ଳଗ୍ରେମ୍ବର ଅଧିକ ଅଧିକ ଅଧିକ ଅଧିକ ଅଧିକ ଅଧିକ ଅଧିକ ଅଧିକ		ad ad Histophy Histophysia His	
10 00116 10 00117 11 00119 11 00119 11 00109				

n

n

2 I FOR PLAN 1, RTIO 3

HYDRUGRAPH AT STA

ζ,	į
a	ı
ű	Ċ
Ľ	
•	
	į
	ì
ŭ	į
4	ı
4	
4	į
3	
-	
۲	
2	
6	
3	
3	
i	

	737.146.157.77 7888446.74481		4.000 1000 1000 1000 1000 1000 1000 1000		0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.0
c c	4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4		######################################		611 130 130 140 140 140 140 140 140 140 140 140 14
PAGE 0015	200 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	VOLUME 19806 361. 9 08 230 76 818 1010	4.00 0 1 1 4 5 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	VOLUME 26408 748 12 11 307 68 1091	201 244 244 201 201 201 201 201 201 201 201 201 201
	8 1 6 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9	10TAL	7. 17. 17. 17. 17. 17. 17. 17. 17. 17. 1	TOTAL 10 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	## 4 4 4 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5
	9 1 9 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	72-HDUR 165 9 08 230 76 818 1010	PLAN 11106 UAN 10090 A 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	72-HDUR 220 6 12 11 307.68 1091	PLAN 1.1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	44 7 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	24-HOUR 366 10 8 06 204 61 726 893	24.02.02.02.04.4.4.4.0.00.00.00.00.00.00.00.00.00.0	24-HOUR 488 14 10 74 272 81 968	1 FOR 129 129 129 100 100 100 100 117
	4894-9400+0W	6-MOUR 921 26 3 07 128 73 457		6-HDUR 1228 33 6 76 171 64 609	H
	4@n@mon/h44	₽ 1196 34	DROGR	7 00 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	######################################
U		CFS CMS INCHES AC-FT AC-FT	Enull 400 000 000 000 000 000 000 000 000 0	CFS CHS INCHES AC-FT S CU #	2000 90 90 10 10 10 10 10 10 10 10 10 10 10 10 10
CIATES. P	48844444444444444444444444444444444444	II THOUS	-6.23 2.23 2.24 2.24 2.24 2.24 2.24 2.24 2	THBUS	24274EEV 248EE
RA ASSOC	0.000 0.000 0.000 0.000 0.000 0.000 0.000		10000000000000000000000000000000000000		1000 1000 1000 1000 1000 1000 1000 100
ERTY GIAVARA ASSO			!		
¥	•		•		

Pre

: 3 3

001
PAGE

	1111 1111 1111 1111 1111 1111 1111 1111 1111		1467 1467 1467 1467 1460 1460 1460 1460 1460 1460 1460 1460		9 6
	16 14 13 13 13 14 13 15 15 15 15 15 15 15 15 15 15 15 15 15		1004 1004 10044 10044 10040 10040 10040 10040 10040 10040 10040		17.
VOLUME 33010 935 1314 184 59 1364		39612 39612 1122 18 17 461 31 2019	208 208 208 208 203 203 203 203 203 203 203 203 203 203	46214 46214 1309 21 830 938 43 1910 2356	16
TOTAL	01 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	10190	2010 7 29 29 29 29 29 29 29 29 29 29 29 29 29	2 TOTAL	RT10 8
72-HOUR 273. 15.14 384.39 1364	.	72-HOUR 330. 18 17 461.91 1637. 2019.	201 1. R	72-HDUR 389 11 21 20 338 43 1910	PLAN 1. 6
24-HOUR 10 17 13. 43 1209.	1 FOR	24-HDUR 732 16 11 1409 21 1491 1790	1 FOR 10 10 181 181 181 27 149 2791 2791 2791 164	24-HOUR 834 24 18 80 477 42 1693	3 1 FOR
6-HOUR 1939 43 8-43 214 93 761 939	ATS T	6-HOUR 1841 52 10 14 237 46 913	1 STA	6-HGUR 2148 61 11 83 300 36 1063 1314	H AT STA 4 10
PEAK 1994 36	22/08/06/RAPH 3 1 1 2 4 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	PEAK 2393 68.	HYDROGRA 10070000000000000000000000000000000000	PEAK 2791 79	HYDRUGRAPH 3 10
CFS CAS INCHES AC-FT	HYDROGRAPH A 2	CFS CMS INCHES MAC-FT AC-FT	HYDROGRAPH A 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3	CFS C S INC S AM AC-FT	m o-
11 THOUS	100 10 10 10 10 10 10 10 10 10 10 10 10	II THBUS	######################################		
	07.20.04.04.04.04.04.04.04.04.04.04.04.04.04		1000 1000 1000 1000 1000 1000 1001	<u> </u>	ЮФ

C-34

FLAHERTY GLAVARA ASSOCIATES, P.C.

744, 1110, 1110, 144, 152, 152, 152, 153, 154, 154, 154, 154, 154, 154, 154, 154		11	
2008 2008 2018 2018 2018 2009 2009		27.22 27.22 27.72 27.73 29.32 29.32 29.32 29.32	
234 238 238 2683 2684 2684 2684 2684	VOLUME 32816 1496 24 23 615 33 2182 2692	6 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	. VOLUME 66020. 1869. 30. 28 769. 19 2728. 3365.
2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	2 TDTAL	7110 9 177 180 180 1119 2677 3677 3679 216	R 10TAL
227 229 229 88 197 197 3154 274 180	72-HDUR 440. 12. 24. 23. 615. 33. 2182. 2692.	PLAN 1. 1 16 16 286 286 110 110 3942 337 223	72-HDUR 550. 30.28 769.19 2728.
2022 2027 2027 1020 1130 1130 1187 1187	24-HDUR 976 28 21 48 343 62 1938 2387	1 FOR 2288-228 2210 2210 3210 3311 231	24-HDUR 1220. 35 26 83 682 03 2419 2984
10272 1087 1087 1084 1084 1982 1982	6-HBUR 2433 70 13 31 343.27 1217	A PERM - PERM GORDE	6-HOUR 3069. 87. 16 89 429 09 1522.
	90.	roracer	РЕАК 3988. 113
21 145 128 134 244 273 1213 2014	C T T T T T T T T T T T T T T T T T T T	H4 11 12 12 12 12 12 12 12 12 12 12 12 12	CFS CMS INCHES MM AC-FT THOUS CU M
2001 1116 1202 1204 1204 1104 1114	CFS CMS INCHES MM AC-FT THOUS CU M	25.5 2.5 2.5 2.5 2.5 2.5 2.5 2.5 2.5 2.5	IN A THOUS
20 20 20 20 20 20 20 20 20 20 20 20 20		2112 2112 2142 2143 2460 2460 2460 2460 2460 2460 2460 2460	

***		********	***	*******		******	* *	*	******
			COMBINE HYDROGRAPHS	/DROGRAF	HS				
	INFLOW HYDRUGRAPHS ISTAG		SUB-WATERSHEDS NO 1 & NO 2 COMBINED ICOMP IECON ITAPE JPLT JPRT S 2 0 0 0 0 0 0	TAPE	40 2 CL JPLT 0	OMBINED JPRT 0	INAME	INAME ISTAGE TAUTD	1AUTB 0
	3.1. SUF	SUM OF 2 HYDROGRAPHS AT 1. 1. 2. 2. 3. 3.	06RAPHS AT 1 2 2 2 3 3	~	PLAN 4	1 PLAN 1 RTID 1 2 2 4 4	⊶ (1 ∕J		-a-

-60

ن به
ASSUCTATES.
GIAVARA
FLAHERIY

				0												:	
	4 10001144 00001144	į	•	Ö	٠.	• • .	• .		•	•							
OQ:				900	٠.		·	-					•		,		
PAGE 0018	24 111.00 100 100 100 100 100 100 100 100	VOLUME 13742. 2389. 71. 58 71. 568. 700.		800									•				
	4114 41134 41134 41134 7004	TOTAL		700	٠,	٠.	•			•							
	4 1 1 4 4 5 1 1 4 4 5 1 1 4 4 5 1 1 4 4 5 1 1 4 4 5 1 1 4 4 5 1 1 4 1 1 1 1	72-H0UR 115. 2. 82. 71. 38 568. 700.		009 009		4 .	٠.										
	36 106 106 106 106 106 106 106 106 106 10	24-HOUR 262 7 2.58 69:54 520 641.	-	085ERVED FLOW(*) 300	• • ,					4							•
	23 48 8 6 7 7 7 7 8 8 7 7 7 7 8 8 8 6 7 7 7 7	6-HGUR 668 19 19 1 63 41 78 331	STATION	O) AND OB									•				
		PE.AK 853 24		UUTFLOW(D) AND				٠								-	
;	27 765 1665 0 27 765 1665 0 27 765 1665 0 27 765 1665	CFS CMS INCHES MM AC FI IS CU M		INFLOW(1), 300													
		INCH INCH INDUS AC		200													
	25 25 20 473 473 843 843			100													
				011	(A tu) at	10 00 00 00 00	~ 60 5	10	<u> </u>	12.	161	15.0	4000 4000 4000	10.0 10.0	17.8	 	- - - -

C-36


1

C	
۵.	
ASSUCTATES.	
GIAVARA	
FLAHERIY	


48-104-04-04-04-04-04-04-04-04-04-04-04-04-0	! :
12 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3	:
4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	27483. 27483. 264 143.17 1136.
т риме шари т риме шара 4 е п п 4 е и а и и и и и и и и и и и и и и и и и	TOTAL
PL AN 1 7.4 2 31 1 1 4 5 3 3 1 1 1 4 5 5 3 3 1 1 1 4 5 5 3 3 1 1 1 4 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	72-HOUR 229. 5 64 143 17 1136.
A A T A B B B B B B B B B B B B B B B B	24-HOUR 124. 13 16 131 07 1040.
2 HYDROGRAPHS 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	田 04 女 0 0 文
1 5 5 4 5 5 1 1 1 1 1 1 1 1 1 1 1 1 1 1	CFS 17 CMS 17 CMS 10CHES MM MC-FT 1 AC-FT 1
1 1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	ING P. SURILL
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
6 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	

STATION

FLAHERIY-GIAVARA ASSOCIATES NEW HAVEN CT F/G 13/13 NATIONAL DAM SAFETY PROGRAM. NORWICH RESERVOIR NUMBER 2 DAM (IN-ETC(U) AUG 81 H C FLAHERTY DACWS1-81-C-01006 AD-A107 414 DACW51-81-C-0006 UNCLASSIFIED NL 2 - 3

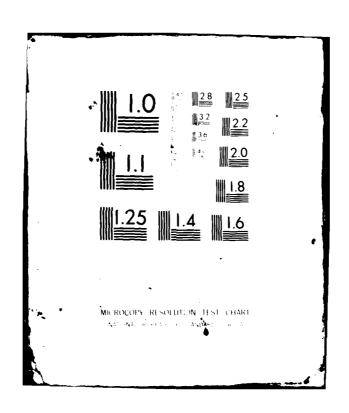

RUN PATE 6/27/ TIME 3 OT FR

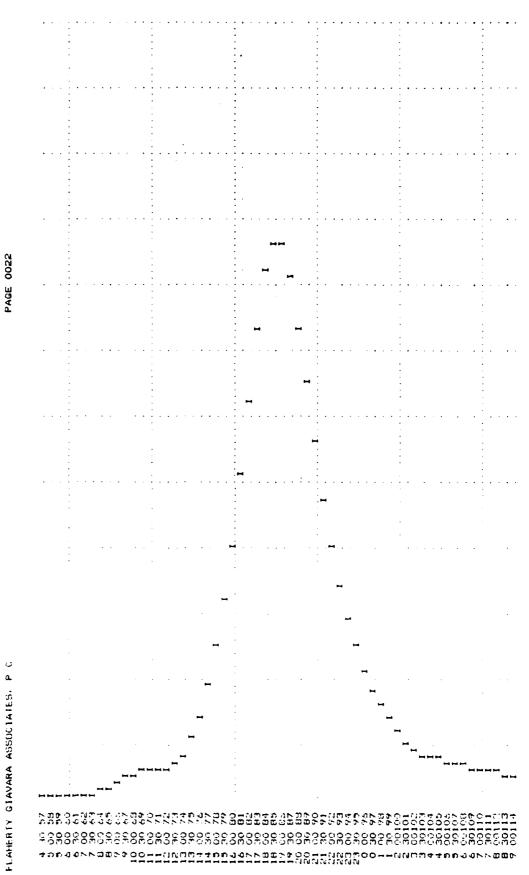

*N^O*1

4.7.9.4.0.4.
4 × × × × × × × × × × × × × × × × × × ×
A TIO 3
1 PLAN 1 33 126 126
A
OF 2 HYDROGRAPHS (2)
SUM OF 2
40- (140)/
υ 14 α δ δ 10 δ α δ α δ

123. 127. 127. 128. 1206. 1670. 1847. 124.			0				. ,		
4 / 5 4 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6			ó					•	
4 / 14 / 14 / 14 / 14 / 14 / 14 / 14 /	VDLUME 41227 1167 1167 214 75 1704		0	-					
2 2 2 2 2 3 3 4 4 5 6 7 7 7 8 7 8 7 8 7 8 7 8 7 8 7 8 7 8 7	T0TAL		2800						
1480 1480 1480 1480 1490 1490 1490 1490 1490 1490 1490 149	72-HDUR 10. 10. 214. 73 1704.		FLOW(*) 2400			,		÷	
0044018 0044018 0084018 0084018 0084018 0084018	24-HDUR 786. 22. 7. 74 196. 61 1560.	- Z		,					
2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	6-HDUR 2003. 37. 4.94. 123.33 994.	STATION	INFLOW(1), OUTFLOW(0) AND OBSERVED 0 1200 1600						
	PEAK 2388. 73.		OUTFLOW 16						
24 4 4 4 7 5 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	CFS CMS INCHES MM AC-FT THOUS CU M		NFLOW(I),						
1489711994111994111994111994119941199411	I THOUS		800	٠	٠		•		
100 6 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			400		•			٠	
			0	11	31	141	119	71	_
		00F						000	
		*		-		.,			

6/27/ 3.01 FM NATE TIME RUM

- C-41

in the contract of

FLAHERTY GIAVARA ASSOCIATES, P.C.

		•		•	
		· ·	• •	•	· ·
	• •		• • • • • • • • • • • • • • • • • • •		
					:
				•	
		· • • • • • • • • • • • • • • • • • • •	: :		
		•			
					• •
		• • • • • • • • • • • • • • • • • • •	· ·	·	• •
				•	· ·
		•			•
	. • •	• • • • • • • • • • • • • • • • • • •	• • • • • • • • • • • • • • • • • • •		
		:: : н н	•		·
		. H H			
		·	: i	•	
		, н н :			•
	i	. H	:	•	• •
		· :	· ·	•	• •
			•		
		. .	.		
			. H		
	1	::			
	`` .		:. 	•	
	t	•		· ·	· ·
	H	: 1	. 		• • •
		: . 	. 		
м м м м мммм ммммм ммммм ммммм ммммм мммм	-				· •
н н н н н н н н н н н н н н н н н н н	•	:		· .	•
pel pel pel pel pel pel pel pel pel pel pel				•	•
мины нынин нимины нимин	• •			·	•
т .	•		· ·		
	1			•	ныны

1688 745 1003 7110 1884. 1884. 1884. 764. PLAN 14. 168. 160. 160. 968. SUM OF 3. 10. 10. 100. 100. 100. 279. 247.1.47.1.643.1.6

30. 179. 34. 222. 1271.

6/27/ 3.01 PM S N


C-43

まならなアプログラのひょうごごうさいひょうごごうきょんますらんなアプログラグラック

						•														:
				o '							• : .	• •								:
											:				:					
	નાંલાંલાં			0					. . .											:
	2226. 463. 2483. 163.										:									
							:	;			:				:					•
	2581. 2581. 258. 172.			3600.	• • •			• •	• • •		• : .					• •				
92	Ni ·			ตั							:									
PAGE 0026	ci ni ni ni	F0~000-0		6				:		.	. :									•
PAG	2930. 629. 269. 179.	VOLUME 34970 1557 11. 27 286. 34 2271 2802.		3200			:	٠												
		TOTAL					:				:									:
	3247. 729. 280. 187.	0		2800.		· • • ·	. :	• · ·	• •		• : .	•				٠		• • •	.	:
	m'''	Sec. 45.		ផ							:									:
	ക്ക്ക്	72-HDUR 458 13. 11. 27 286. 34 2271. 2802.		€																•
	3446. 846. 291. 194.			FLOW(*) 2400.			:				:									
	26. 23. 23. 24. 10.48. 26.2. 26.2. 26.2. 26.5.	-				:				:									:	
	<u> </u>	7	OBSERVED 2000.			. :		• •		• • •	٠.						•		: -	
		STATION	AND OI							•				•					:	
	3264. 1154 316 211. 211. 2674 76. 167.14	ST	₹ 60			:														
			1600																	
		РЕАК 3450 98		JUTFL																
	2922 1356 329 219	()		DW(1), QUTFLOW(0) 1200 1600.					٠											
	반인민준단의			30																
) a	& O M &	INCHE PAC-18		INFLO																
res,	2489 1600 343 229	II THUUS		000											•					
C I A															·					
A \$5(2033 1892 393 238			400	•				•			-								•
/ARA	ผล			•															·	.
61A				0-	N641	772		=55		 15.00	752	HE:	- IO -	.1.			- 		ain.	0
FLAHERTY GIAVARA ASSUCIATES			fr i.e.		8888															
Ft. AH			1 *OVF								00		าเปต						000	
-					C-44	.														



FLAHERTY GIAVARA ASSOCIATES, P C

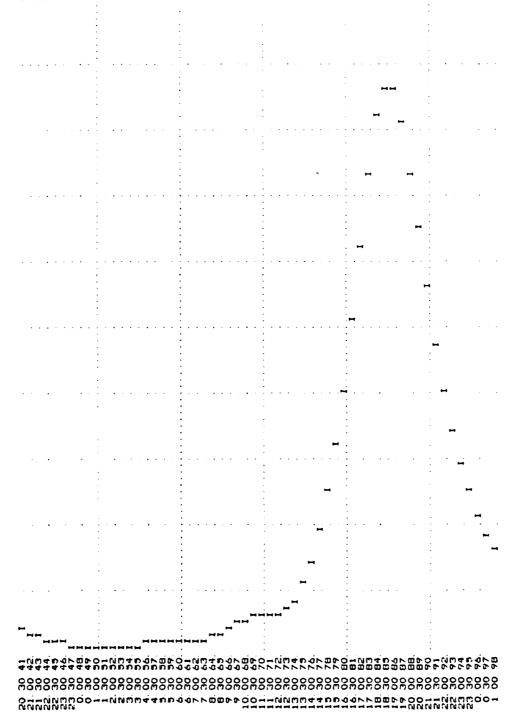

7.50.44 P. 10.44 P. 1 PAGE 0028 2800 | THELUM(1), CUTFLOW(0) AND OBSERVED FLOW(*) 800 | 1200 | 2400. STATION 6-HOUR 3342. 95. 8 23 208.92 1657 PEAK 4313 122 SUM OFS CMS INCHES MM AC-FT FLAHERTY GIAVARA ASSOCIATES, P.C. 482 112 2000 112 2000 112 2000 112 2000 112 2000 20 400 0725 888 ********

PAGE 0029 FLAHERTY GIAVARA ASSOCIATES, P.

C-4.7

E. Z. FLANERTY OLAVARA ABBDCIATES F.C. 10

		HS AT	O F	110	203 634	1479
		HYDROGRAPHS 3	170	131	174 493 493	1231
		SUM OF 2	17 128.	133 63	149 418. 4384	2034
			93.			
			16 71.			
30 1					ř	'n
12 00120	1 *DON*					


25 25 25 25 25 25 25 25 25 25 25 25 25 2	
24 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	VOLLUME 82450 82450 16-91 429-50 4207 4203
RTIO 6 226 276 276 276 1000 111946 1000 1000 1000 1000 1000 1000 1000 10	101AL
2511. 2511. 2511. 2511. 2511. 2512. 2517. 2517.	72-HDUR 687. 16.91 16.91 429.50 3407. 4203.
A 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	CFS 5176 4011 1573. CMS 147 4011 1573. INCHES 147 72-73. AC-FT 250,71 393.21 42 AC-FT 2453. 3848. 4
HYDROGRAPHS / 9 / 9 / 9 / 9 / 9 / 9 / 9 / 9 / 9 /	6-HDUR 4011. 114. 9 87 250 71 1989 2453. STATION
ณ	9176 147.
SUM DE 1129 DE 1128 DE	CFS CMS INCHES MA AC-FT AC-FT
407.49 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	I SUOHT
2002 2002 2003 2003 2003 2003 2003 2003	

 1000	1200	1500. 2000. 2000.	AND UBSERV	2500. 3000.	3300	4000	4500	2000	2200
٠	•	•		٠		٠			
	•				٠				
			-						
	:								:
				*					
	•			٠	٠				
				-					
				-				ė	
			٠			•			٠
								٠	
	٠							•	٠

o

アードリウムかの国人とややないなかないでして



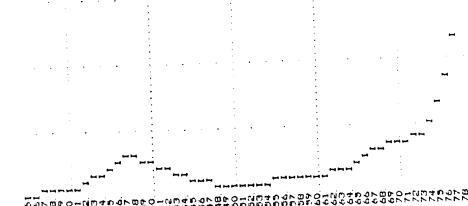

44444444のおおおからちゃちょうからなるなるなるとアアアアアと田田田に日本のとは日本ちょうと思すらいここでは、日本のここでは、日本のとに日本では、日本のとに日本では、日本のように日本では、日本の

C-50

FLAHERIY GIAVARA ASSOCIATES, P.C.

				.g
H H				04 0 1000 1000 1000 1000 1000 1000 1000
	· ·	·		1101 1001 1001 1001 1001
		· · · ·		R T I I I I I I I I I I I I I I I I I I
	H			1 PLAN 1 7 AN 1 7 AN 1 7 AN 1 7 AN 1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
	H			H5 A7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7
	1	. , , , , , , , , , , , , , , , , , , ,		HYDROGRAPHS 6 6 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8
	, H			SUM OF 2 10 10 10 10 10 10 10 17 4 17 5374
	, , , , , , , , , , , , , , , , , , ,			00000000000000000000000000000000000000
			мын мын	61 1 64 64 64 64 64 64 64 64 64 64 64 64 64

-C-51

D ()	1	٠,٠
ن	c	L
	4	ر

		ó									•											· .				
0034		ď			• •			-						-												
PAGE 0034	TOTAL VOLUME 96197. 2724. 19 73 301. 09 3979. 4903	0							•														•			
	JR 72-HOUR 802 23 23 19 73 75 501 07 75 501 07 79 4903	_					٠.						·													
	6-HOUR 24-HOUR 1635 1635 1635 18.06 292 49 458 75 2320 2862 4489	STATION 1 NAND OBSERVED FLOM(*					• •																			
	PFAK 6. 2038 171	STATI INFLUM(1), OUTFLOW(0) AND	200 4000											•												
IAIES, P C	SHORT SHORT SHORT WM T 1 3A M UO SUGHT	CHOLON	3000																							
VARA ASSOC			1000																			1		-	pri (m)	•
FLAHERLY GLAVARA ASSOCIATES.		1 # GVF #	9	200 000 000 000	00	83	100	32.	12	ရှင်	<u>ن</u> 100	39	ŝ	16	38	8	33	38	83	33	3	ခဲ့မှ	ξ.	10 00 00 00 00 00 00 00 00 00 00 00 00 0	2	


! ;

FLAHENTY GLAVARA ASSOCIATES. P.C.

127 E 24 E		o ·	
0.110 0.110		ó	
2457.00 277.00 277.00 2000.00	109940. 109940. 22.13. 272.67 4443. 5604.	0	
ATIO 8 110 8 120 120 120 120 120 120 120 120 120 120	10 TAL 10	7000	
1 BLAN 1 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	00R 72-HDUR 916- 916- 94-22-35 27-67- 39-5604	1 ED FLOW(#)	
A A A A A A A A A A A A A A A A A A A	R 24-HDUR 2097 2097 6 20 64 6 524 29 4199	TION 1 DBSERVED 5000.	
2 HYDROGRAPHS 72 24 126. 174. 174. 232 6528 6528 632 632 632 632 632 632 632 632	PEAK 6-HOUR 6701 5348 175 131. 13.16 13.16 2632 2632	STATION OUTFLOW(0) AND OBS	
24 - 1 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2	CFS CMS INCHES MM AC-FT THOUS CO M	INFLOW(I).	
122 122 1244 2444 176 176 176 1800 1800 1900 1900 1900 1900	II SUCHI	I Groce	
284 284 284 284 71 162 497 3783 478 476 476			
		1.07	ନ୍ତନ୍ତିକ୍ରିକ୍ରିକ୍ରିକ୍ର ୦୦୦୦

FLAHERTY GIAVARA ASSOCIATES, P.C.

.C-55

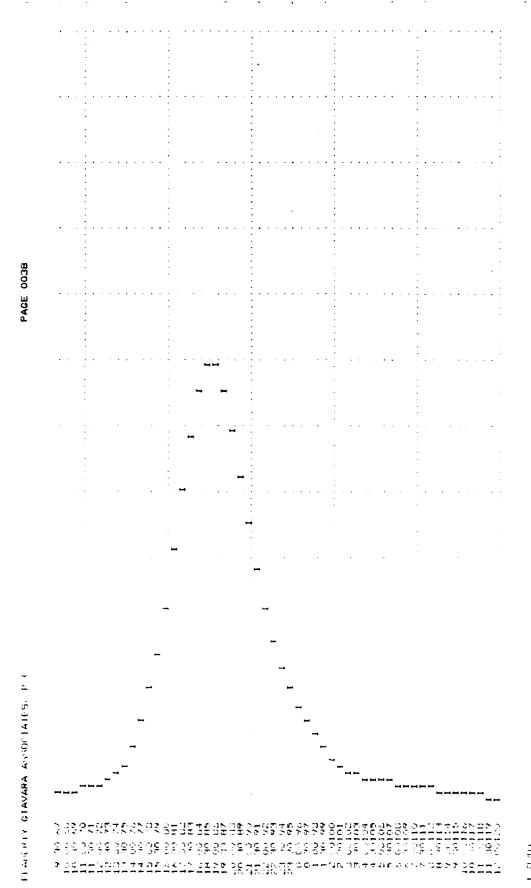

4			ó	•								•		
######################################			9000						*			•		
2525 272 272 273 273 173 173 173 173 173 173 173 173 173 1	137423 3871. 28.18 713.84 5679.		8000											
RTIC 9 2017 2017 2017 2017 1919 1919 1911 1911 1911 1911 1911 1	R TOTAL 8		7000								a	٠		
1 PL AN 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	72-HDUR 1145 32. 28.18 5 715.84 5679		FLOW(*) 6000.											
7 AT 2 AT	24-HDUR 2621. 74. 25.76. 535.36. 5199.	NO NO	OBSERVED F				•							
HYDROGRAPHS 15 123 218. 123 2290 822 8150. 8889.	6-HBUR 6685 189 16. 45 417 83 3315 4089	STATION	JW(G) AND							-		•		
SUM OF 2 HY 18. 18. 29.2. 20.2. 20.3. 20.3. 20.3. 20.3. 20.3. 20.3. 30.3. 30.3. 30.3.	PEAK 8626. 244		1), DUTFLOW(D) 300. 4000.	•			•							
7.1.1.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.	CFS CMS INCHES MM AC-FT THOUS GU M		INFLUM(1),		٠		,	÷				ě		
	÷													
7 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -	·		1000		II				101		in set in			
		1 +0.7 F +	8		ဂိုင်	100	38	898	288	168	S 2 6	S8:	26	158

FLAHERTY GLAVARA ASSOCIATES, P. C.

PAGE 0040

ASSUCTATES,
GIAVARA
FLANERTY


g									-				
t a c					Н	- -		•					,
ei ga g					ı								
25 S			,										
c s ii						,							
	. .				•						:		:
	" .						,						
		•		•								,	
	, I												
	₩ ►												
		•										 	
	•												
												 ٠	
,													
				•									
	•		•										
	***		****		*	*****		*****	* * *	*	*****		
					HYDRUGRAPH ROUTING	APH ROU	TING						
	X	RESERVOIR ROUTING ISTAG	_	TODIFIED P	PULS METHOD IECON ITA	TOD ITAPE	J.	T JPRT	INAME.	ISTAGE	1AU10		
		94.038	0 000 0	• • • • • • • • • • • • • • • • • • •	IRES	ROUTING DATA IRES ISAME 1	101	T IPMP		LSTR			
		;		NSTDL O	LAG O	AMSKK 0 000	× 000 0	X 15K	STURA	STURA ISPRAT			
al AGE	1244 10	1244 40 04 9001	400 200 200 200 200 200 200 200 200 200	50	12545 60 1254, 40		1246 40	1247 40		1248 40	1249 00	1249 40	1250 40
30.14				20	95 30		263 20	486 70		746 00	934, 20	1066 30	1434, 10
į													

FLAHERTY GIAVARA ASSOCIATES. P C

								44 9- 10 V	4 Gi	600 600 647.	OGHAMMIN	20040V	######################################
								- mar. 7.4		716 71 71 49.	od-4mmr	11. 11. 11. 11. 11. 11.	
				EXPL.				M#6	137 192	786 186 74 51.	CQ-04M4	6744E	11111111111111111111111111111111111111
				CDGI. CAREA 0 0 0 0 0	DAMUID 375	RATIO 1	ORDINATES		⊸രന	8840 716 53 53	00H848	0 4 6 6 E E E E E E E E E E E E E E E E E	44444444944444444444444444444444444444
				ELEVI. CO	M DATA	. PLAN 1.	HYDRUGRAPH	ວ=ນຫຼືຄ: ເທີຍ:		m (A	oo⊶∉nmi	nue	11111111111111111111111111111111111111
4 30				FXPW F	FL COOD	I OI 1	-PER 100	2 E E E E E E E E E E E E E E E E E E E	232	83 83 83	STURAGE	401401 101 101 401	50 P P P P P P P P P P P P P P P P P P P
40 248				3000 000	TOPF1	STATION	END-OF	o≕ณญ่ญ ตะ	555 555 555 555 555 555 555 555 555 55	3408 840 800 60	c <i>o</i> -mnm	40 8 W W W	######################################
2129 4	2	287	1264	1 SPW18				o⊶៧ain	100	400 400 700 600 600	odened	4 p is 3 in p	0.000000000000000000000000000000000000
1828 80	4.	112	1294	CREL 1244 1				Q-1497	200	1641 1020 1021 1031	ପରି=ଲ∉ମ	400VE0	
1636 00	£	c	1244					c=nng		900 900 117 67	೦೦೯೫	#84040	/=0@@@@m /-0@@@@m //0@###################################
	SUPFACE AREA=	CAPACITY=	EL.FVATION=										

4	
TY GIAVARA ASSUCTATES.	ر
TY GIAVARA ASSUCTA	a
TY GIAVARA	4
TY GIAVA	ACC
· ·	TAVA
	7.1
1	4

1245 3 1245 3 15 850, AT 1	IN A SUGHT		100 200.										-	pod t
1245 2 1245 IME 43.00 HOURS	CFS B30. CMS 24. INCHES PA MM MM AC-FT		INFLOW(1), OUTFLOW(0)		,									
0.00 8.00 8.00 8.00 8.00 8.00 8.00 8.00	6-HBUR 24 662 19 1 63 41, 36 328 405,	STATION	D) AND DBSERVED O. 500.				•							
100 H	24-HOUR 72-HOUR 3 2 51 3 65 37 70 65 519 540.	1	RVED FLOW(*) 600.											
1245 1 1245	101AL		700 B						,					
10 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	VOL VME. 1356.3 384. 2. 78 7.0 65 560. 691.		B00. 900								-	•		
12445.0			0	· · ·		•								

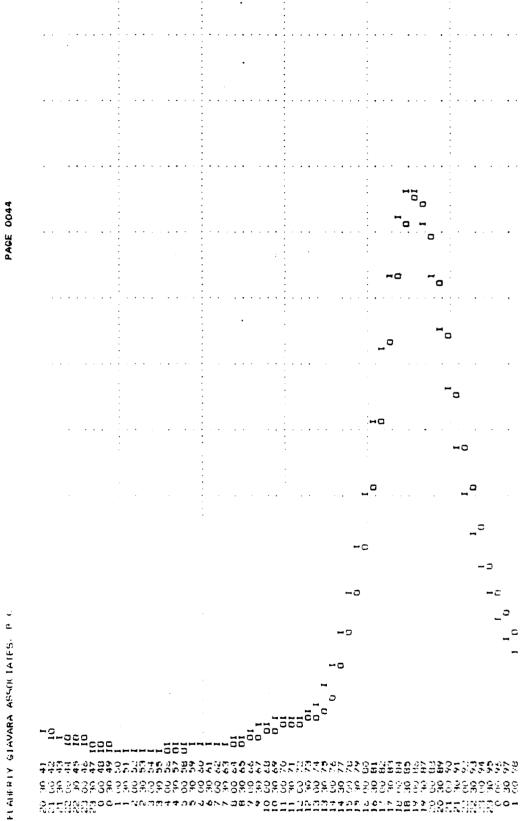

							:					
							:					
ここのようではなる。			0				. • •			• • • •	• • •	
444444444444										•		
กับเกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิด										:		
							:			•		
こころの日日のこれて日ム			ď									
44444444444			600				-					
លល់សេសសេសសេសស			=									
11日日のサア40日の日々	ച്ച മന						:					
สสสทสสทพอสทุก	UME 1987 1988 1848 1848		600				:			:		
	2716 2716 141		2									
	>N -						,					
	ہے											
-00000mm4-04	OTAL											
	¥		ġ.				•			• •	•	
444444444444			9									
ល់លំលំលំលំលំលំលំលំលំលំលំល	≃ മന		-									
	HOUR 2227 56. 3 38 11. 63 386.											
	In the		_									
-0000V-0V4D4	12		.									
44444444444	• •		FLDW(4									
เหมเหมเทนเทนเทนเหน	~ .		2,2									
	240-04BT											
AGE	HOUR 322 124 15 15 16 16 18 18 18 18	_	Ē									
トーこのひょうひつととりん	4 H		₹				: .					
3444404046VUU	C)		1010				•					
ช่นช่นช่นช่นช่นชน เกมเกมเกมเกมเกมเกมเกมเกมเกมเกมเกมเกมเกมเ		Z	1000									
	2 N III N II I	- 1										
	-HOUR 1327 3 27 82 95 638	STATION	AND									
ノもーク田ものごろのごーク	- 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	ໜ່										
44440440430300	•		OUTFLOW(D) BOO									
454445444544	ສູ		₹ 33									
	HOURS E AK 49		<u>ت</u>									
	PE. AK 787 49		=									
	30 = =		ಕ									
- というというというと			.0									
	n ₽		1),									
	ωρώΣ⊢Σ		<u>3</u>									
	72.73		5									
	CFS CMS CMS INCHES INCHES AC-FT		INFLOW(1),									
14804486/83- 2	_ = `S		Ξ ₀									
44440440930	A Î A Î		400									
	ί, Ξ		•									
	172											
	2											
まこちゅうほうアーラブ			_									
444484488269			200									
্লেল্ডাল্লেল্ডাল্ডাল্ডাল্ডাল্ডাল্ডাল্ডাল্ডাল্ডাল্ডা	2		ca									
	3											
	אראא מחוורסא											
	= 5		0-	nie ÷	E) 4] ?	, D 9 /	2-2	2 - 1	21.3	200	almani alaman	1118 8218 8318
	5	~		, O O O	000	יים כוק י	-100		ء جا رب م	· · · · · · · ·	-	J. 121.12 C
	ž	1 ADOL 1	ř	సరేనర	707	137	553	¥ 31,7	iŏħà	7550	SMS.	35.85
	ů,	á		r1	៧៣៩	الجاشار	ນ ທ 43	91.5	33 CC 3	- t- 00		មហ្យុ÷
	-	~										

10 10 10 10 10 10 10 10 10 10 10 10 10 1		≓o :	STATION STATION END-OF-PERIOD OUTFLO 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3
1. 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1			STATION STATION END-OF-PERIOD OUTFLO 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3
10 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0	I. I. O. O. O.		STATION END-OF-PERIOD 1
STATION 1. PLAN 1. RATIO 3 END-OF-PERIOD HYDROGRAPH ORDINATES OUTFLOW 1	1 0 1 0		SIATION END-OF-PERIOD 1 3 3 45 45 45 75 36 36 36 37 31 31 31 32 36 31 31 31 32 31 32 32 33 32 33 33
1. PLAN 1. RATIO 3 HYDROGRAPH ORDINATES W 1. PLAN 1. RATIO 3 HYDROGRAPH ORDINATES HYDROGRAPH O	H		
I. O. IO I O IO II O II O II O II O II			
RATIO 3 ORDINATES 2	H		 1, PLAN 1 HYDROGRAP W 1. 777 738 388 388 388 2592 2292
10 10 10 10 10 10 10 10 10 10 10 10 10 1			
1 +\p\p			ะเนื่อยก เรอสมอนตร- เพลองจุดสมอสุจ

4464 448944 4464 4464 4464	44404404444444444444444444444444444444				o ·		•		
4-647/v000074	44499999877.30 44469999877.30 444699999877.30				0				
40000 40000 40000 40000 40000 40000	######################################		. VOLUME 40883 1158 8.38 212.97 1689 2084.		٥	٠			
	######################################		-HDUR TDTAL 341. 10. 10. 12. 38 1689 2084.		2800			•	
	90 11 11 11 11 11 11 11 11 11 11 11 11 11		HDUR 72-H 786. 22. 7.74 B 8.5.53 212 359. 169.		ED FLOW(#) 2400.		• • •		
ठन्यक्रम्यन्यक्षक्षक्षे इ	44444444844444444444444444444444444444	:	2001. 24-F	STATION	AND DBSERVE 2000				
0-0-K-0-0-86-0-0	######################################	HOURS	73. 122	S	aUTFLaW(B) /	•			,
— чв4ич О≃иариар∠авоа		TIME 43.00	20 20 20 20 20 20 20 20 20 20 20 20 20 2		INFLOW(1), DI				
CHMUMABAAPHA		2392. AT T	INCI AC THOUS CI		IN 800.	•			,
		15			400				
		PEAK OUTFLOW		1 *0VF*	30	888	3888	88	6 00 121 7 00 131 7 30 141 8 00 151

0

FLAHERTY GLAVARA ASSOCIATES. P.C.

C-68

e a STATION 1, PLAN 1, RATIO 4
END-OF-PERIOD HYDROGRAPH ORDINATES ៧ខា

ผก DUTFLOW 5.

6.9

C-69


PAGE 0051

			ī.		U0000			— "៧ភពិភព 	
	3600				0.7.44			1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	18. 181.
• •	3200		VGLUME 34583. 1346. 11.19 284.32 2782			######################################	ลุขนุลอย ลลลูพิดูล ลูขนุลอย ลลลูพิดูล	176. 566. 1882. 1820. 2981. 715. 187.	14. 176.
	2800		10. TOTAL 13. 33. 32. 56. 56. 56. 56. 56. 56. 56. 56. 56. 56		0.0.44	44444444444444444444444444444444444444	+4444444444444444444444444444444444444	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	12. 73.
	FLBW(#) 2400		4-HDUR 72-HDUR 1048 455 10.32 11.19 262.03 284.32 2079. 2782. 2564. 2782.			######################################		1444 1444 1600 1600 1600 1600 1600 1600	11 121 82
	D OBSERVED 2000.	STATION 1	Ñ		06.40	1100 40 40 40 40 40 40 40 40 40 40 40 40 4	STORAGE 10.1.0.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1.1.0.1	10441111111111111111111111111111111111	10 81
. .	OUTFLOW(D) AND	STA	AK 6-HOUR 2673. 18 76. 167.038 1329.	HOURS		44404044 44404044 44404044	Q=465,444,445 Q=465,444,445	1201 1202 1202 1203 1203 1203 1203 1203	9 19 104
	INFLOW(1), OUT		PEAK FS 3457 MS 98 ES 98 MM MM	43 00		11111111111111111111111111111111111111	0-07-47-100-14-8	1486 1486 1486 1486 1986 1988	a 4 7
	INFL		CFS CMS INCHES MES AC-FT THDUS CU M	457 AT TIME		######################################	- 0-049 - 1-049 - 0-04	25.2 141 141 744 744 1640 1640 209	8 35 141
	400			15 34		11111111111111111111111111111111111111	- Manacanana - Manacanana - Manacanana	1000 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	7 2 8 8 1 9 4 1 9 4 1 9 4 1 9 4 1 9 1 9 1 9 1 9
- HUS	0-			COTFLOW					
6688 8688 8688 8688 8688 8688 8688 868		DVF.		EAK OF					

PAGE 0052

FLAHERLY GIAVARA ASSUCIATES. P. C.

PAGE 0053 FLAHERTY GIAVARA ASSOCIATES.

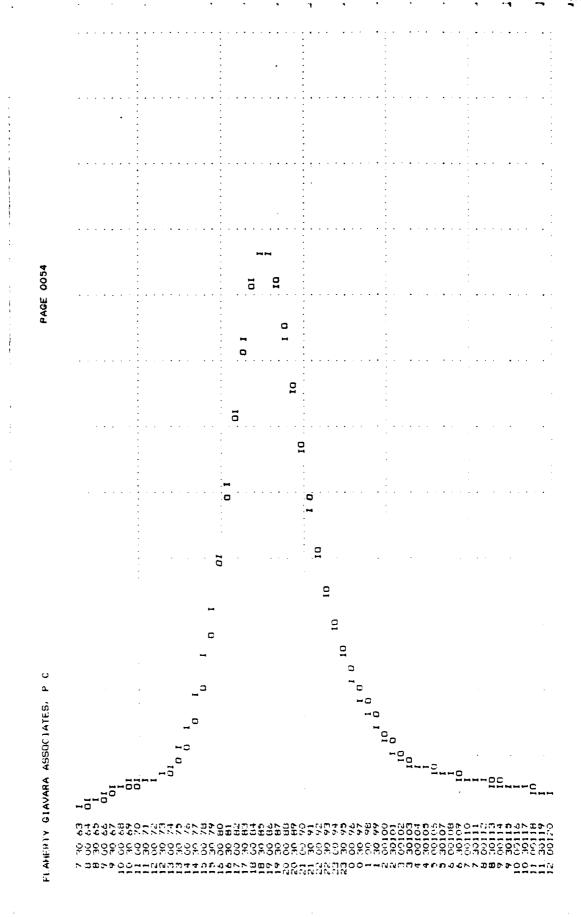

ATES,
-
u
=
ᅠ
ASS0C 1
GIAVARA
•
`
_
_
2
_

		4	œ	23.8 63.63	8	15	2847	323		≓લં	n 85	710	in o	200 E	1244 1244 1244 1244 1244	4 4 0 U	4.4 0.4	6.0	84.	Ó		
		4	ωŅ	227	79.	A LO	3289	223		<u>-</u> . €4			เมษา		1244 1244 1244 6	246 246	246	940	84.	0		
		n	18	222 76	72	1066	3721	231		₩N	48:		.4.4 .0.4	- M- M-	1244 1244 1244 1244 6	246 246 346	0.4 0.4 0.4	949	Ω. O.	r,40		VULUME 68281 1733 14 00 355 67
RATIO 5	I ORDINATES	m	_	202 803 803	400	34	or	365		⊣ (4	E 7.		39.	4.01 0.4.0	112 122 124 124 130 130 130 130 130 130 130 130 130 130	44 30	245 246	24B	944	0		HOUR TOTAL 369 16. 4 00
1. PLAN 1.	HYDROGRAPH		44	168.	, di	, C	4320	254.			E 41		10.00 10.00	10 m	111 666 644 666 660	242	244	747	6.4	246		33
	END-OF-PERIOD H	OUTFLOW 2	i diği	119	ın:	* (*	10-1	398. 264.	STORAGE	- – വ	ici d i	mo r	7.60	000	STAGE 244.3 244.3	4.4 U.U	4.4 U.U	4.	0.7	9		24-HOUR 1310 37 12 90 327.56
STATION	END-OF	'n	ini N	76.	ก	18.60 10.00	i -i ^	418 274		on	e i	4.0.4	47	20. 20.	4.4.4 010.0 010.0	4.0		80	0.0	5.0	ťΩ	6-HOUR 3340 95. 8 22. 208 79
		_					4-	46. 86.		0.4	iei o-i	റിയ്	ર્ગ ભા ં	- 7 m	- U.D.	-0	1	~	, L'01	r.	. OO HOURS	PEAK 4320 122.
			•	wī	ຸກ	11	337	• 4 Ul				- ⊶ณขอกณ		OUN	1 3 1244 1244	124	11 44	4.0	100	124	TIME 43	CFS CMS INCHES
		-	.n.	44	in i	308	3027	244. 298.		0-	67			939 1306	444	C 4	4 4 U.U.	46	0. P	9	4320. AT	_
		c	40	n c	180	91	2463	310		0-		7.0.0		ម្ចាញ់ កម្ចាល់	1244 1244 1244 1344 1344	44	4.4 0.0	90) U 4 ·	9	15	
																					PEAK CUTFLOW	
																					PEAK	

1 *0VN*

1656. 2599. 2 STATION 1 OUTFLUM(0) AND OBSERVED FLOW(*) 2500. 3000.	9300

	CILLICATION
	00000000000000000000000000000000000000
•	にしてののもの独居とより

STATION 1, PLAN 1, RATIO 6
END-OF-PERIOD HYDROGRAPH ORDINATES

	40000 P	ผ⊶๚ฃฃ๔๚๚	44444446 44444460
	2000 2000 2000 2000 2000 2000 2000 200		20000000000000000000000000000000000000
n	46.00.00 46.00.00 46.00.00 46.00.00 60.00		22222222222222222222222222222222222222
1 UKDINATES			44444444 444444444 4444444444444444444
HYDROGRAPI	23 207 207 207 207 207 208 13184 1309 304	# 12 12 12 12 12 12 12 12 12 12 12 12 12	00000000000000000000000000000000000000
END-OF-PEKIOD HYDROGRAPH URDINALES	00TFLOW 7.7.7.160.133.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.	8 108 108 108 108 108 108 108 108 108 10	81 A 44 A
END	9 4 5 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6		11111111111111111111111111111111111111
	6421 6421 6421 6421 6421 6421 6421 6431 6431 6431 6431 6431 6431 6431 643	00000 4 100000 00000 6 4 1000000	11111111111111111111111111111111111111
	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		
	1.00 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	0487408811174	######################################

⋖
ز
_
A ASSUCTATES
GIAVARA
PLANERIY GIAVARA

									:															
12550. 12480.6 12480.6 1246.4			o			•		• •				-										• .		
1250.9 1248.9 1247.0 1246.4			ó	• .		: .				.:														• •
12949. 1 12949. 1 12949. 1 12949. 2	VOLUME 81979. 2321. 16.81 427.03 3388. 4178.		ó					. :		•		٠	! -			•								
151 140 140 140 140 140 140 140 140 140 14	101AL		a										•											
4 4 1251 3 1254 6 1244 1247	72-HDUR 683. 19. 16.81 427.03 3388. 4178.		(*) O										•				•							
1251 1254 1247 1246	19-HOUR 1972. 1973. 15. 48 393. 08 3118.	7	ED FLOW(*)																					
1251 1247 1247 1246 6	ý,	NO I	DBSERVED 5000						: .			•	• •		•									
OV4V	6-HOUR 4009. 114. 230.60 1988. 2432.	STATION	CO) AND						: .															
0 1251 9 1249 6 1247 8 1246 00 HBURS	PEAK 3184 147		DUTFLOW(D) 4000.																					
1251 1254 1244 1246 43			INFLOW(1), (٠														
1250 7 1250 1 1247 8 1245 8 1244 8	CFS CMS INCHES TM AC-FT THDUS CU II		INF1 2000.							• •														
4 0 0 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			1000																					
PESK DOTFLOW			0	112	IE ÷	91 61	11			131	191	121	300	107			501	121	162	1000	1000	-0 -3:	-5	10 23 24 35
PESH U		1 #UVF 4		9 8 8		ရှင်	ã e	222	28.8	90	88	000	38		က် (၁၈	Ç ~∂	200	28	÷ ₹	<u>ွှင့်</u>	36	33	gg.	£3

PAGE 0060 10 i o 2 5 10 FLAHERTY GLAVARA ASSOCIATES, P.C. 0

FLAHERTY GLAVARA ASSUCIATES, P C

88888	000000	000000 000000	9 00114 9 30119 10 30115 10 30117 11 30119 12 00119

ผูนคน เกษุ 4 ผูนกูเกษุ 4 4 0 0 1		992 471. 314.	4393	333	87 123	318	កស	n			
កបស់ក្រុយពីស្ត្រ កបស់ក្រុយពីស្ត្រាស្ត្		1141. 488. 327.	3202	319	86. 4.1.	312	11 26	4			
		1313 309 341	5739	280	111	203	10 25 20 20 20 20 20 20 20 20 20 20 20 20 20	4	ORDINATES	RATIO 7	
		1 0 0 0 0 0 0	-						YDROGRAPH	1. PLAN 1. RATIO 7	
STORAGE 2 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	STORAGE	1771. 334. 370.	6013.	205	199	193.	gi 61	OUTFLOW 3	END-OF-PERIOD HYDROGRAPH ORDINATES	STATION 1	
-0449-4004		2073. 380. 385.	9691.	178	184	133	7. 18	ณ	END-(STA	
-0440000000000000000000000000000000000		2430. 617. 401.	5021.	197	215	83	17.	CU			
4 6 10 10 10 10 10 10 10 10 10 10 10 10 10		2870. 683. 418.	4 4 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	143.	247	62	7 91	-			
04444444444444444444444444444444444444		3391. 782. 435.	3440	133	279	64	90				

1 *0VN*

Ç
œ
ASSUCTATES.
GIAVARA
FLAHERIY

28. 21.	44444444444444444444444444444444444444	į			6						. •			 		• •
0, CI	uuunuuduuduuduu 44444444 44440000,-000 600000000000000000000000000000	į			o					•	•			 		
6	44444444444444444444444444444444444444	į	VOLUME 93678 2709 19 62 498.38	7 79	ö	• • •		٠.				٠				
30 30 30 83	11111111111111111111111111111111111111		101 TOTAL 13. 62. 38. 38.	`	7000.	•								•		
84 1.4	11111111111111111111111111111111111111		JR 72-HDUR 23. 23. 19. 62. 50. 498.38 39. 3934.		FLDW(*)											
0.4 0.4	S A GE		JR 24-HOUR 1834 22. 52. 51. 18. 05 38. 458. 60 4487		OBSERVED 5000	• • •								 		
e 60 80	04 4 4 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	HOURS	PEAK 6-HOUR 6048 4677 171 132 171 11 31 292.38 2319	STAI	•						٠		·			
ยน 4 ง	01101010101010101010101010101010101010	ME 43 00	CFS 60 CMS 1 INCHES 1 FM HM AC HT 15 CC M		INFLOW(1), DU											
37 26	44444444444444444444444444444444444444	6048 AT TI	ING PA DA SUBHI		INF 2000											•
4.0 017	44444444444444444444444444444444444444	15			1000											
		PEAK OUTFLOW		1*0vF*	8	2000 0000 114	23	SS.	200	3 25	335	3.0 5.00	338	368	0.00 0.00 0.00	38

7-

FLAHERTY GIAVARA ASSOCIATES, P C

ם **-**0 ō ē ö

	• • • •		:			4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4
4.						381-10 6 -4441-10 98,444-10,18440 68,44-10,18440
PAGE 0064	 • .					201 201 201 201 201 201 201 201 201 201
						RATIO 8 ORDINATES 327. 127. 127. 127. 127. 127. 1300. 1300.
	HH		· : :			1, PLAN 1, HYDROGRAPH 14 233. 280. 108. 108. 279. 6911. 1737. 1737.
	01 01		* * * * *			ON -PER 10D CUTFLC 22.2.4 1.738
	· · · · · · · · · · · · · · · · · · ·	: :o				STATI STATI 23.7.23.23.24.440.2883.3883.3883.3883.3883.3883.3883.388
		1 10 1				20 20 20 20 20 20 20 20 20 20 20 20 20 2
ATES, P C						- 867 - 4687 - 4
GIAVARA ASSUCIATES,	:		1 10 OI	000000000000000000000000000000000000000		17.7.7.7.9.9.9.9.9.9.9.9.9.9.9.9.9.9.9.9
FLANERTY GIA	80808	3888888	38888	C-	8000000000000000000000000000000000000	ž.

U-04

では、では、これでは、人人のこれでは、これでは、これでは、これでは、これでは、これでは、これでは、これでは、	44444444444444444444444444444444444444				o '					• .	
ମଧ୍ୟ କଥା ଅନ୍ୟ ପ୍ରଥମ ଅନ୍ୟ ବ୍ୟସର ପ୍ରଥମ ବ୍ୟସ	44444444644444444444444444444444444444				o ·	٠					
ี่ต่อและเลย การกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบบการกระบ เกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิดเกิด	44444444444444444444444444444444444444		AL VOLUME 109377. 23097 22 43 269 74 4920.		o		٠	٠	•		• •
	20000000000000000000000000000000000000		HOUR TOTA 26 26 37 74 1320		7000			. •			•
# ####################################	######################################		2096. 72-H 2096. 9 59. 20. 63 20. 63 22 524. 11 969 4138. 45		D FLOW(*)						
5.00 A 20 A	S 444444444444444444444444444444444444		4	STATION	D GBSERVED 5000						
#4-47-11-11-11-11-11-11-11-11-11-11-11-11-11	######################################	HOURS	101. 101. 101. 101. 101. 101. 2601.	STA	LOW(0) AND 4000.						
-04661140668	44464446444444444444444444444444444444	43 00	PEAK FS 6911 MS 198 IFS I98 FT		INFLOW(I), OUTFL 3000						
001401111006400		6911. AT TIME	CFS CMS INCHES NM AC-FT THUUS CU M		TWFL						
04486448 004486498 00448648	44444444499444444444444444444444444444	51			0001						
		PEAK GUTFLOW		1 + 0 / / 7 +	9	3007	88	၀င္ငင္	999	389 389	200

C-83

FLAHERTY GLAVARA ASSOCIATES, P.C.

PAGE 0066

ပ	
٩	
ä	
ű	
₹	
8	
ASSOCIATES,	
GIAVARA	
Š	
≤	
O	
₹¥	
≆	

					•		:		
	·								•
	. нн			• • •					
		e .							
		· · · · · · · · · · · · · · · · · · ·					•		
	0.					•		•	
		1					•		
		5	1	•		•		•	•
	.		0 10		•				
-			1 01						
10			, , , ,	, H			,		
. 		•	•	. 1		2,,,,			
010		•			:	йннн	G		

STATION 1, PLAN 1, RATIO 9
END-OF-PERIOD HYDROGRAPH ORDINATES OUTFLOW

1*07/14

ပ
<u> </u>
ASSOCIATES,
GIAVARA
FLANCHTY

PAGE 0068

411 - 6201 411 - 6201 9040000000000000000000000000000000000	ジョーラムアキョネ ごよはアヨムごようのもで	44 1040 1040 1040 1040 1040 1040 1040 1				o ·
7. 9. 4. 4. 4. 4. 4. 4. 4. 4. 4. 4. 4. 4. 4.	M4-V8-W4-BN-W9 M4-V8-W4-Q0-N-9	440 EV O O O O O O O O O O O O O O O O O O				9000
4 L L 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	ഗ≒= ഗഢജലവു ഗ്ട-സ്രജലവു ഗ്ട-ഗ്രജ്ജ് 4 ഗ്ഗ്ജ	44479977777777777777777777777777777777		VOLUME 136773. 3873. 28.05 712.45 3652. 6971.		8000
26. 126. 136. 135. 135. 135. 136. 186. 186. 186.	្យុងដល់មួយប្រជា ក្រសួតប្រជុំក្នុង ១៤ ភូមិ ក្រសួតប្រជុំ ១៤ ១៤ ភូមិ	44444444444444444444444444444444444444		HOUR TOTAL 140. 32. 32. 2 45 652. 971.		7000
######################################	m ผลายของกุลต านเกเบาระบาร์	00000000000000000000000000000000000000		100R 72-1 520. 1 74. 20. 20. 3. 79 71: 5. 14 71: 5. 14 71:		FLDW(*)
447.09.09.00.00.00.00.00.00.00.00.00.00.00.	TORAGE 4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	84444444444444444444444444444444444444		4 4 9 minus	AT 10N 1	AND OBSERVED
E 19 11 10 10 10 10 10 10 10 10 10 10 10 10		######################################	HOURS	PEAK 6-HOUR 8837 6682 245 189 16 44 417 67 3314 4087	ST#	DUTI LOW(D) AN
24 25 25 25 25 25 25 25 25 25 25 25 25 25		40000000000000000000000000000000000000	IME 43 00 H	CFS B&SCRINCHES BY INCHES		INFLOWCD, DUT 3000
21 E E E E E E E E E E E E E E E E E E E	-84-107-34-8 -94-84-97-48-98-8	66666666666666666666666666666666666666	537 AT TH	INC) OP SUCHI		1NF1 2000
1994 1944 1944 1944 1001 1001 1944	00408WKUMMK49	######################################	8 51 1			10-6
			UFFLOA			∴ =
			PEZK OUTFLOW		* 1/20+1	0E 0

oʻ.

o ·

o . .

8000

548

FLAHERTY GIAVARA ASSUCIATES, P C

G-87 .

FLAHERTY GIAVARA ASSOCIATES.

11 30119

1*0VN*

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND) AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STAFION	AREA	PLAN	RATIO 1	RATIO 1 RATIO 2 0.10 0.20		RATIOS APPLIED TO FLOWS RATIO 3 RATIO 4 RATIO 5 0.30 0.40 0.50	LOWS RATIO 5	RAT10 6	RATIO 6 RATIO 7 0.60 0.70	RATIO 8 RATIO 9 0.80 1.00	RATIO 9 1.00
нурапсварн ат		≥ 09 5.41)		467 13. 24) (935. (26, 47) (1402	1870 52.94)(2337 66 18) (2804 79 41)(3272 92.65)(3739 105 88)(4674 132 36)
HYDROGRAPH AT	. ·	4.38)	ĭ	399.	798. (22. 58)	33, 88) (1595.	1994 36 46)(2393. 67 75) (2791	3150	3908 112 92)
2 COMBINED	<u>,</u> ~	3.78	"	863 24 43) (1725. (48.85)(2588	3450	4313. 122 13) (-	6038 170 98)	6901	8626. 244.26)
ROUTED TO	~ ~	3 78	ĭ	850 24 07) ((48 90) (2592.	3457.	4320. 122-34) (604B. 171. 26) (195 70)(8637 244.56)
					SUMMARY OF	DAM	SAFETY ANALYSIS	វេ				
FLAN 1			ELEVATION		INITIAL VALUE 1244 10 0	SP ILLW	SPILLWAY CREST 1244 10	10P OF DAM 1249 00	DAM 000 €.			
			3				=	•	4			

,

- C-89

FLARERY GIAVARA ASSUCTATES, P. C.

4

LAST MUDIFICATION 26 FFB 79

APPENDIX D PREVIOUS INSPECTION REPORTS/AVAILABLE DOCUMENTS

EXCERPTS FROM TECHNICAL SPECIFICATIONS



THE NORWICH WATER WORKS.

CONTRACT.

	THIS AGRI	FEMENT. MA	de the	Four	5	day of	Offe	il)	
1890 :				Vorks, of No		=	/		and
	Troy	Pu	blee.	norks	Com	ham	<u></u>	inite	£
	8								
***********		. 44 - 4 - 444, <u>111</u> 4 - 47 - 47 - 47 - 47 - 47 - 47 - 47 -	***************************************	, - ándhéir e r - C anna	***************************************	•		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	
							party of	the second pa	art :
_			- /	the second pa	-	•	=	-	-
	-			r the consider					
			•	nto, and unde	· ·	•			_
	•	=		furnish and p			-	-	
				l expense, all					
execut	e and perfo	rm in the m	ost workmanl	ike manner, of	the best mat	terials, and i	n the man	ner, and subj	ject
to all t	he requirer	nents of the	Specifications	, all the work	mentioned,	enumerated	l and calle	d for in the	fol-
lowing	Specification	ons, which S	pecifications a	are hereby mad	ie a part of t	his agreeme	nt and con	ract:	

SPECIFICATIONS.

Description.

The work will consist of the construction of a Storage Reservoir in the town of Norwich, N. Y., and situate above what is now termed "the Storage Reservoir" of the Norwich Water Works aforesaid, and all other work necessary to meet the demands and intent of the plans designed therefor, subject to such modifications as the Engineer may make by reason of unforseen causes or otherwise.

Foundations of all embankments. All embankments are to be constructed upon a well prepared and solid foundation; and the payment rendered will be deduced from the schedule of prices expressed in the proposal for the various materials excavated, or otherwise constructed therefore, regardless of depth or expanse in any direction. In final, the Contractor should exercise his own judgment, arrange his prices and cover all contingencies by the price designated in the proposal for excavation.

Material for embankments

The material with which all embankments are to be made, will be such as is best suitable for the purpose intended, and excavated from such points as the Engineer may direct, and in case any or all such material be found to exist within the consequent slopes

necessary to effect the final flow line of the said Storage Reservoir and for By-Pass Canalshall be paid for in excavation and as otherwise provided, but in case of any excavation being made outside of the same, embracing rock and necessary stripping therefore, shall not be paid for in excavation, excepting material for puddle, hence the only payment to be awarded to the Contractor in such case, will be that deduced from his or their schedule of prices for the work constructed in place with such berrowed material. The Norwich Water Works does not guarantee the existence of all necessary material within the limits of the boundaries of its lands.

All material used for the purpose aforesaid shall be deposited properly in courses extending longitudinally with the bank, having a concaved surface transversely so as to retain a depressed surface at point of puddle wall as represented by the plan, and the various courses so applied, must be of approved material, entirely free from all such stone, lumps, roots and foreign matter as will be deemed detrimental by the Engineer, and the said courses must not exceed a thickness of eight inches at the time of deposit, after which, if considered necessary by the Engineer, it must be rolled with a grooved iron roller weighing at least six hundred pounds to the lineal foot, to such extent as to compact the said course to a degree of hardness approved by said Engineer, and should the action of said roller fail to transmit sufficient hardness, or result in rendering an imperfect bond, the material thus rolled must be sprinkled or wetted sufficiently with water, and if necessary, be re-rolled until sufficient compactness is finally attained. The finest and most appropriate material hauled from time to time upon the bank, must be deposited upon the entire width of the front slope, and be extended also upon the rear slope for at least a distance of ten feet from the rear face of the puddle wall. The construction of rear slopes must receive the same care and attention as specified for the front slope. In final, the only difference allowed between the front and rear slopes is that the material built into the outer portion of said rear slope may be coarser and may also contain a greater percentage of stone, but the amount of stone thus placed will be discretionary with said. Engineer during the time of construction. Frozen material will be disaflowed in every instance, and the amount and payment allowed the contractor for said frozen material will be discretionary with the Engineer.

The face of each and every excavation and borrow-pit must be dressed down and trimmed off so as to produce a good tidy appearance at date of completion, which expense must be covered by the price for earth excavation for material placed in embankment. The final measurements taken by the Engineer of all material having been used, made and placed into the work, will occur upon such dates as he may decide upon, but in no case shall he postpone it unnecessarily, neither shall the Contractor impede the transaction in any form or manner; but on the contrary furnish all facilities, and at times, assistance in obtaining measurements, data, etc. The Reservoir embankment will, so far as possible, be built in conformity with the sections represented by the plans.

N. B .- All earthwork will be measured for payment in excavation only, except, that extra payment will be made for puddle, as herein provided.

quent use on the rear slope of said embankments.

If necessary, a part, or all of the natural soil, consisting of muck, etc., occupying the area covered by the flow line and embankments, will be hauled into spoil banks, for subse-

Earth moved more than once is not to be measured a second time, excepting puddling

material and muck as herein specified. Preparation of surfaces for complete incorporation of additional material are not to be measured until after having attained a depth of eighteen inches, after which the contract price will be paid.

The supply for the Distribution System, or to the "Distributing Reservoir," will be controlled by valves placed within a masonry Inlet Chamber, provided with a bridge as per plans thence passing through a twenty-four or twenty-inch cast-iron pipe, as may be decided upon extending under the embankment; said pipe being thoroughly supported throughout its entire length, and if deemed necessary, a cement masonry wall, or cut-off wall, will be built at its junction with the puddle treuch, or as otherwise directed.

Location of

Puddle trench loundation, width, etc. The Engineer will designate certain points at which stop-walls, consisting of either cement masonry, concrete, puddle or select material, will be built in under and all around said pipe, in accordance with directions, and number required, and the material so placed, must be executed by experienced workmen. The foundation of the puddle trench will be extended down and into a solid and impervious material, and the width at bottom shall be not less than that deemed necessary by the Engineer at the time of construction, which perhaps in no case, will be less than five feet, from which point it will ascend with a variable width, filling every void, situate between said foundation and the original line of the natural surface of the ground, at which point it must be lined into position, also to the proper width, and receive henceforth a batter of about one inch per foot, upon either side of the wall, and terminate with a top width of five feet, at a point situate two feet above the flow line.

Rip-rap

The slope-lining, or rip rap, will consist of stone either wasted from the excavation pit, or procured otherwise, and the price named in the proposal, is for hauling and placing said material only. Payment for excavation will occur only where the stone is taken from excavation pits.

Surface

If deemed necessary by the Engineer, puddle will be placed upon the surface of Reservoir bottom; also into crevices, fissures, etc., and in fact every part of the work; but before so doing, all stone, roots, and perishable matter must be thoroughly removed, from the point of application.

Right of changing plans and amount of work. The amount of work, and the plans therefor may be changed, during the progress of construction, if so ordered by the Engineer; but the contract price shall remain the same, for all material named in the schedule of prices.

Approximate quantities

The approximate quantities of the work to be done, and as stated in the Quantity Sheet are approximate only; and the Corporation reserve the right to increase or diminish them as they may deem necessary.

Price bid to include all work The price bid for each item, is to include the cost of all work and materials incidental thereto, such as bailing, pumping, and draining away water, furnishing all necessary tools, furnishing centers for masonry, furnishing water for all uses, etc., etc. It is intended that this specification shall provide for the full completion of the work above mentioned, ready for use, except as herein specially mentioned; and all labor and materials necessary to that end are to be included in the items to which prices are attached.

Crude timber becomes property of Contractor. All the wood and timber directed to be cut, and herein considered under the head of grubbing and clearing, becomes the property of the Contractor, who must haul it immediately from off the grounds, and deposit all debris of whatever class at points approved by the Engineer.

Skulled labor

The construction work must be done by competent men, skilled in the capacities assigned them by the Contractor.

Escavation

All excavation is to come under the head of earth or rock; the latter to include all hard rock found in a mass of one cubic yard or more, for which explosives, in the opinion of the Engineer must necessarily be used.

All other material found in excavating, of whatever nature, including disintegrated rock, or any other material that can be removed with picks or bars, shall with the exception of muck, come under the head of earth.

The price for earth and rock excavations shall apply to all trenching and foundations for masonry, puddle, concrete, etc., and permanent earth-work of any description necessary for the construction of the works connected herewith.

Muck.

In case a deposit of muck is found, the Engineer may require its removal to such place as he may indicate. The payment for the same being at the price in proposal per cubic yard.

NEW PICKET FENCING.

Feened

A picket fence composed of good seasoned hemlock, free from all detrimental qualities, will, if required, be constructed in conformity with the plan, and upon such lines, directions, etc., as the Engineer may direct. The posts shall be of good, sound chestnut, entirely free from its bark, and have a diameter of at least six inches, midway of tip and butt, and a length of not less than nine feet, all of which shall be set plumb, at intervals of six feet between centers. The back-filling shall be selected from the excavation made for the post-hole, and should such material fail to provide a sufficient amount to refill around said post, in a permanent and satisfactory manner, it must be taken from the general surface of the ground, and completed in a manner as not to produce a trench or pit-hole. The back-fill must be free of stone and thoroughly rammed with properly constructed rammers, during the operation of refilling.

Dimensions.

The pickets shall be four inches wide at base, three inches wide at top, one and one-quarter inches thick, and six and one-half feet long, spaced at intervals of seven inches apart at centers. They are to be securely nailed to a top, center and bottom rail, being two by four inches wide; and also finished off by a rail at top and bottom, planted upon the pickets in the manner represented by said plan, and the whole to be executed in a good and workmanlike manner. In case it is necessary to grade up or off such material as the engineer may direct in order to maintain a reasonably parallel grade between the base of the pickets and the finished surface of ground line, the same must be done, and the cost thereof must be included in price per linear foot of fence complete.

Gates

N. B.—At points designated by said Engineer, substantial swing-gates shall be constructed of the aforesaid material.

The necessary hinges, locks, hasps and cross-bars, shall be of approved class and material. The entire set of locks must be of the same pattern; accompanied with duplicate keys, and the cost of said gates per linear foot must be covered by price per linear foot specified in the schedule sheet of prices.

TIMBER BRIDGE.

Vacemel.

At the point designated by the Engineer, a timber farm bridge of the form, span, etc., represented by the plans may be built across the By-Pass Canal, and the material called for and built into said structure, must be of first-class, well seasoned Georgia pine lumber painted in two coats of good mineral paint.

And the material constituting the tie or suspension rods must be of good, pure, soft Swedish iron, upset at ends, upon which threads of the form shown upon the plan will be properly cut.

A Guard Rail, of the form also represented, will be built across both sides of the bridge, and be securely fastened to the string-piece as represented on said plan.

The price for the various classes of material in place, must cover the cost, etc., of every item.

Wrought iron
bridge in her
of timber
bridge.

In case it be deemed advisable by the Corporation aforesaid, a wrought iron bridge, represented by "Plan A," will be adopted instead of the timber bridge above mentioned. It shall be fourteen feet wide, and be planked with such material as the Engineer may select from the quantity sheet. All the iron and such parts of the wood work as may be deemed necessary, must be painted in two coats of the best mineral paint.

IRON FOOT BRIDGE.

Iron foot bridg in lieu of tim her foot bridge. In case the said Corporation decide to adopt the wrought iron foot bridge, represented on plan "A", the same shall be constructed in accordance with said plan, and be painted in two coats of good mineral paint, and payment therefor, all in place exclusive of flooring, will be made per lineal foot, and should circumstances necessitate an increase or diminution in its length by reason of shifting the proposed location of the Inlet Chamber, the said additive or deductive amount will be covered and adjusted by the schedule price per lineal foot.

diminution.

In canvassing the bide, the price, etc., of the Iron Farm Bridge, Iron Foot Bridge and Gate House upon Inlet Chamber (of corrugated iron siding) will be compared separately.

INFLUENT CHAMBER.

The Influent Chamber situate at influent end of the mud pipe proper, may be of the logs cut from the trees obtained from off the site of the work, provided such be accept-

14

Frame work of crude maternal. able. It will be of the dimensions represented upon the plans, and the framing will consist in halving the ends to a reasonably fitting joint and be pinned alternately, log upon log, as represented, with wooden pins of hard wood, having a diameter of not less than one and one-half inches.

The grating will consist of three-quarter inch wrought pipe secured by staples, and the structure back filled with good sized stone of approved form.

The timbers forming the structure must be sound and entirely free from bark, and completed for a lump sum.

Frame work of squared timIn case squared timber be used, packing blocks must be inserted between said timbers so as to leave a void sufficient for the percolation of water to the mud pipe. In such case the work will be paid for as per schedule price for such material. The Engineer will decide as to which will be used at time of construction.

MASONRY.

INLET CHAMBER.

The masonry of the Inlet Chamber must be of a quality that will insure durability and also be impervious to water, the object being to afford the opportunity of descending into the same without drawing off at any time the stored waters of the Reservoir, and will be built according to the plan so far as is practicable, but if in the opinion of the Engineer circumstances necessitate a shift or change from the position represented upon the map, the change so made shall not increase or decrease the prices given in the proposal. The work must be executed by masons skilled in this particular class of work. Inexperienced workmen will not be allowed upon any portion of work falling under the head of Rubble Masonry.

SCREEN LUGS.

At a point situate about three feet below the central axis of the upper inlet, three iron plugs will be inserted into the fourteen-inch stand pipe sufficiently to project through the shell of said pipe in a manner as to afford a safe and substan at resting place for the basket screen, and the cost of the same must be included with that of setting the stand pipe.

VALVE RODS.

The Valve Rods must be securely fastened to the valves by a key, and be extended to the upper surface of the floor, supported throughout their length so as to maintain a plumb position and operate easily, as may be directed by the Engineer at time of construction. The heads of the said rods must have a bearing upon a cast iron collar planted and fastened to the flooring of the Inlet Chamber in such manner as not to extend above the general plane of the surface of said flooring, and the size of each value operated, must be designated with red paint, also the direction for closing, by an arrow plainly scribed upon the floor, and directly opposite the rod for which it is intended.

GATE HOUSE.

WOOD STRUCTURE.

The Inlet Chamber will be surmounted by a Gate House as represented on the plan. The material used, in case the structure be built entirely of timber, shall be of good seasoned pine, encased upon the outside with sheeting paper of best quality and by two-inch clear lumber, tongued and grooved, planed and wrought in conformity with plans, in a good workmanlike manner. The sides and ceiling on the interior will be sheeted with good sheeting paper and one-inch pine lumber, tongued and grooved, as aforesaid. The floor will consist of good, well-seasoned one-inch pine and one-inch spruce, cross-laid, with proper provisions for trap door, gate rods, etc.

WINDOWS AND DOORS.

All swing doors shall be provided with good substantial butt hinges, and where necessary good substantial latches and locks appropriate for the purpose and situation. The

15

The payment to be made for said Lamp Holes will be rendered per lineal foot, vertical measurement, from hub of T, with which the same is connected, and shall also include the cost of the frost-wall, material, labor, etc., with exception of the roofing, which shall be paid for per B. M.—as otherwise provided.

BY-PASS PIPE LINE.

Location

The twelve-inch By-Pass Pipe Line will be commenced at a point situate in the line of twenty-inch mud pipe of the Storage Reservoir, as represented upon the map, from which point it will be extended in a westerly direction around the southerly side of the Distributing Reservoir and be connected with the Pipe Main of the Distribution System in such manner as to admit of a 10-inch Blow-off discharging into the original creek bed.

The weight of all straight cast pipe used upon said 12-inch By-Pass Line (in market lengths) must not deviate materially from the standard weights quoted by the Warren Iron Foundry, and generally known as "Class A" pipe.

per 12 feet lengths.

BASKET GUTTER

If deemed necessary a cobble stone basket gutter will be commenced and extended from and to all such points as the Engineer may designate at the time of construction.

Size of stone

The stone shall not be more than ten nor less than five inches in their longest dimensions and be of a material not liable to disintegrate nor crush. They shall be placed upon a ballast of creek gravel or coarse sand, having a depth of about twelve inches, prepared so as to make a depression of eight inches after the stone are rammed and paved into their final position.

Wideh

The width of the gutter from out to out, shall be not less than four feet, and the stone used shall be graduated so as to increase in size from centre line toward either side.

Surface of approach The surface of the approach to, and into said basket gutter, must be so arranged as to prevent, as far as possible, any undermining effect caused by the water upon the outer courses of said gutter.

Entrance to

As the gutter approaches the Catch Basins, it must be so fashioned as to conduct the water properly into said basin, as represented upon the plans

ROCK.

Rock excava-

In case any solid rock is found within the lines of excavation, it shall, if so ordered by the Engineer, be blasted out to such surfaces as he may direct, and any space so made beyond the grade surfaces of the work shall be properly filled with puddle, or otherwise treated as the Engineer may direct.

No payment will be made for excavations having been extended beyond the lines and limits previously designated by the Engineer.

PUDDLE

Daddle

The material for puddle shall be the best the excavation affords, and freed from all stones more than an inch in diameter, and from perishable earth; and if in the opinion of the Engineer, different materials require mixing, they shall be intermixed in proper proportions while dry, after which a sufficient quantity of water shall be applied, and the whole well and thoroughly worked up and rammed or cross cut with proper tools operated by men experienced in this particular kind of work, until the layers become sufficiently tough to meet the approval of the Engineer, and be impervious to water.

Contractor to furnish clay, etc., if Any surface to which the puddle is to be bonded is to be broken up and properly prepared for that purpose. If, in the opinion of the Engineer, it shall be needful to mix any clay or other material not found in the excavation, into the puddle, such material shall be furnished and delivered on the ground by the Contractor who shall incorporate it properly with the puddle, without extra charge.

Puddle, how

The puddle shall be applied in horizontal layers, not exceeding six inches in thickness. Each six inch layer shall be allowed to attain a proper consistency, but not dry, before another layer is applied; and if any portion of a layer shall have become hard and dry before the application of the following one, it shall be thoroughly broken up, watered and prepared, so as to insure a sufficient connection with the subsequent layer.

Puddle covered The finished surface shall be temporarily covered, when necessary, to prevent cracking from exposure to the sun or defrimental action of the frost.

Menourement

All material falling under the head of puddle shall be measured in place, complete, and no allowances shall be made for shrinkage.

CEMENT.

Cement and its

All cement furnished by the Contractor for the entire work herein specified will be subject to inspection and rigorous tests, and, if found of improper quality, must be immediately removed from the work; and the character and severity of the tests are to be determined by the Engineer. It shall be of the best quality of American Hydraulic Cement, freshly ground, and must be packed in substantial barrels of material and workmanship as will protect the contents from water and air. When stored, it shall be kept in a tight building, free from draughts of air, and each cask must be raised several inches above the ground, by blocking or otherwise, so as to avoid the liability of absorbing moisture.

The particular brand to be used will depend upon the tests made by the Engineer with various specimens of cement mixed with the various sands found within the neighborhood of the works and the village of Norwich, and having decided upon which brand forms the best compound, the Contractor will be held to the same without any modification of schedule price or extras, and he or they shall use the same as directed.

MORTAR.

Mortar for

The mortar for the stone masonry shall be prepared by properly mixing one part of clear cement, well compacted, of the quality before described, and two parts of loose, sharp sand, all by measure.

Sand.

The sand shall be as clean, sharp and free from loam and frost as the section of country will admit. The cement shall be thoroughly mixed dry with sand, in the proportion of one part of cement to two parts of sand.

Water

Clean water shall be added at such time, and in such quantity as to make a paste of the best quality and of proper consistence.

The whole shall be thoroughly worked with proper tools, in suitable boxes made for the purpose.

Miged fresh.

The mortar shall be mixed fresh for the work in hand, and any mortar that may have been left standing long enough to "begin to set," shall not be used.

The ratio of sand and cement must be in accordance with experiment made by the Engineer, and should be consider a greater proportion of cement necessary the same shall be done without any extra charge.

CONCRETE.

Concrete.

The concrete shall be formed of sound and acceptable stone, either screened from gravel or broken so as to be not more than two and one-half inches in greatest dimension. The material shall be cleaned from frost, dirt and dust before being used, be properly wet, and thoroughly mixed with mortar in suitable boxes, in such proportions that the volume of mortar shall always be slightly in excess of the volume of voids in the broken stone.

9....

The mortar used in concrete is to be such as above described for stone masonry, viz: one part cement to two of sand, or the proportions may be derived from test as aforesaid. The concrete is to be quickly placed in layers of about six inches in thickness, and thoroughly rammed with suitable rammers until the mortar flushes to the surface.

No walking or working upon its surface will be allowed while the mass is setting, and sufficient time must clapse before any succeeding work is allowed to be laid upon it.

All classes of work subject to injury from the action of frost, must be properly protected therefrom by the Contractor without extra charge.

RIP RAP.

After the bank is carried up sufficiently, the inner slope will be dressed true to a line given by the Engineer, and a layer of stone, averaging about fifteen inches in thickness, will be

Rip rap.

applied. The stone used for this purpose must be sound, and shall be hand placed if required. Any additional depth of stone above that of fifteen inches will be allowed, provided the same be so placed as not to produce warped surfaces, but the additional depth so placed shall not constitute an extra price.

RUBBLE MASONRY.

Classificaci

The rubble masonry will be divided into two classes, viz: first and second, and the class adopted for the various structures will be designated by the Engineer at the time of construction, the probability being that the only structures built of the first class will be the Inlet Chamber and the Waste Weir, each of which may embrace both classifications.

Distinction be tween 2nd and 1st class Both classifications will embrace equally good stone, the difference being that all facework of the structures above mentioned, shall be stone assorted for the purpose, and in general receive a better degree of care and attention as regards fitness to perform the duty imposed upon them.

RUBBLE-FIRST CLASS

Tar**as**a

The stone used will be of any formation that will not disintegrate, they shall have the property of being hammered or pitched, if necessary, to a line, and admit of being scabbled on bed and builds in order to obtain a satisfactory joint, the thickness of which will depend somewhat upon the size of the particular stone being set, which in no case shall be laid so as to admit of no mortar between it and the adjacent stones. In final, the joint must not be more than three-quarters, nor less than one-quarter, of an inch.

Beds, etc

The stone must be perfectly clean and laid upon a properly prepared bed of mortar with its best bed down, and in no case shall spalls or any other medium be driven in for the purpose of leveling its upper bed. In the preparation of the bed, all chips and spalls used for the purpose must be carefully hand-laid and be hammered down until the mortar flushes to the surface, and when doing likewise with the larger stone, a wooden block must be employed. Regular courses are not to be called for, further than to approach it sufficiently to produce a good bond and a harmonizing effect, approved by the Engineer, more attention being paid to the said bond throughout the whole thickness of the walls than to regular courses.

The insertion of anchor rods, ladders, etc., must be carefully set so as not to admit of any percolation of water. All dowels must be set in sulphur

All projections on the face side of the work exceeding two inches, must be scabbled off prior to setting the stone, and in no case shall any stone be set so as to form an inverted batter. After the work becomes sufficiently set for the purpose, the Contractor will clean out the joints of all such work as may be designated by the Engineer, and re-point the same with rich mortar, to the satisfaction of the Engineer.

Re-pointing.

Masonry of all classes are to be measured in the work only, excepting such as are otherwise provided for.

COPING

The material for coping must consist of either good sound blue stone, or stone quarried at Oxford, N. Y. They will be "rock-faced," neatly pitched to parallel lines, and laid to a joint not to exceed three-eighths of an inch, and be bonded back into the masonry walls as represented upon the plans, and laid in good, rich cement mortar, mixed especially for the purpose. All imperfect stone, also stone having endured long exposure to the natural elements, etc., or discolored thereby, will be rejected.

The material called for in cases of spillways, bridge seats, etc., shall consist of equally good stone and workmanship.

How measured.

All coping will be measured by the cubic yard in place as per quantity sheet, and no extra payment will be made for dimensions exceeding those upon the plan.

PAVEMENT IN CEMENT MORTAR.

Arrangementa.

The stone used for all slack-water basins will be of good substantial material, regardless of color, but practically similar in length. They are to be carefully arranged in place, upon a properly prepared bed, as per plans, and wedged, rammed, etc., until becoming positively fixed

20

PREVIOUS REPORTS

RECEIVED

MAXING 6 10 1914 16 1500)

	() MA 75 30		
UIVISION OFFICE Chiefeen	a With A la Moone of these forms as ion Commission, Albany.) girleer	completely as possible for each	dam in your district, return it at once to the
	ST	ATE OF NEW YORK	RECEIVED
	CONSER	VATION COMMI ALBANY	SSION MAY 8 1914
			DIVISION INLAND WATERS
		DAM REPORT	J. D. M.
			Op. 1914
Consei	RVATION COMMISSION,		
	Division of Inland V	Vaters.	
GENTL	EMEN:		
	I have the honor to make t	he following report in	relation to the structure known
as the.	The normal	water wales	Dam. 😘 . 2.
	This dam is situated upon th	10	a Carook
			County,
about .	9000 feet from the Vill	age or City ofΥ	Donuiel.
The di	stance stream fro	om the dam, to the	ve name of nearest important stream or of a bridge)
	it 9000 test.		
	The dam is now owned by	The source	
مسک	as built in or about the year ن مسلم همه مست ن the year	139) , and was ex-	tensively repaired or reconstructed
	As it now stands, the spillway	portion of this dam is	Ottill Of (State whether of masonry, comercial timber)
			the change cone.

and the other portions are built of (State whether of misonry, control of timber)

As nearly as I can learn, the character of the foundation bed under the spillway portion of the dam is

and under the remaining portions such foundation bed is

The	total length of t	his dam is	63B	feet. T	he spillway or	waste-
weir portion	n, is about	45	feet long, and	l the cres	t of the spill	way is
about	5' - 9"	feet below	the top of the dar	n.	,	
The	number, size an	d location of di	scharge pipes, wast	e pipes or	gates which r	nay be
used for dr	rawing off the w	ater from behir	nd the dam, are as	follows:	36" much	p /u
with one	1.20 und 3	- 14" inlet			r - 1101 (N	
	the space below, wheth cks which you may have		this dam is in good condit	ion, or bad con	dition, describing p	articularly
		·		1		
			100	1		
		Re	eported by	Winter	nature	••••••••••••••••
	Brow		··-	,		
(Add ress —	Street an I number, P. O. B.	s or R. F. D. route))	
	(N	Ame of place)				

(SEE OTHER SIDE)

(In the space below, make one sketch shewing the form and dimensions of a cross section through the spillway or waste-weir of this dam, and a second sketch showing the same information for a cross section through the other portion of the dam. Show particularly the greatest height of the dam above the stream bed, its thickness at the top, and thickness at the bottom, as nearly as you can learn.)

(In the space below, make a third sketch showing the general plan of the dam, and its approximate position in relation to buildings or other conspicuous objects in the vicinity.

AA optehanes

621 am

Flevation about 334.3 for a continue of the start of the

STATE OF NEW YORK

Reservoit Nº2

DEPARTMENT OF

State Engineer and Surveyor

ALBANY


Report of a Structure Impounding Water

To assist in carrying out the provisions of Section 22 of the Conservation Law, being Chapter LXV of the

	\(\frac{1}{\sqrt{0}}\) nsolidated Laws of New York State, relating to safeguarding life and property and the erection, reconstruction,
	of maintenance of structures for impounding water, owners of such structures are requested to fill out as completely
	V as possible this report form for each such dam or reservoir owned within the State of New York for which no plans
	$\sqrt[4]{}$ for reports relative thereto are on file in this Department, and to return this report form, together with prints or
	photographs explanatory thereof to this department.
	,
	I. The structure is on Ranglord Coulk flowing into Chenango River in the
	Town of Norwich County of Chango and about
	8000 X let I wan't to mouth of the Stream on the City Line (Give exact distance and direction from a well-ishown bridge, dam, village main cross-roads or mouth of a stream)
	2. Is any part of the structure built upon or does its pond flood any State lands? Ho
	3. The name and address of the owner is The Norwich Water Works.
1	Noxwich N.Y.
-	4. The structure is used for Impounding Mater Supply used in the lity of Norwich
1	1. The structure is used for 2 / 1/2
	The material of the right bank, in the direction with the current, is Reckt With Earth above the ; at the
7	spillway crest elevation this material has a top slope of about Laminches vertical to a foot horizontal on the
]	center line of the structure, a vertical thickness at this elevation of Alegat 14 feet, and the top surface extends
	for a vertical height of a base h. A feet above the spillway crest.
j	to a foot herizontal, a thickness of far a short and a height of about 400 feet. A Cat 17 0 23 Wall in Notaral Bank 10
7	the foot harizontal, a thickness of far a short and a height of about 400 feet.
ł	7. The natural material of the bed on which the structure rests is (clay, sand, gravel, boulders, granite, shale,
	<u>⊬25−1</u>
٦	state lime tone, etc.) I make with and pan
4	
1	
1	8. State the character of the bed and the banks in respect to the hardness, perviousness, water bearing, effect
	of exposure to air and to water, uniformity, etc. The Kirch on the right limb is somewhat
	Committed, in the bottom, dense, The hard pan clears and impurious
	X Rock dismbyotes to some extent by enform to the air. There has been
.	no lead of I
	no leakage from the reservoir during the 35 years since constructed
1	D-13

direction of the horizontal outcropping relative to the axis of the main structure and the inclination and direction
of the layers in a plane perpendicular to the horizontal outcropping?
10. What is the thickness of the layers? Yaxiable
11. Are there any porous seams or fissures? Some on the right bank but all cut-
off by Concrete and clay probable
12. The watershed at the above structure and draining into the pond formed thereby is Quest 5 square miles.
13. The pond area at the spillway crest elevation is about 8 acres and the pond impounds about Full
cubic feet of water. See note on page 3
14. The maximum known flow of the stream at the structure wascubic feet per second on
may and Sept. 1890 (Date)
15. Has the spillway capacity ever been exceeded by a high flow? No
Can any possible flood flow from the pond otherwise than through the wastes noted under 17 and 18 of this
report?
character and slopes of the ground of such possible wastes (SLI plan on pogs 4) For about 100 feet
the bank or dum, is from 6 inches to I foot lower than the crest of the main dams
And an ore flow there would follow a natural graned brank, evilinely among from the structure and discharge into Reservoir No 1. She oketch on separate of the attended 16. State if any damage to life or to any buildings, roads or other property could be caused by any possible
16. State if any damage to life or to any buildings, roads or other property could be caused by any possible
failure of the above structure. Describe the location, the character and the use of buildings below the structure
which might be damaged by any failure of the structure; of roads adjacent to or crossing the stream below the
structure, giving the lowest elevation of the roadway above the stream bed and giving the shape, the height and the
width of stream openings; and of any embankments or steep slopes that any flood could pass over. Also indicate .
the character and use made of the ground below the structure. There are a house and a small school
house in a rather narrow vally, also 3 other houses and from buildings as the vally
on the river wand and a highery in the river rally mear the brook
The fand is used for grazing and cultivation
. 17. Wastes. The spillway of the above structure isfeet long in the clear; the waters are
held at the right end by a many wall the top of which is feet above the spillway
crest, and has a top width of 25 feet; and at the left end by a the Rame, the
top of which isfeet above the spillway crest, and has a top width offeet.
18. There is also for flood discharge a pipe
feet below the spillway crest; and a (sluice, gate outlet)
feet high, and the bottom is

			oillway there is an		Rock botton (Maiorini)		wit se
		fee fee	t thick. The down	- 14 Carrier 5145 (c. 144	e aproz has a ililotza	SS 3C	
				re liable to cause	its failure in high flo	ws? No.	**********
the top to the sp section s wall at t sketch a their hor way sect the bank	e at the grewidth (for billway creshow a crothe end of plan; sho rizontal distion; and coss, giving	eatest depth; g a concrete or st, the length ss section of t the spillway, w the above s mensions; the butline the ap-	iving the height and masonry spillway at of the section, and the apron, giving its giving its heights sections by their top abutments by their ton. Also sketch at width excavated in	the depth from the two feet below the material of whe width, thickness and thickness. A lines, giving the top width and to n elevation of each to the banks.	ale for each different on the surface of the found the crest), the elevation that the section is con- and material, and show lark each section with mark and the length op lengths from the unit the end of the structure	lation, the bottom on of the top in restructed; on the so ow the abutment the a capital letter of each; the open pstream face of the with a cross se	n width, reference spillway or wash ex. Also nings by the spill-ection of
					ch (70 (mes) beer		lic water
rear while a re but,	y sam Lis 4s Ligain Ly hea Ly li 6 36 in	fut long obone of rain letter if a	of and filled that of the so storm fill this and filled	up, was 3 f ume year, and the form otorm al	when the back of the top, but of passed of how a spilling to a	nas 15 fee did not a	thigh orn flo
The June	est of olente	he earl inchanges of the wo	have never iter, who w	bore the to, been eque	to 50 feet up of I of the spiller led during P. The Engineer a	4 35 year	ful.
Thurs a	ecen	ed from	th 45.	whins the e	3 /	Musson.	
a precifita	tion afficient of may	Exform, 8	10 sofollow Sept. 9-10 10 304 11 39 13 1.36	Ston- Highway	Gred Bridger R.	: .	

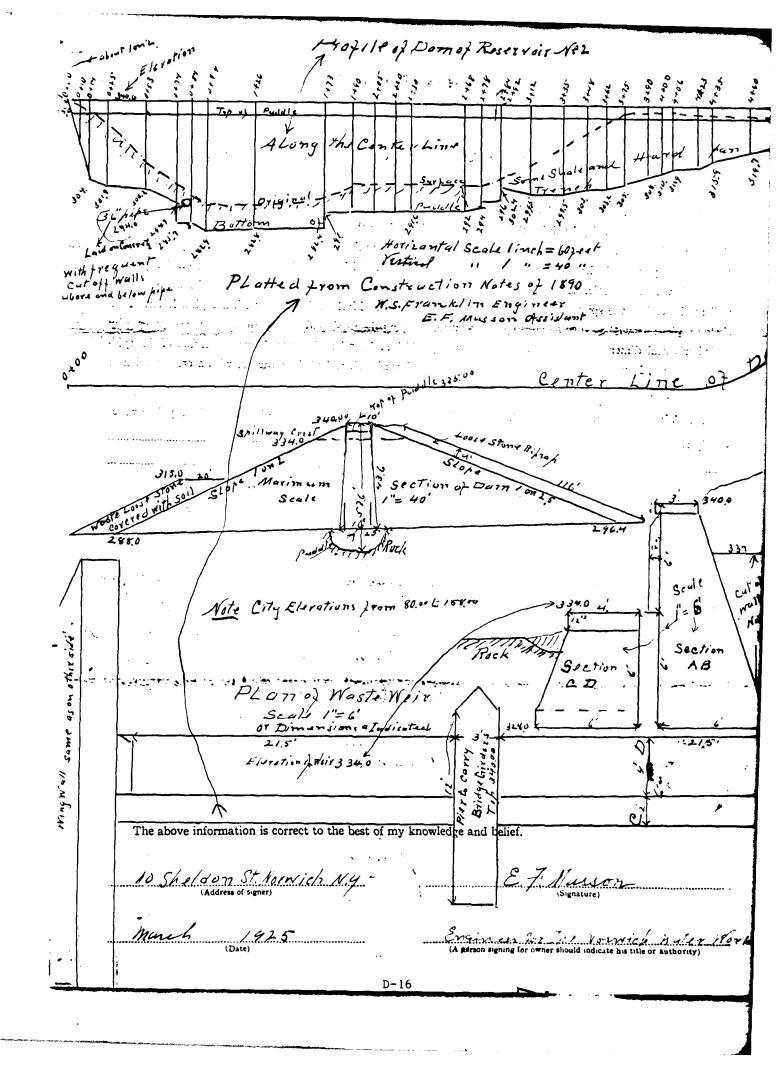

High Ground Caterity AM Galcult. Sketch Map of the Reservoirs The Norwich Water Works. Scale linch = 200 pest.

High Ground Conal Glade FOOT Bridgs FOUT BIIdes Stone Guts house Reservoir Gata House N- 2 1890 Euration 334.0 Capacity &Mcapi High Ground Reservoir Not Cofacity AM gel cult eration Maximum Sections of Dyke. RIS

Civil Engineer

APR 20 1925
REFOTO M. APRIL

Norwich. N. Y., April 16,1925.

Department of State Engineer and Surveyor, Albany, N.Y. Gentlemen; -

As requested by your department, I enclose herewith reports concerning the two earth dams and appurtenances owned by The Norwich Water Works of this City.

That designated as Reservoir No.1, was constructed in the year 1881. The information regard to that has been mainly obtained from preliminary plans prepared before the construction, together with some measurements of parts that are now accesable and readily measured.

Since the construction of Reservoir at No. 2, it has been in use as a distributing reservoir, the overflow exertient from reservoir No. 2 passing in a by-pass canal.

The supply from reservoir is discharged into reservoir No. Ithrough aereating jets., In times of heavy rains when the water in No.w is rollythis is shut off till the water is in good condition for use.

The elevations used in the construction of both reservoirs are derived from an arbitrary bonch mark near the center of the City, the elevation of which is assumed as xxx 100.014. and is located on the top of the water table at the North East corner of the Congregational Church.

Reservoir No2 was constructed in the year 1690. The Hon Richard W. Sherman was engaged with Mr. McDonough in the Troy Public Works Co. as contractors. Mr W. S. Franklin was Engineer in charge, with the writer as assistant. The information containing the report concerning this reservoiris from the original construction notes and drawings used in the computations for the final estimate.

During the construction of this work there were two very unusual storms, as noted on the report. These figures were obtained as noted from the Weather Bureau at Tthaca, N&Y&

Owing to the very heavy rainfall that occured in May it was decided to install a waste pipe 36 inches in diameterin place of one of 20 inches. This was cast iron , asphalt coated and very carefully laid both as to line and grade. It was laid on a masonry wall with several cut off stops extending on each side and over the pipe, extra precaution being taken where the pipe crosses the puddle trench, the masonry extending down several feet to the rock as excavated in the trench.

At the timeof the heavy rainfall that occuredfrom Sept 9 to 13, the top of the dam was at about elevation 315. The 36 inc pipe was 192 feet in length, the elevation at the lower endwas 299x 290.34 and at the upper end 296. The water rose above the dam

M. AM. SOC. C. E.
(REBIGHED)

E. J. Musson

Civil Engineer
OFFICE AND RESIDENCE 10 SHELDON ST.

NORWICH, N. Y.,

to the top thereof and I think overflowed a very little where a slight trench had been dug where less damage would doubtless resulted thanwould likely been done otherwise. Of course there was quite a large quantity of water impounded above the dam which would materially reduce the rate of discharge over the waste weir at reservoir No. 4. I am not at all satisfied with such computations as I have made from the lower weir and of the 36 inch pipe, but the facts are as stated and I leave any further computations for you to take up if you so desire. As stated in the report, at the time of the latter storm the water in the reservoir No. 4 was 3 feet above the top of the weir at a point 50 or more feet Back from the weir.

Mr. Sherman agrees with me as to the conditions at the dam at the time, except that he thinks the dam was about 30 feet above the pipe at the time, but as I have the original notes of construction at hand which show the elevation Sept. 12 as at 313 and Oct. 12 as 320, it would appear that 315 was about right.

Precipitation records have been kept by the writer for the past 16 years. Only twice during those years has there been a precipitation of over 3 inches in 24 hours, and in each case there has not been a discharge of 3 feet over the waste weir of res. No. 2, I should have stated that the water shed between the two reservoirs is probably less than 1/2 mile.

Trusting the information I have been able to furnish will meet your requirements, I remain very truly yours E. 7. Musson

Engineer for The Mordich
Jater Jorks

P.S.

We have a tracing of the entire area ocupied by both reservoirs and adjacent teritory as shown outsite little map enclose This is drawn to a scale of 1 inch = 40 feet with 16 year leading will sent you a blue print. (we have in facilities for cloth prints)

MARGEMENT REPUBLIC TO STEE

NEW YORK TATES POWER AND GONT SON CONTROL ON STATE
ON THAT YORK TATES NORVED I CONTROL THAT
ONEY OF NORWICH, NEW MORK

GENERAL AND HISTORICAL NORMS

The following description of the water supply system for the City of Herwich, New York has been compiled from information that available by the Company and the State Public Service Consission to pather with the results of various inspections in recent months by deriver & heeler. The data are mostly as at the date of July 1, 1946 and closely show the property as of the present date since only minor very last book done since June, 1946.

The Norwich Mater Morks, so-called, was incorporated Canady SC. 1881. Plant construction was started early in 1881 and the first vater service was given in January 1882. On November 16, 1986, the Now York Water Service Corporation acquired the old company and charged the name to Morwich Mater Service Corporation. On May 7, 1989 the application merged into the New York Mater Service Corporation, and the new consent ly known as the Ferwich Plant of that Corporation.

The Corporation furnishes water to demestic, con archib and industrial customers and gives fire provection by water service, in the City of Norwich and in parts of the Towns of Herwich, in addaudly adjacent to the easterly and westerly corporate limits of the City.

LOUIS S OF SUPPLY

There are two sources of vater. The first is about four square miles of drainage area along Mansford Creek in the Mowns of Merwich, North Norwich and Mer Berlin, beginning about 1.5 miles northeast of the City of Norwich as will be seen from the accompanying 1. The Geological Survey topographic maps. In this drainage area are the see reservoirs first built, known as the "Upper" and "Lover". The Rever measurest has a surface area of about 6.5 acres, a maximum depth of about 50 fb. and a storage capacity of 32 million gallons, for 15 feet dran-down. Spillway elevation is 1138 feet above sea-level compared with about 1015 ft. for the center of the City. The Upper Reservoir is fraedlately upstream and has a surface area of about 9.1 acres, a maximum depth of 40 ft. and a storage capacity of 56.5 million gallons for a Craw-down of 10 ft. The spillway here has an elevation of 1242 ft. or 54 ft. above the Lover Reservoir.

The second source of supply is Chonengo Lake, in the Council Rev Berlin about 3.5 niles northeast of the Lover Reservoir already contioned.

The drainage area of themsinge Lake is combiguous to back of Pensylord drock and is about 0.8 square talle in entent. The belo surface he about 180 acres, and the normal enevation is 1760 fig. The drainers area has been develoyed to be contributory to the first even described, but it originally was part of the drainage area of freed Brook are the Unadilla Miver. implus waters not used for horoid value supply skill thew out to Great Brook. The Company, by unchash. The Lunds and valuetained a strip of lake shore rostly 16.8 ft, wide. Whis strip is con-1900 ft. of shore, as shown on an appended ap. The corporation obtained the right to raise the water lovel to a given health two reed above the prior normal lovel and to draw it down five foot below prior level. This rives a potential storage of 340,000,000 gallone then it can be utilized. The normal realized storage is from 80% to 200 of llien callens. The old natural outlot at the south end of the late and plugged, and an artificial spillway charmed opened up at the north-cast and into a different branch of Great Brook. To divert the later taster into lanctore Greek, a tunnol 761 ft. Long was driven through the rice a separating the two basins and a pipe line of 14, 16 and 16 inch cast from pipe uns run another 9507 Pt. to comment the Lake and Crack with the formel. Nater from the Lake mais 8,000 ft. in open brook chancel to the appoint Reservoir already described.

OTHER FARDS

The Company owns about 270 seres of land around the reservoirs and Ransford Greak as shown in the accommanying rape. This has been replaced with about 177,000 evergreen trees. To improve he account the two reservoirs, about 5100 shrubs have been planted.

There is a tract of about 7 acres on the south side of the heat Berlin Highway in the Town of Norwich just east of the Chemness Alver and the City of Norwich. Here is located the filtrables plants. On the opposite bank of the river, in the City of Norwich, is a corresponding tract of about 10 acres held undeveloped.

The Chemango Lake Turnel and the approach pipe them are ember a strip of land 50 ft. wide owned in fee. The balance of the Palm for creek line is on easements. The Company owns casers is to extend the lake delivery line through to the Upper Reservoir and has rights so the waters of Reneford Greek.

There is a private right of way about 4700 ft. let for two 12-inch cast-iron transmission rains leading down from the lower Reservoir. This parallels the New Berlin highway. The two mains continue under the high-way for another 1200 ft. to the filtration plant just extract the Gity as already noted. From the filtration plant, one Mission each iron rain runs costly under public ways into the Town and cast or here wich to Miver and Regional Streets where it becomes a each a like distriction putter and to include the lands about 1200 ft. from the filtration plant to Mission and to distribution system. All river exceedings are on private lands.

The distribution system is laid almost entirely value public streets. There is a length of about 350 ft. on a private empower near Broad and American Streets. South of the D.L. & ... Line at Front and Thomson Streets is a 600 ft. stretch. Hear Edn am. Become Streets are two lengths aggregating about 500 ft. From the end of East Pain Street is a stretch on private right of the 30 Liver Read across the Chemingo Liver.

STORKER PROTECTION

Lower Reservoir. The dan at the Lower Reservoir cas built in 1881. It is an earth embandment with middled cone. The random helphic is 30.8 ft. and the length is 240 ft. The been widen to be fit. It is upstream slope is 2.5 to 1 with a broken stone partially and the decaption a concrete and majority weir, or everflow section, 40 ft. length by a concrete and majority weir, or everflow section, 40 ft. length between two wing walls of stone and concrete and majority 5.6 ft wide, 2.8 ft. high and 45 ft. long. The spillway deliver in the the object stone. The intake at this reservoir is a 24-inch can extrem with a second in with three 12-inch intake gates at different levels, the enclosed in a majority tower. A "rand pipe," or drain, of he-shade continuous in a dry masonry bead-wall at the outlet end.

Upper Reservoir. The dam at the Upper Reservoir was built in 1891; it is an earth embandment with puddled core, the fit. The upration a maximum height of 50.5 ft. and a top width of 18.8 ft. The upration. slope is 2.5 to 1 with 18 inches thickness of stone riperap. The advantagement weir, or everflow section, 45 ft. long. between wing walls, 2.5 ft. wide, 2.5 ft. high and 48 ft. long. The spillway has a cut-off well extending 7 to 12 ft. below the flow line. The spillway has a cut-off well to 7.7 ft. below the riow line. The spillway appears classed and make a by-pass channel which has been dug past both recovers and another into the old creek bod.

In 1914, counterweighted flasboards were installed on the application of the Upper Reservoir day so us to relie the water level for the These beard are of 2" by 8" plank built in two scotions. They are lifted by four hand wheels working through racks and platens from a bridge above the spillway. This bridge is formed by two 8" I-beard with a 4" yellow-pine floor.

The upper intules is a la-inch cast-iron pine when a copper coston screen, protected by a masonry charbon which is hoped with a iron structure and connected to the can by a 65 ft. about extens with a confidence. . 20 to 30-inch cast-iron "rad pipe," or drain, 200 st. ker , runs under the betten of the dan from a influent charbon (tiple is true of x 7 x 4 ft. with a top grill of 5/4 inch dress hare in the cast-iron and is protected by a x x 4 ft. runson; wall.

A 12-inch east-iron by-pass line about 2,000 Ph. long extends from the 36-inch outlet pipe of the Upper beservoir below the dan, along the south side of the Lover Reservoir and tornests into the two 12-inch transmission lines leading to the law. At a point about 150 ft. upstream from the lover dam is a 12-inch cast-iron size lateral leading to 15 jet serator nozzle. Hornally water from the Upper Reservoir is discharged through this jet into the lever Reservoir.

A caretaker's two story frame house on rabble asome foundations is located opposite the Upper Reservoir. . djacent to it is a one-story frame barn and a one-story parage.

Chenango Take. The outlet dam at Chenango Take is a block of concrete and masonry across an open cut previously made to supply a mill. Through the block is a 24-inch sleeve with sluide-gate and floor stand. Over this is a timber cover and around it is a stool-wire mesh fence, 7 ft. high. The Chenango Iako outlet consists of a 10 ft. riser of 14-inch cast-iron pine, topped with a copper basket screen, 6 ft. high. The outflow is controlled on the shore by a 14-inch gate valve in box.

ADEQUACY OF SUPPLY

The Company records show conclusively that over periods of the aggregating several years, the described sources (exclusive of the use of Chemango River dator which was used for a short time as an emergency supply) have supplied an average of 2 million gallens perday or more. (In the earlier days the consuption was excessive due to general lack of customers nature and to the use of inadequately regulated sever flush tanks.) The supply of 2 million gallons perday or more was maintained in spite of the fact that storage on lamsford Creek amounts to only about 90 million gallons, or no million per square mile of drainage area, which is rather low.

However, we have investigated a dan and reservoir site on the south branch of Ransford Creek above the Upper Reservoir. The draining area is approximately 2 sq. nile, and there appear to be many surfage in the area. At a point about 1400 ft. above the present Upper Per a dam can be constructed to inpound 150 to 200 million gallons of water. With this development, it is estimated that the present sources of cupply, as enumerated, will be able to supply an increased consumption at least as great as can be foreseen for a long that in the future.

PURIFICATION ORKS

Filtration Plant. From 1882 to 1905 the supply of water was delivered to customers without purification or transment. In the latter year, the Company installed four horizontal-bank rapid-sade pressure filters, at the site which has been described as south of New Berlin highway adjacent to the Chemange Navor and Mrs Cing. Two additional horizontal-tank rapid-sand pressure 110 mm were called an 190%. The pressure tanks are 8% in diameter by 90% long. Who are were made by the New York Montinental Jewell Milker Men Montany and the contains 8 cu. yds. of Gravel with 16 cu. yds. of Milker sand.

The secondary buildings at the filtration plant sate include the following: (1) Storage barn; I story frame aspectane with ridge roof and gable onds, clap board sides, rubereid roofing on 1" sheating. One barn section is 30 by 24 ft. and 20 ft. high to reed peak; a second section is 30 by 16.2 ft. and 17.5 ft. high; a third section is 16 by 16.2 ft. and 14 5 ft. high. (2) Sand Storage Bin; a Shiplap bin 9 by 20 ft. by 6.5 ft. with rubereid roof, painted outside.

(3) Hydrant & Hose House; I story frame structure 6 by 3 by 6.3 ft. and 9 ft. high to roof peak. Has concrete foundation, subcrede roof and batten door; contains a 6" hydrant with 2 hose negales and steamer connections, and 350 ft. of 2-1/2" fire hose and noncle. (4) There is a gravel drive, 12 ft. wide into the grounds and around the rear. There is 1500 ft. of 3-strand with foncing on wood posts.

Chowical House at Lover Reservoir. On the scale also of the Lower Reservoir near the dan is a chomical feed house. Whis is a hellow tile building, 16.3 by 24.3 ft. and 14 ft. blib he roof beat. The foundation is of concrete and the building has a basement. The roof is of wood frame with asphalt shingles. The house is heated by a cast-iron boiler and 7 wall type radiators. There are 6 electric outlets. There is located here a fullace a Mierran automatic chlorinator, Type 118', with 1' copper delivery pining to the make added, and a 500 lb. platform scale. There is also a fullace is the man directed alum machine driven by a li-inch water wheel. A checoust food line of 4-inch east-iron pipe leads to the outlet below to a lover dan.

Fari Preint of Perification. To not the requirements of the State Do arthert of Mealth and to prevent farm sewage on the Renamed Greek drainage area from getting into the collected vators, the denoted may has built and caintains on the Pollett, Birby, Mason, this or, Cooley and Indoneson farms, steel soptic tanks 58 by 48-ins. Such a sectional to cover and an average of 75 ft. of 4-in. tile drain.

ILING, S RVIOLS, PLANTE, IMPRORAS

Transmission Mains. The transmission exima, as so channilled by the Company, are shown in the following list, at J by A. 1966.

18"		4 h. ph.
16"		$\mathcal{L}_{\mathbf{r}} = \frac{1i}{2}$
14"	" " " " " " " " " " " " " " " " " " "	9 9
12"	Wrought Iron tar coated 13	
12"	Pit-Cast Iron Pipe 1310	
	Boll & Pocket Cast Iron Pipo 48	-
	Pit-Cast Iron Pipe 45	
ಚ"	Contrifugal Cast Iron Tipe 1	
6°	Pit-Cast Eron Pipe 1	$\Omega = \mathbb{R}^{n}$
6 ¹³	Centrifugal Cast Iron ipc 5	0 31

Total length 23738

The inlicing are facto dwell up by galling in . to the properties camed by the Chippen house in the

1881 - Norwich Water Works incorporated January 11. 2. 1. Board of Trustees of the Village of Norwick grant and Franchise to lay and construct necessary piper in and along village streets. Water Company purchased lands along Ransford Creek to build and impound waters of this creek, and contract let for building Reservoir No. 1 (Lower) holding about 30,000,000 gallons, and for laying 12" transmission main to Rexford and Silver Streets. The original contract and the Franchise are on file in the Water Office.

record shows that approximately 3,800 feet of this 1881 line were laid in the highway (State Route 23) All riparian rights in the waters of Ransford Creek from the reservoir location to the Chenango River and necessary rights of way for the 12" line were also purchased. A record of these purchases and the deeds are also on file in the Water Office.

Additional lands east of Reservoir No. 1 purchased and Reservoir No. 2 (Upper) constructed to hold approximately 60,000,000 gallons. Original contract on file in the Water Office. Both dams have puddled cores (clay) and working drawings of both are on file in the Water Chilone A 12" line is laid from the 36" waste line of the Upper Reservoir, around the south side of the Lauren Term product. from Which I 45 and 3 30 inlove can be than Wile is the members in taggether with 10 in a new new new members

- 1905 A second 12" transmission rain the confusional to the Village, and this line is interconnected this, the first 12" (1881) line so that the city supply can be delivered from either reservoir or both. This new line was reduced to 10" west of the Filter Plant and was laid under the river (as was the 1881 line) and up Gold Street to Silver.
- 1900 The Norwich Water Works paid Colonel Edwin Loomis the sum of \$15,000.00 to raise the level of Chasange Lairs and draw down the waters thereof a manimum of 7%. Corplant let to lay intake pipe and outlet line (inchuding 750 of 4% reckent tunnel) in Towns of New Berlin and Corth School to the headwaters of Hansford Crock. Rights ware also purchased from other lake front owners to raise lake level and rights of way to lay outlet line.
- 1919 Sale (on mortgage forcelosume) by National Lank & Truck Co. of Norwich to the Norwich Water Vorka of all the lands in Town of New Berlin owned by late Colonel Locate including approximately 111 acres of the 135 acres boxel surface of Chenango Like.

The standing timber on the Locais Lands sold to Tal data Cottage lots surveyed and mapped on east, south and war sides of lake.

Filter Plant land purchased in 1904 and Millian Plant with four units installed in 1905 selected to 3,000 in the wash a filtering capabity of \$60,001 while as you improve decided treatment began using colories of chunker way? The churchying and bypochlockto of thms eclasion for puring 0-26.

The with a chorestory control was an amount of the churchying of

PREVIOUS INSPECTION REPORTS

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION DAM INSPECTION REPORT

(By Visual Inspection)

Dam	Number	River Basin	Town	County	Haza	rd Class*	Date & Inspector
6	2/	5058	Mariel	Change	8	+	16/25 KINA
	Type of (Earth w, Earth w, Concrete Stone Timber		Water Supply Power Recreation Fish and Wildlife Farm Pond No Apparent Use-Abandoned				
 - 	1-	Impoundment Siz -5 acres -10 acres ver 10 acres	<u>e</u>	<u>Estima</u> to	ed Heig	Under 1 10-25 f	feet
9		satisfactory of repair or ma	·	of Spillway		ary satisfa d of repair	or maintenance
	Satisfac In need		· · · · · ·	n-Overflow Se	ection		
r 떤 ' ㅁ	Condition of Mechanical Equipment Satisfactory In need of repair or maintenance Explain:						
*Ex	plain Haza	Evaluate Eva	No de	Visual Inspe fects observe rs required b	ed beyon		
(10/74))		D-27	,			· · · · · · · · · · · · · · · · · · ·


APPENDIX E


REFERENCES

REFERENCES

- 1. Chow, Ven Te, Editor <u>Handbook of Applied Hydrology</u>. McGraw-Hill Book Company, New York, New York, 1964.
- 2. Hydrologic Engineering Center, U.S. Army Corps of Engineers, HEC-1 Flood Hydrograph Package, Users Manual. Davis, California, January 1973.
- 3. Hydrologic Engineering Center, U.S. Army Corps of Engineers, Flood
 Hydrograph Package (HEC-1), Users Manual for Dam Safety Investigations,
 Davis, California, September 1978.
- 4. King, Horace and Brater, Ernest. <u>Handbook of Hydraulics</u>, 5th Edition. McGraw-Hill Book Company, New York, New York, 1963.
- 5. Riedel, J.T., Appleby, J.F. and Schloemer, R.W. Seasonal Variation of the Probable Maximum Precipitation East of the 105th Meridian for Areas from 10 to 1000 Square Miles and Durations of 6, 12, 24, and 48 Hours (Hydrometeorological Report No. 33) U.S. Department of Commerce Weather Bureau and U.S. Department of the Army Corps of Engineers, Washington, D.C., April 1956
- 6. U.S. Department of the Interior, Bureau of Reclamation, <u>Design of Small Dams</u>, Second Edition, Washington, D.C., 1973.

APPENDIX F
DRAWINGS

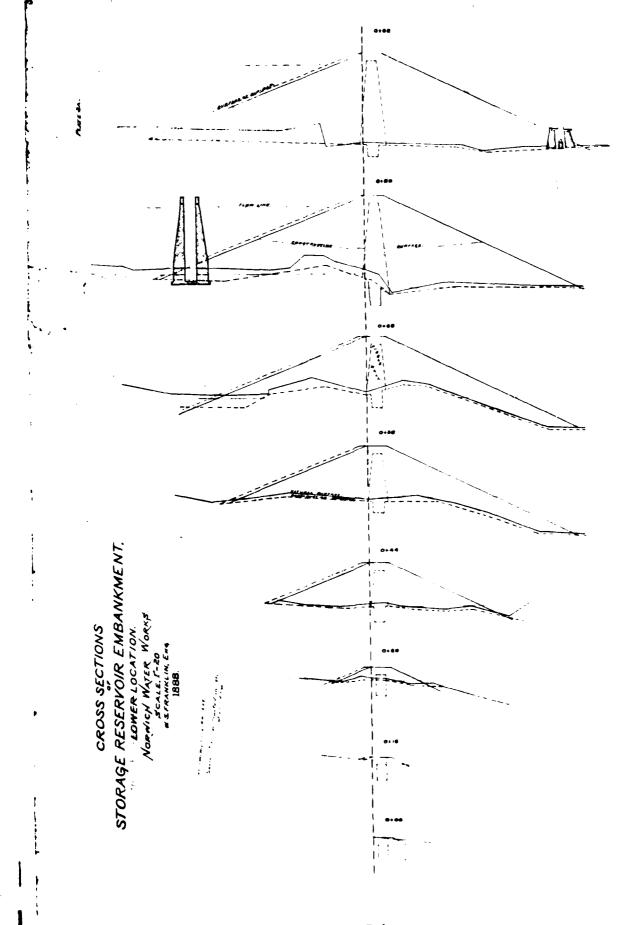

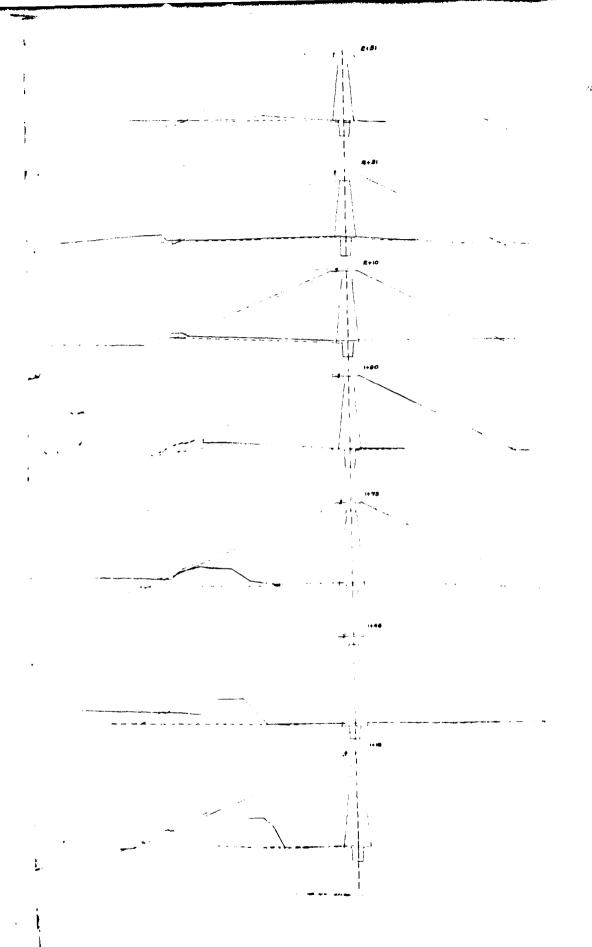

F-3

THE THE STATE OF T -:**B** PI. - (. N°


WASTE WEIR


NORWICH WATER WORKS


SCALL . 1


WSTRANK. IN ENG
1888 SECTION ON LINE &B.




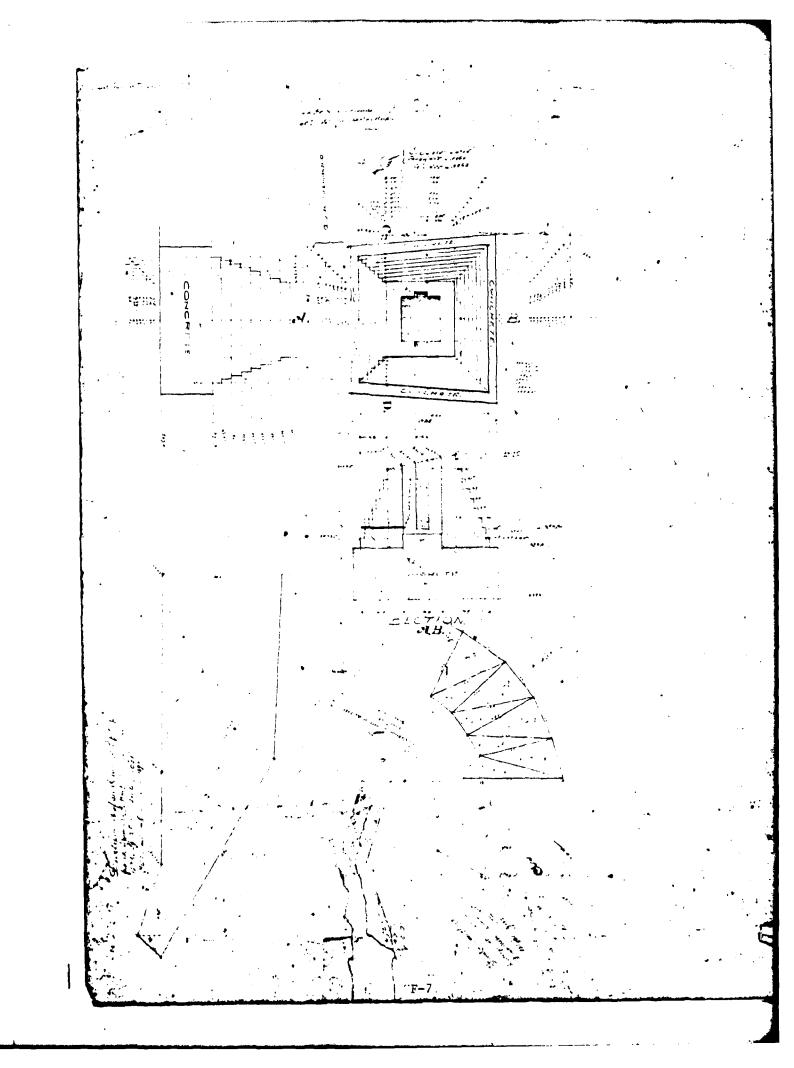


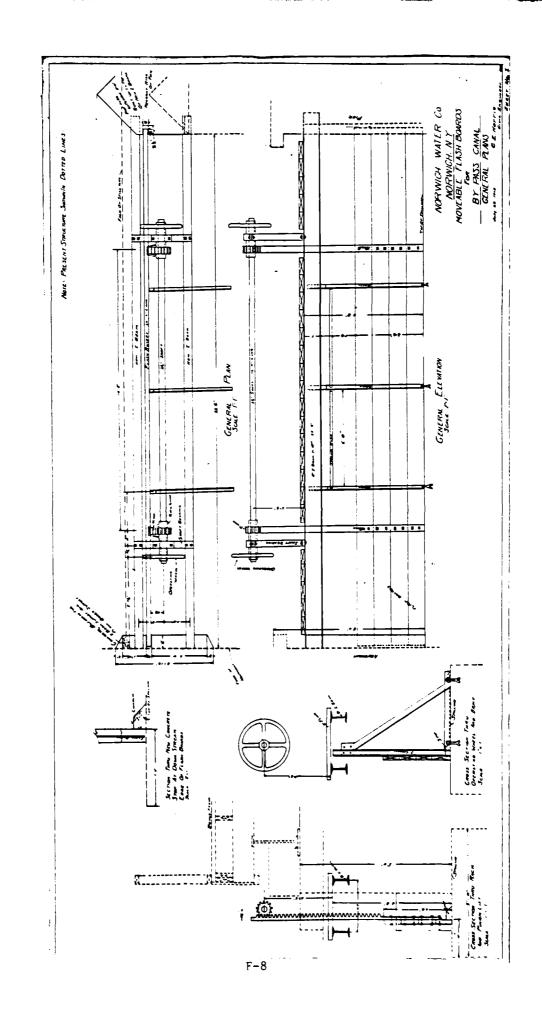

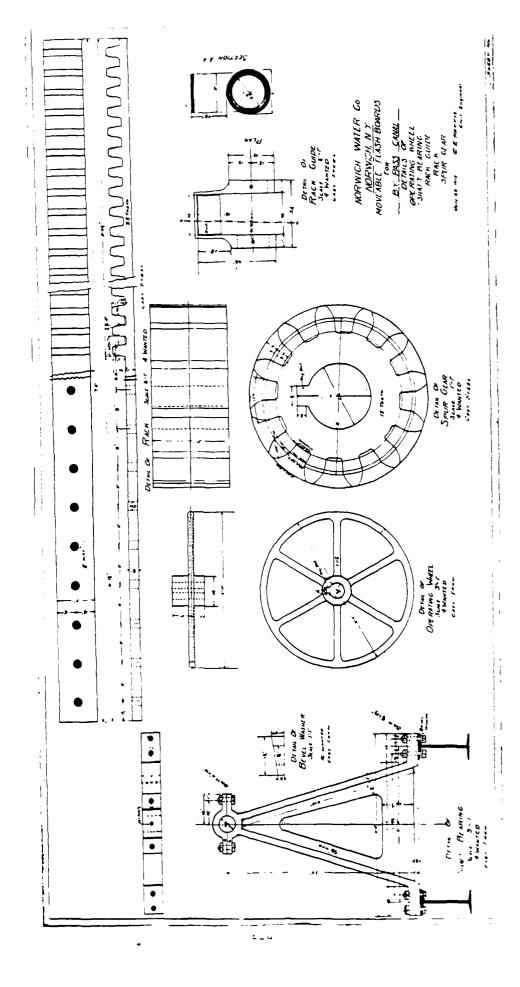

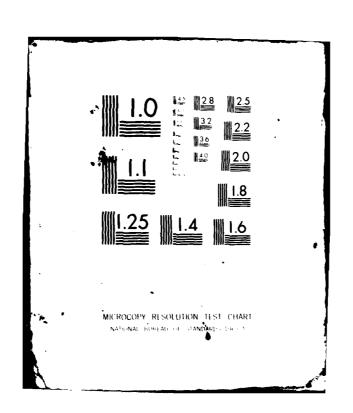

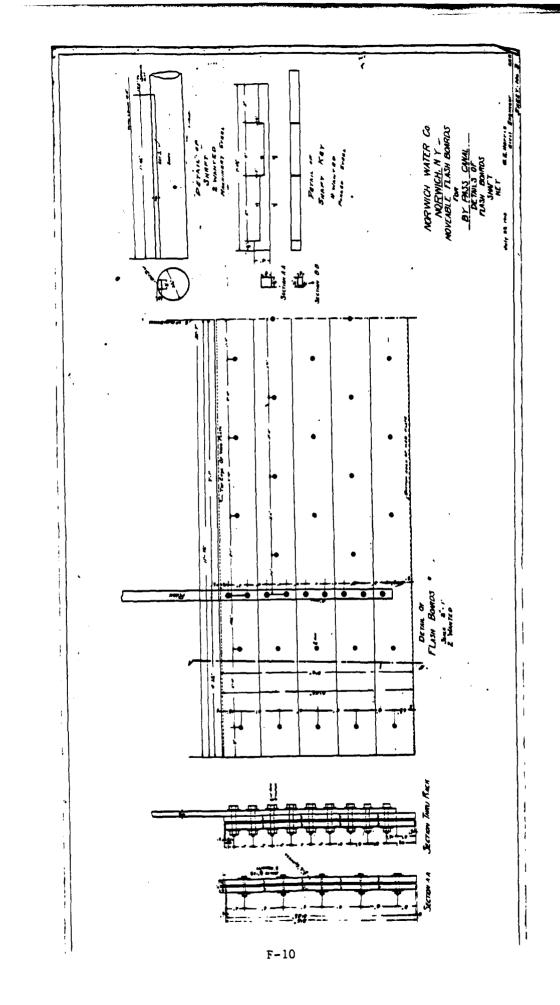

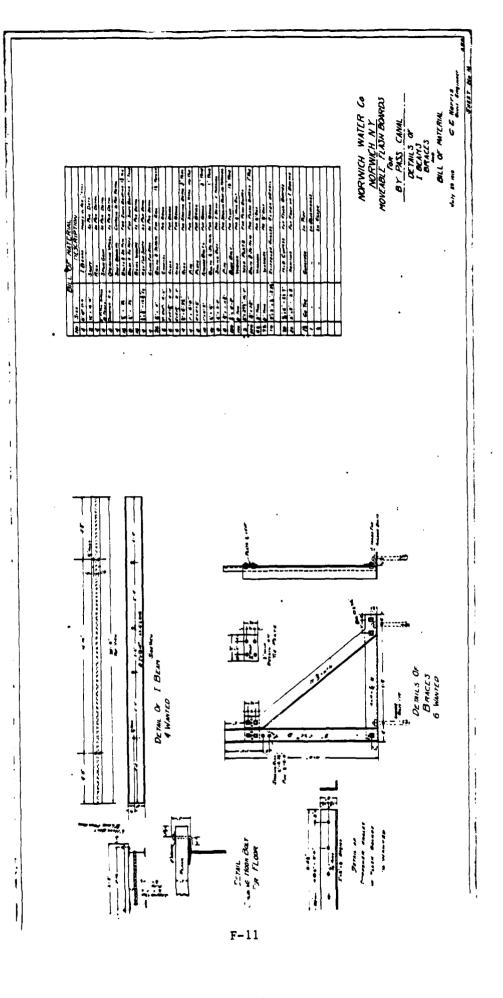

ì

1

